I 29.88:EL 5/V.1/APP.A
Clemson University
3 1604 019 700 436

existing condition survey
main building
volume 1
appendix A

PUBLIC DOCUMENTS
DEPOSITORY ITEM
FEB 22 1989
CLEMSON
LIBRARY

ELLIS ISLAND

STATUE OF LIBERTY

NATIONAL MONUMENT/NEW YORK-NEW JERSEY

Funds for preparation and printing of this document were provided by a donation from the Statue of Liberty/Ellis Island Foundation

ELLIS ISLAND
STATUE OF LIBERTY NATIONAL MONUMENT

EXISTING CONDITION SURVEY
MAIN BUILDING

Volume 1
Appendix A

Prepared by

Beyer Blinder Belle/
Anderson Notter Finegold

U.S. Department of the Interior / National Park Service

Digitized by the Internet Archive
in 2012 with funding from
LYRASIS Members and Sloan Foundation

http://archive.org/details/existingconditio00beye

TABLE OF CONTENTS

PAGE

I. Introduction.....1

II. Survey Methodology

A. Explanation of Forms.....2
B. Definition of Existing Conditions.....4

Floor - Tile.....5
Floor - Vinyl.....6
Floor - Linoleum.....7
Base - Wood.....8
Base - Tile/Tile Wainscot.....9
Walls & Ceilings - Plaster.....10
Walls & Ceilings - Gypsum Board/Glazed Wood Partitions/Acoustic panels.....11
Doors/Openings - Wood/Glass Panelled.....12
Doors/Openings - Wood Veneer.....13
Doors/Openings - Galvanized Metal.....14
Lighting fixtures.....15
Radiators.....16
Plumbing Fixtures.....17

C. Definitions of Architectural Significance.....18

Areas of Most Architectural Significance.....19
Areas of Some Architectural Significance.....20
Areas of Minor Architectural Significance.....21
Areas of Negligible Architectural Significance.....22

III. Plans Depicting Existing Conditions

First Floor.....23
Second Floor.....24
Third Floor.....25

Plans Depicting Architectural Significance

First Floor.....26
Second Floor.....27
Third Floor.....28

IV. Inventory

A. Basement.....29
B. First Floor.....34
C. Second Floor.....199
D. Third Floor.....366

I. INTRODUCTION

INTRODUCTION

This survey provides a definitive record of existing conditions of all interior spaces of the Main Building on Ellis Island as of September 1983. In addition, each space has been evaluated for architectural significance. The survey will be used to assist in the preparation of other studies, including the Historic Structure Report, restoration design proposals, and cost analyses. Observations recorded in this study will also help to identify appropriate design parameters for alternative space utilization proposals.

The results of the survey have been plotted on graphically-coded floor plans that illustrate the relative condition and architectural significance of each space.

This study will be supplemented by similar analyses being made by all the engineering trades and a building materials conservation consultant.

II. SURVEY METHODOLOGY

EXPLANATION OF FORMS

This interior architectural survey of the Main Building consists of a room-by-room analysis of all visually accessible finishes, decorative trim, doors, lighting, plumbing, and heating equipment. A total of 274 survey forms were completed at the site. On these, the room number, last known use, square footage, ceiling height, and date of survey are recorded. The surface materials in each space are described and assessed for their existing condition and approximate date. A summary condition and date has been tabulated based on this information. In cases where sizable portions of the room are from different periods, more than one date has been given. Rooms are also evaluated for relative architectural significance within the building. Photographs of each room supplement the written description; however, in some instances photographic coverage was limited due to the accumulation of debris. Additional photography will supplement this report at a later date.

Room identification numbers generally follow the numbering system currently existing in the building. This system was developed in 1978 by The Ehrenkrantz Group, P.C. Occasionally numbers were assigned, for the purpose of this survey, by adding letters after room numbers, i.e., Room 322 A, B, etc.; in other cases, unnecessary room numbers were deleted. For reference, each series of survey forms is preceded by a floor plan identifying all room numbers, as revised.

The definition of square footage used for calculations was the area of each room measured from the inside edge of the exterior and/or principal walls in each space, including both structural and non-structural interior walls.

Survey forms are in numerical sequence for each floor and are followed by forms for the hallways (numbers preceded by an "H"). Forms for all interior stairs (numbers preceded by an "S") are located in the last section of the report. Some minor stairs have simply been noted on the same form as an adjacent hallway.

DEFINITION OF EXISTING CONDITIONS

The condition of each space has been evaluated according to criteria that were specifically developed for the Main Building on Ellis Island. A range of conditions was defined for each material in the building following careful field inspection. The condition of a finish was evaluated relative to other similar finishes in this building using the standard terms "good", "fair", "poor", and "destroyed". Since the Main Building has experienced extensive deterioration no surfaces or fixtures were considered to be in "excellent" condition. In borderline cases, the more deteriorated condition was selected. It has been noted where the survey of a room or parts of a room were made difficult or impossible by debris accumulation.

Following are definitions of the criteria that were used in the existing condition survey of the Main Building. Items are discussed in the order that they appear on the forms.

FLOOR
Tile

GOOD

85-100% intact. Very few, if any, cracks in tile. Minor discoloration. Retiling noticeable in places.

FAIR

60-85% intact. Some cracks in localized areas. Some tiles missing.

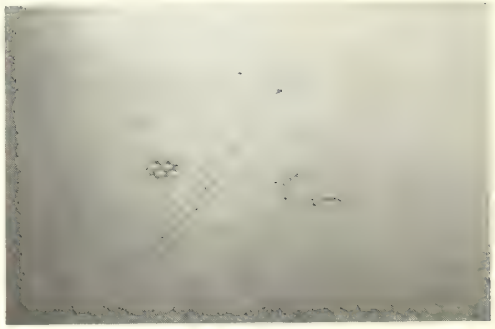

POOR

30-60% intact. Large cracks. Large areas missing.

DESTROYED

0-30% intact. Material is completely missing or is destroyed beyond practical retrieval.

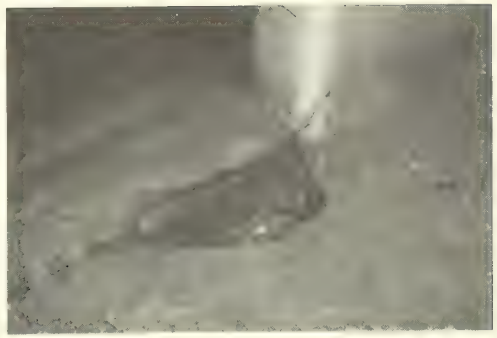

FLOOR
Vinyl

GOOD

85-100% intact. Squares in place, adhered to floor, not broken.

FAIR

60-85% intact. Some squares broken, some buckling, some adhesive failure. Sections of wood floor exposed.

POOR

30-60% intact. Significant number of squares are missing, broken, buckling, loose, no longer adhered.

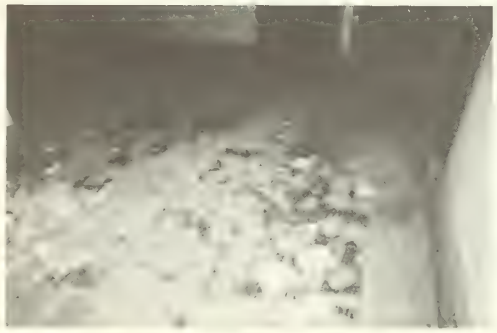

DESTROYED

0-30% intact. Material is completely missing or is destroyed beyond practical retrieval.

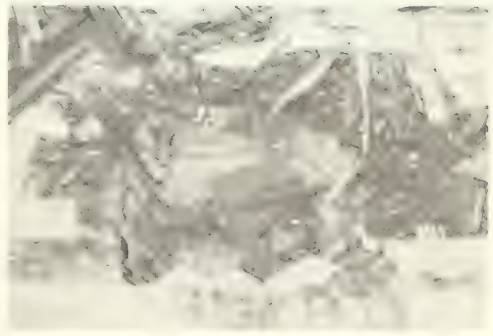

FLOOR

Linoleum

GOOD

85-100% intact. Little or no cracking or buckling. No material missing.

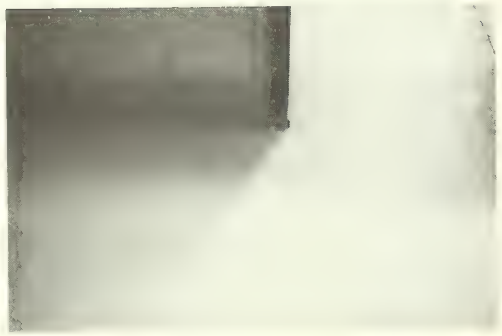

FAIR

60-85% intact. Some material missing. Cracked into sections. Some buckling.

POOR

30-60% intact. Significant amount of material missing. Extensive cracking, buckling, and spalling of material.

DESTROYED

0-30% intact. Material is completely missing or is destroyed beyond practical retrieval.

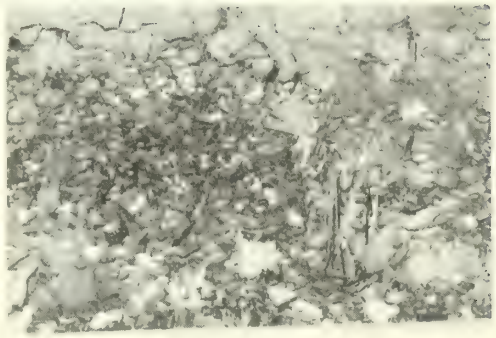

BASE
Wood

GOOD

90-100% intact. Still joined to wall. Minor deterioration of paint surface.

FAIR

75-90% intact. Separated from wall in limited areas. Some deterioration in localized areas (generally along window).

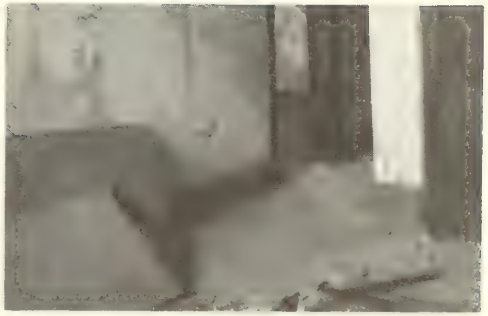

POOR

20-75% intact. Complete separation from wall. Serious deterioration (generally under windows).

DESTROYED

Material is completely missing or is destroyed beyond practical retrieval.

BASE
Tile / Tile Wainscot

GOOD

85-100% intact. Few or no cracks forming. Minimum number of tiles missing.

FAIR

60-85% intact. Some cracks in localized areas. Some tiles missing.

POOR

30-60% intact. Large areas missing, sizable cracks present.

DESTROYED

0-30% intact. Material is completely missing or is destroyed beyond practical retrieval.

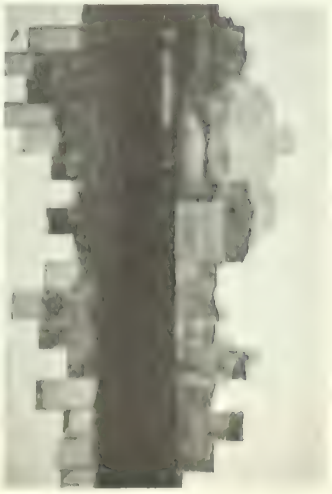

WALLS & CEILINGS
Plaster

GOOD

70-100% intact. Minor surface spalling, cracking and peeling of paint.

FAIR

50-70% intact. Substantial surface spalling, cracking and peeling of paint. Unit masonry and/or basecoat exposed in certain areas.

POOR

20-50% intact. Majority of plaster is severely cracked with buckling and spalling. Exposure of significant areas of base surface.

DESTROYED

0-20% intact. Material is completely missing or is destroyed beyond practical retrieval.

WALLS & CEILINGS
Glazed Wood Partitions / Gypsum Board / Acoustic Panels

GOOD

85-100% intact. Minor surface damage including scrapes, knicks and peeling of paint.

FAIR

50-70% intact. Small holes and cracks. Some missing material. Glass missing.

POOR

20-50% intact. Large holes and cracks. Major amount of missing material.

DESTROYED

0-20% intact. Material is completely missing or is destroyed beyond practical retrieval.

DOORS / OPENINGS
Wood / Glass Panelled

GOOD

Wood, glass, and hardware intact. Minor peeling of paint. Minor surface knicks and scrapes.

FAIR

Hardware intact, part may be missing. Minor warping of doors. Deteriorated paint finish and/or surface damage.

POOR

Severe wood damage, i.e., splitting and missing elements. Glass broken or missing. Extensive deterioration.

DESTROYED

Door is missing or is destroyed beyond practical retrieval.

DOORS / OPENINGS
Wood Veneer

GOOD

Wood and hardware intact, no splitting.

FAIR

Minor splitting and/or delamination. Finish and hardware may have minor deterioration.

POOR

Hardware missing. Severe splitting and/or delamination.

DESTROYED

Door is missing or is destroyed beyond practical retrieval.

DOORS / OPENINGS
Galvanized Metal

GOOD

Minor peeling of paint finish. Hardware intact.

FAIR

Deteriorated paint finish. Small dents to surface. Hardware may have minor damage.

POOR

Deteriorated paint finish. Severe corrosion to surface. Bad dents. Hardware badly damaged or missing.

DESTROYED

Door is missing or is destroyed beyond practical retrieval.

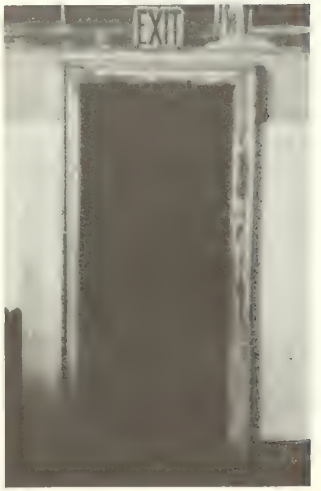

LIGHTING FIXTURES

Note: The evaluation of lighting fixtures is based on physical appearance only and does not consider whether the fixture is still functioning.

GOOD

Principle fixture elements are intact. Globe and sometimes shade are extant. Little or no corrosion.

FAIR

Shade without globe is extant. Fixture is partially corroded.

POOR

Broken globe, damaged shade, severe corrosion.

DESTROYED

Fixture is missing or is destroyed beyond practical retrieval.

RADIATORS

Note: Evaluation is based on external appearance only and does not consider whether the radiator is still functioning.

GOOD

Minor surface corrosion, some paint peeling.

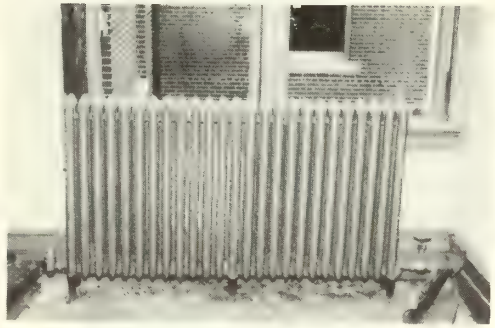

FAIR

Moderate surface corrosion.

POOR

Severe surface corrosion, broken or cracked metal.

DESTROYED

Radiator is missing or is destroyed beyond practical retrieval.

PLUMBING FIXTURES

GOOD

Porcelain intact. Toilets with toilet seats. All fittings extant.

FAIR

Porcelain intact. Some staining may be present. Toilet seats, faucets and other fittings may be missing.

POOR

Chipped or cracked porcelain. Missing hardware.

DESTROYED

Fixtures and fittings are missing or are destroyed beyond practical retrieval.

ARCHITECTURAL SIGNIFICANCE

A range of significance for spaces within the Main Building was developed for existing architectural spaces in the structure. The ranking of spaces for architectural significance is relative to the specific architectural context of this building. Certain factors were considered in evaluating the spaces:

- Volume, size, monumentality, proportions
- Quality of materials and workmanship
- Overall design
- Uniqueness of the design, rare features.

In borderline cases, the higher level of significance was selected.

Graffiti was uncovered in various locations throughout the building. Its existence is noted on the survey forms. However, graffiti is considered to be of cultural rather than architectural significance and has not been considered in the evaluations.

Following is a brief discussion of the criteria:

MOST ARCHITECTURAL SIGNIFICANCE

The classification of "Most Architectural Significance" was assigned to spaces which have the greatest architectural character in the building. Such spaces generally exhibit monumental proportions and their design, materials, and workmanship are of a high quality. They are often unique volumes. An example is the Registry Room (Rm. #231) characterized by its two-story elevation, Guastavino vaulting, balconies, and arched windows.

SOME ARCHITECTURAL SIGNIFICANCE

The classification of "Some Architectural Significance" was assigned to spaces which have a moderate amount of architectural character. Volume, size, monumentality, and proportions may distinguish them from the more common and generally smaller spaces in the building. Careful attention was given to the use of materials and the execution of details. An example is Room 108, a first-floor office with a high cove ceiling, octagonal columns, arched windows and a terrazzo floor.

MINOR ARCHITECTURAL SIGNIFICANCE

The classification of "Minor Architectural Significance" was assigned to spaces which exhibit few architectural pretensions. Materials and workmanship are standard. Volume and proportions are relatively undistinguished. Rooms are common for their type. An example is Room 361, an office on the third floor east wing with painted plaster walls and ceiling surfaces, a vinyl floor and no decorative details.

NEGLIGIBLE ARCHITECTURAL SIGNIFICANCE

The classification "Negligible Architectural Significance" was assigned to spaces which have no architectural character. They are often very small and of standard materials and design. An example is Room 359A, a small lavatory.

III. PLANS DEPICTING EXISTING CONDITIONS

PLANS DEPICTING ARCHITECTURAL SIGNIFICANCE

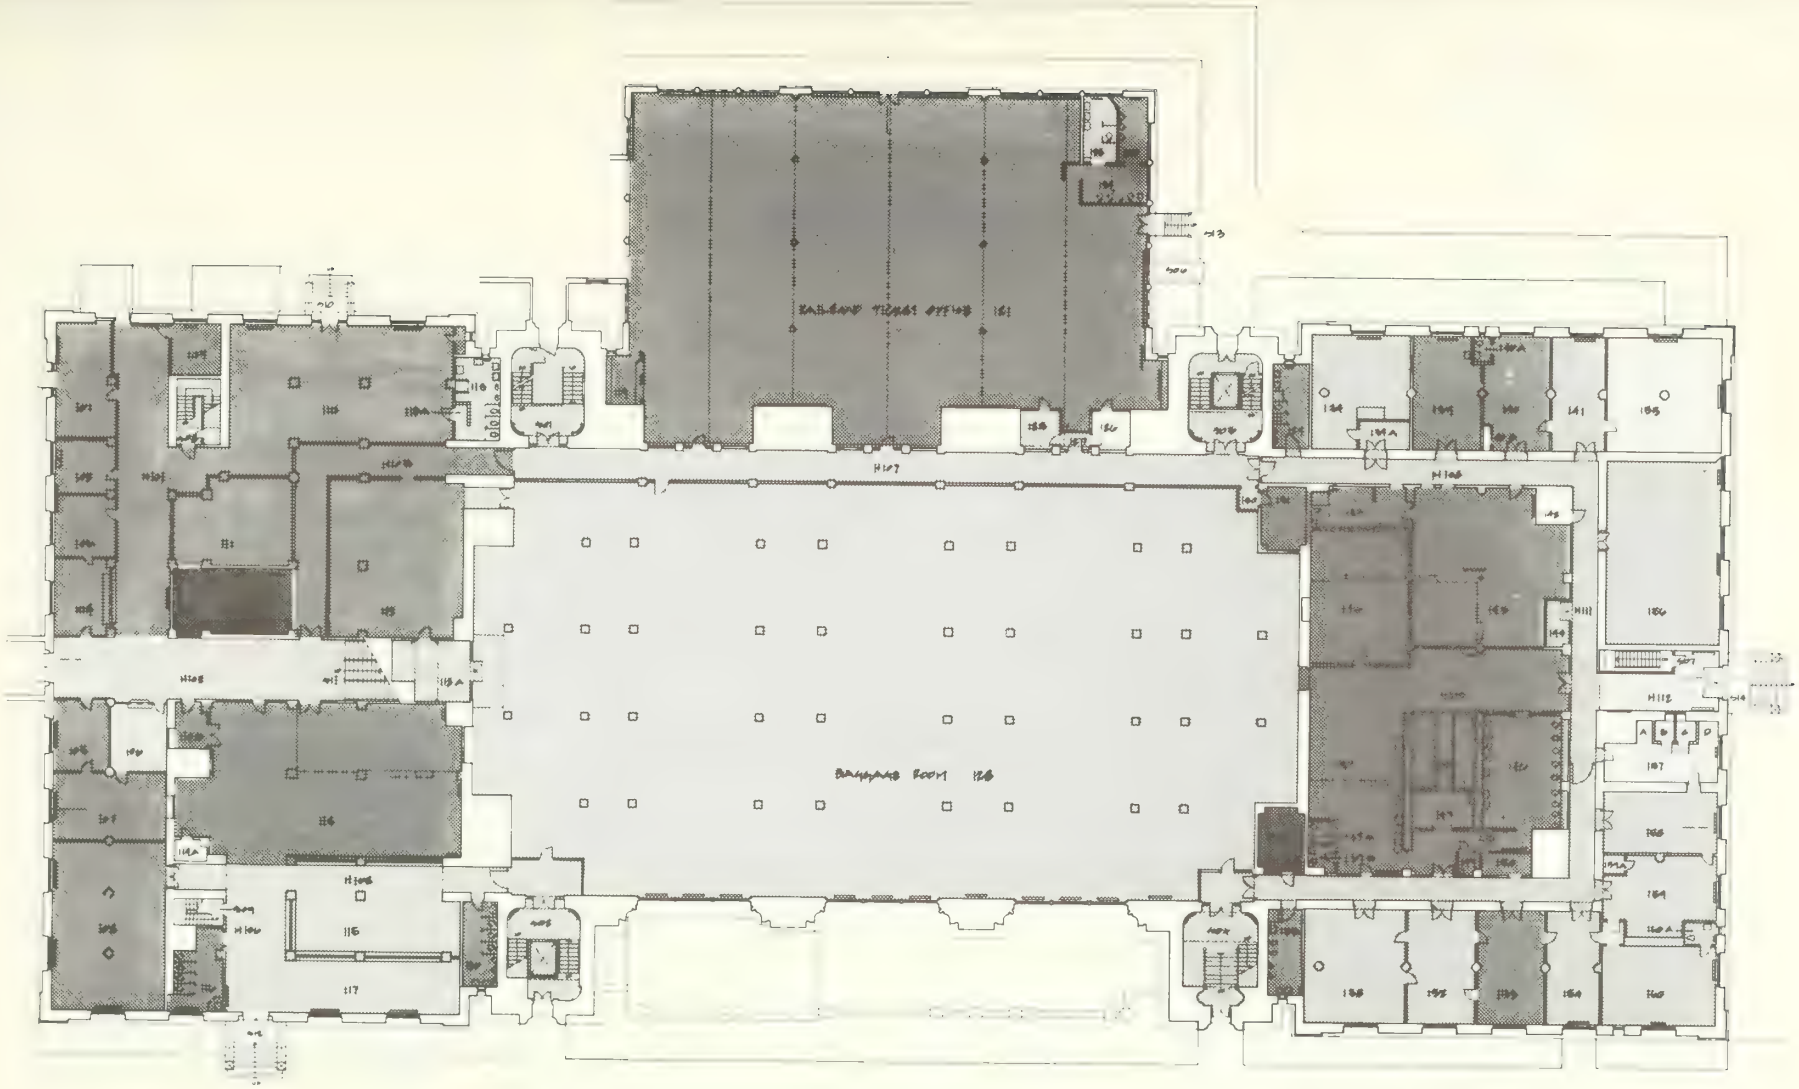

FIRST FLOOR PLAN

EXISTING CONDITION

- GOOD
- FAIR
- POOR
- DESTROYED

356	26,003 / 1 of 9
DSC	JUL 88

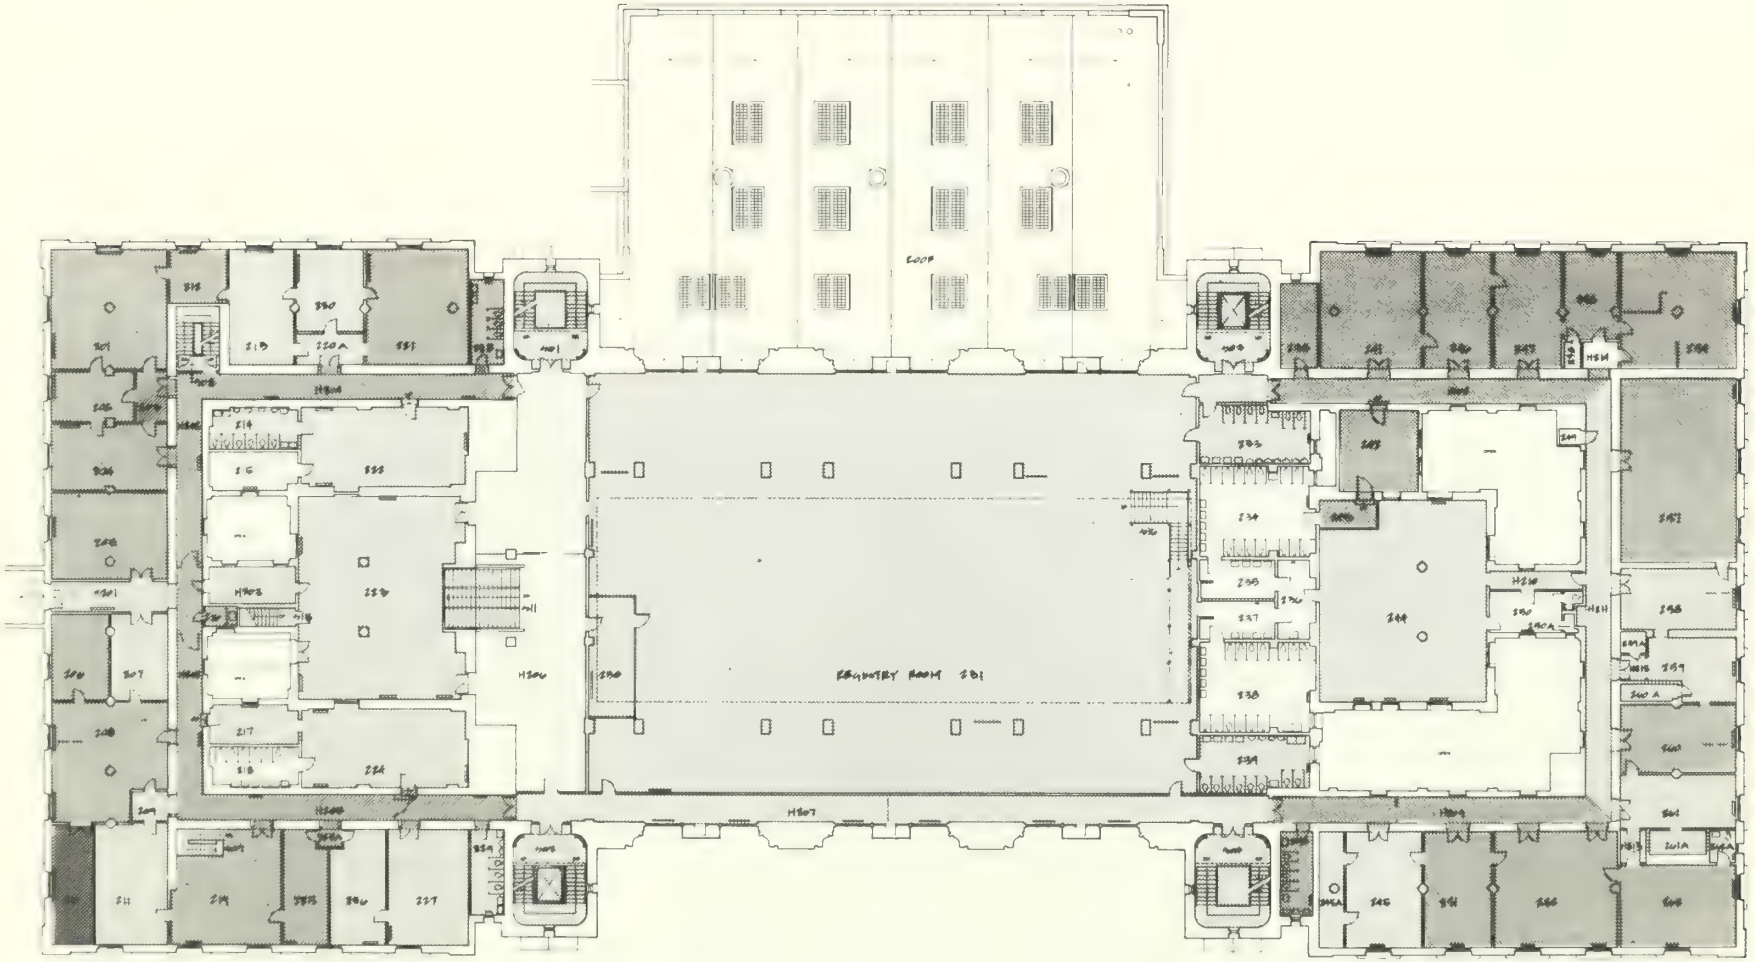

SECOND FLOOR PLAN

EXISTING CONDITION

GOOD

FAIR

POOR

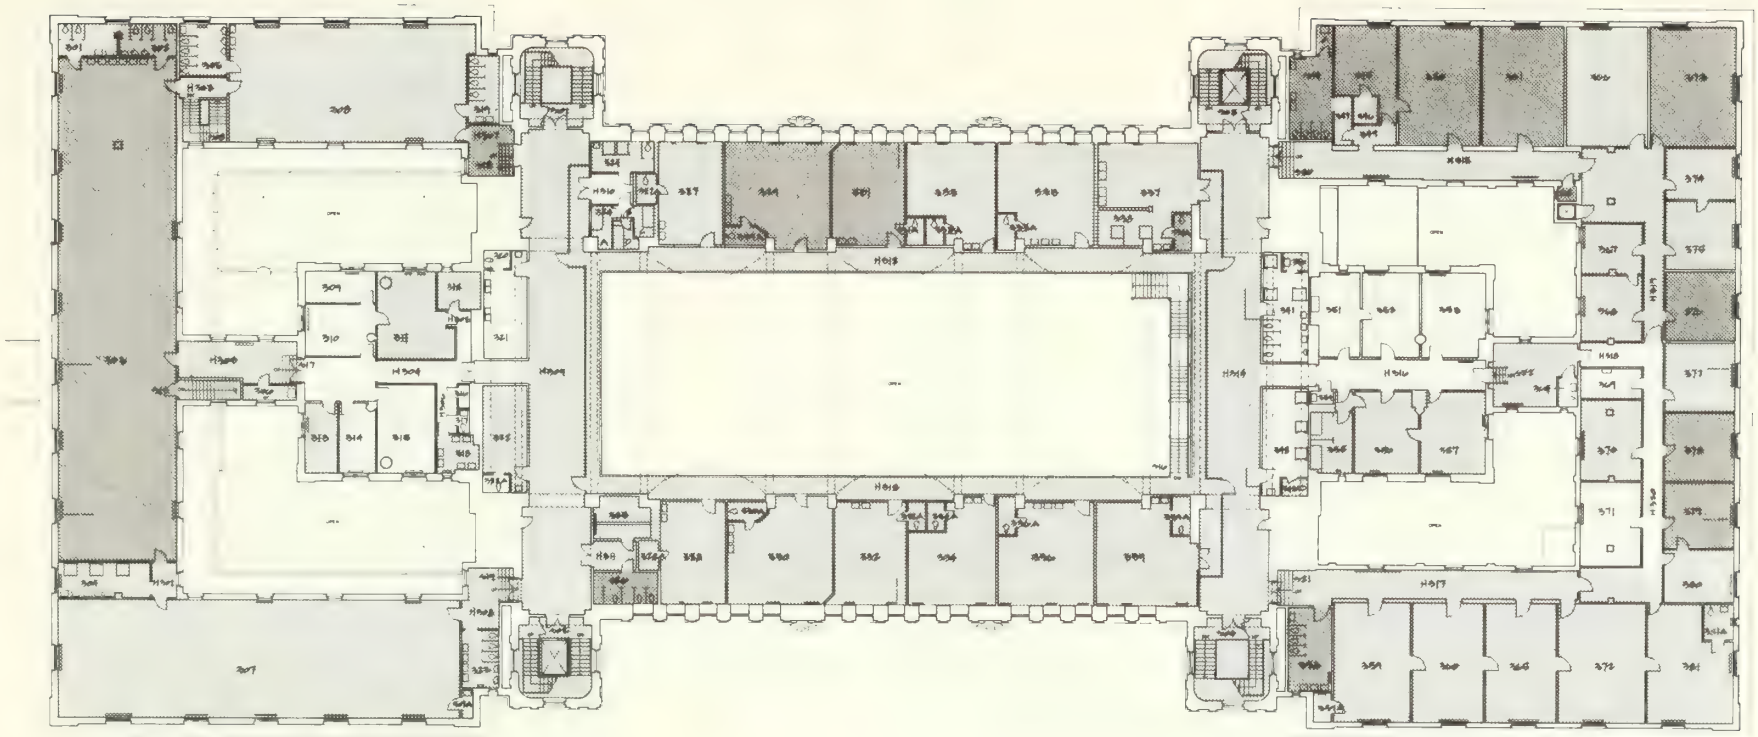

THIRD FLOOR PLAN

EXISTING CONDITION

- GOOD
- FAIR
- POOR
- DESTROYED

356	26,003 / 3 of 9
DSC	JUL 88

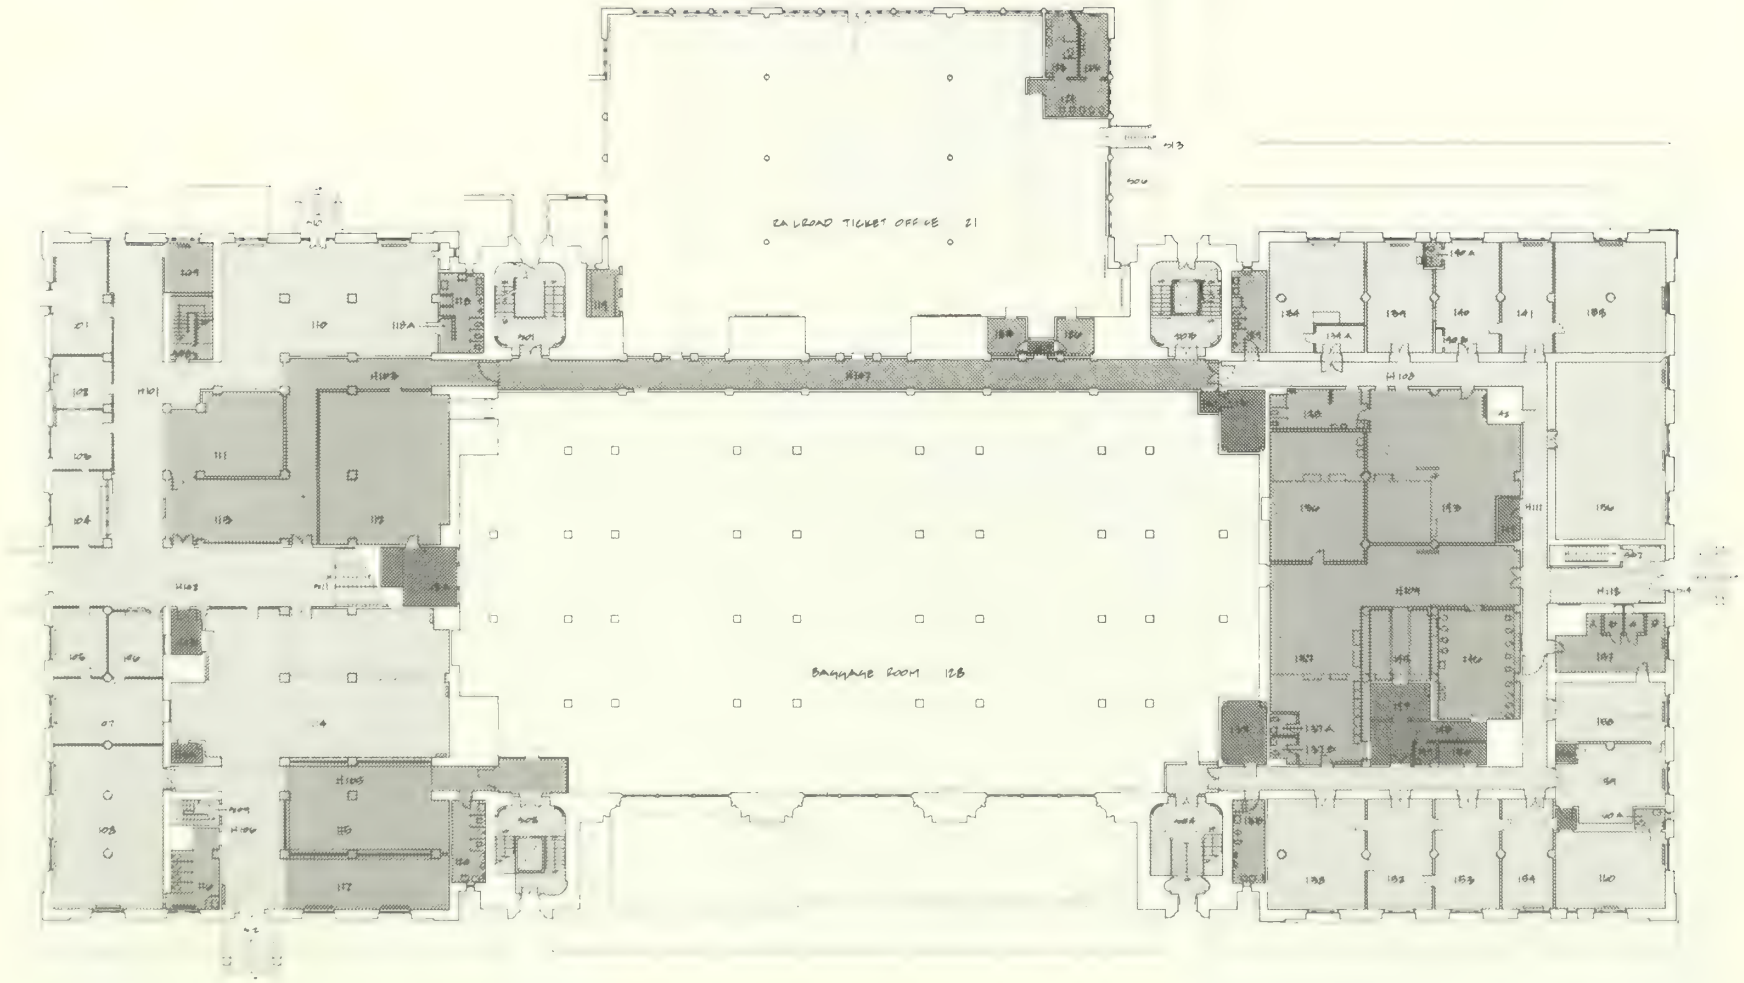

FIRST FLOOR PLAN

ARCHITECTURAL SIGNIFICANCE

- MOST
- SOME
- MINOR
- NEGLIGIBLE

356	26,003 / 4 of 9
DSC	JUL 88

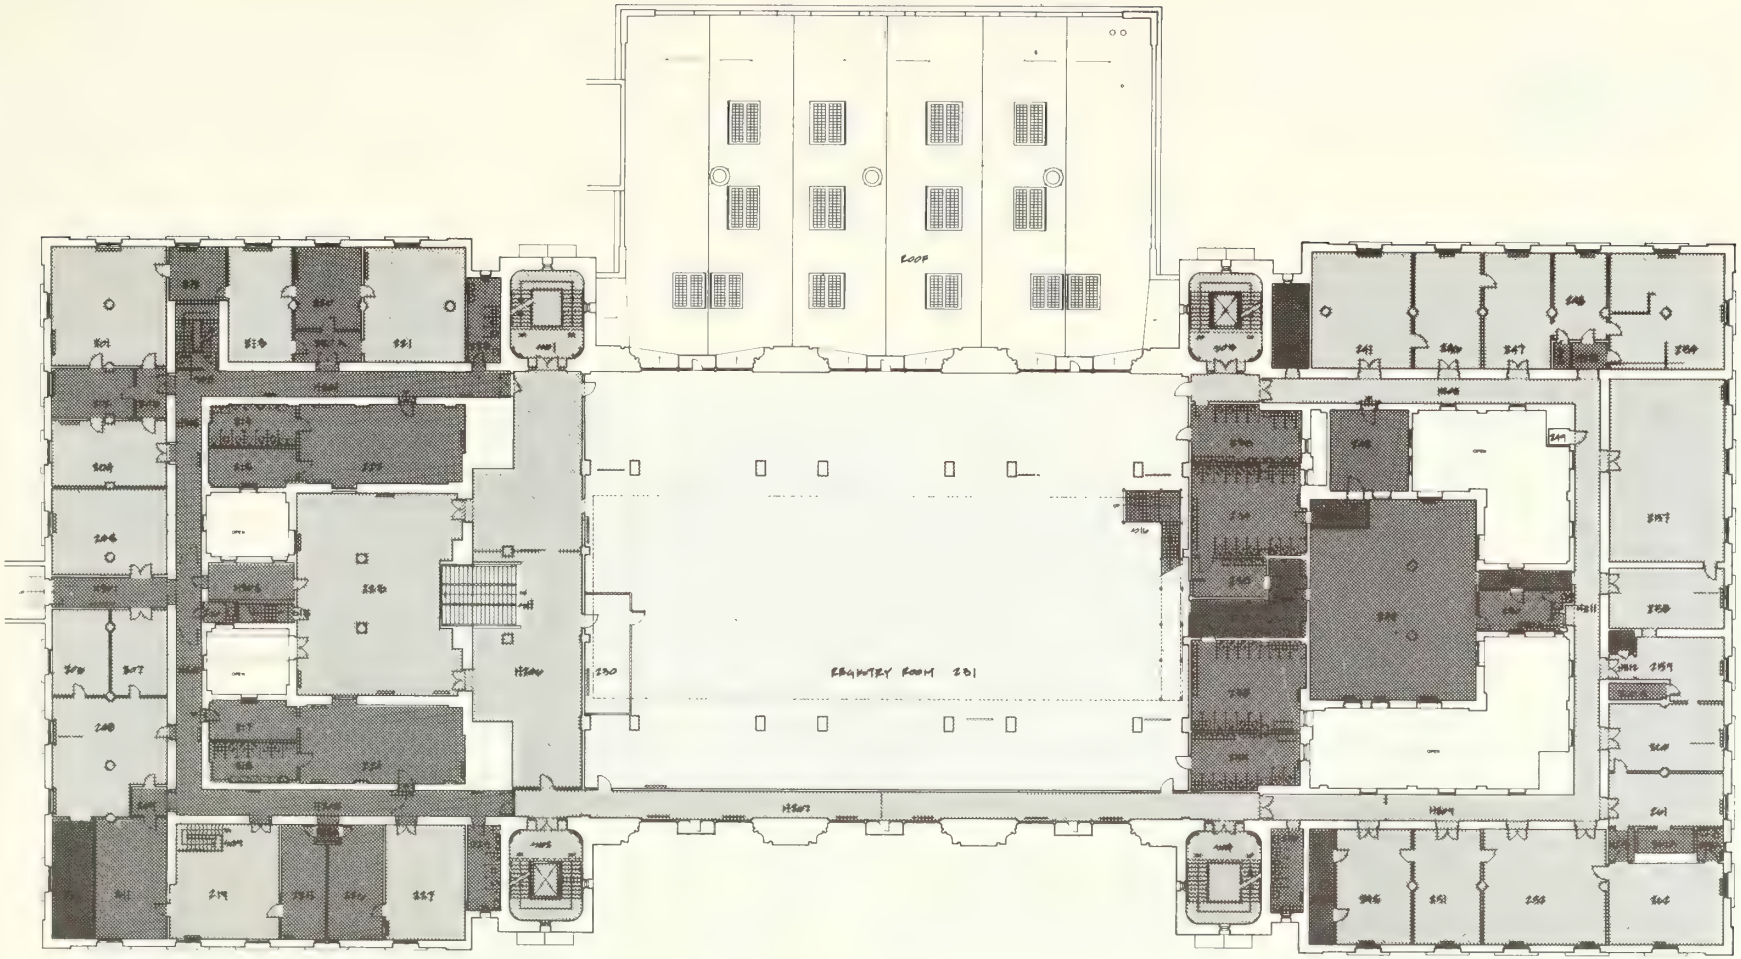

SECOND FLOOR PLAN

356	26,003 / 5 of 9
DSC	JUL 88

ARCHITECTURAL SIGNIFICANCE

- MOST
- SOME
- MINOR
- NEGLIGIBLE

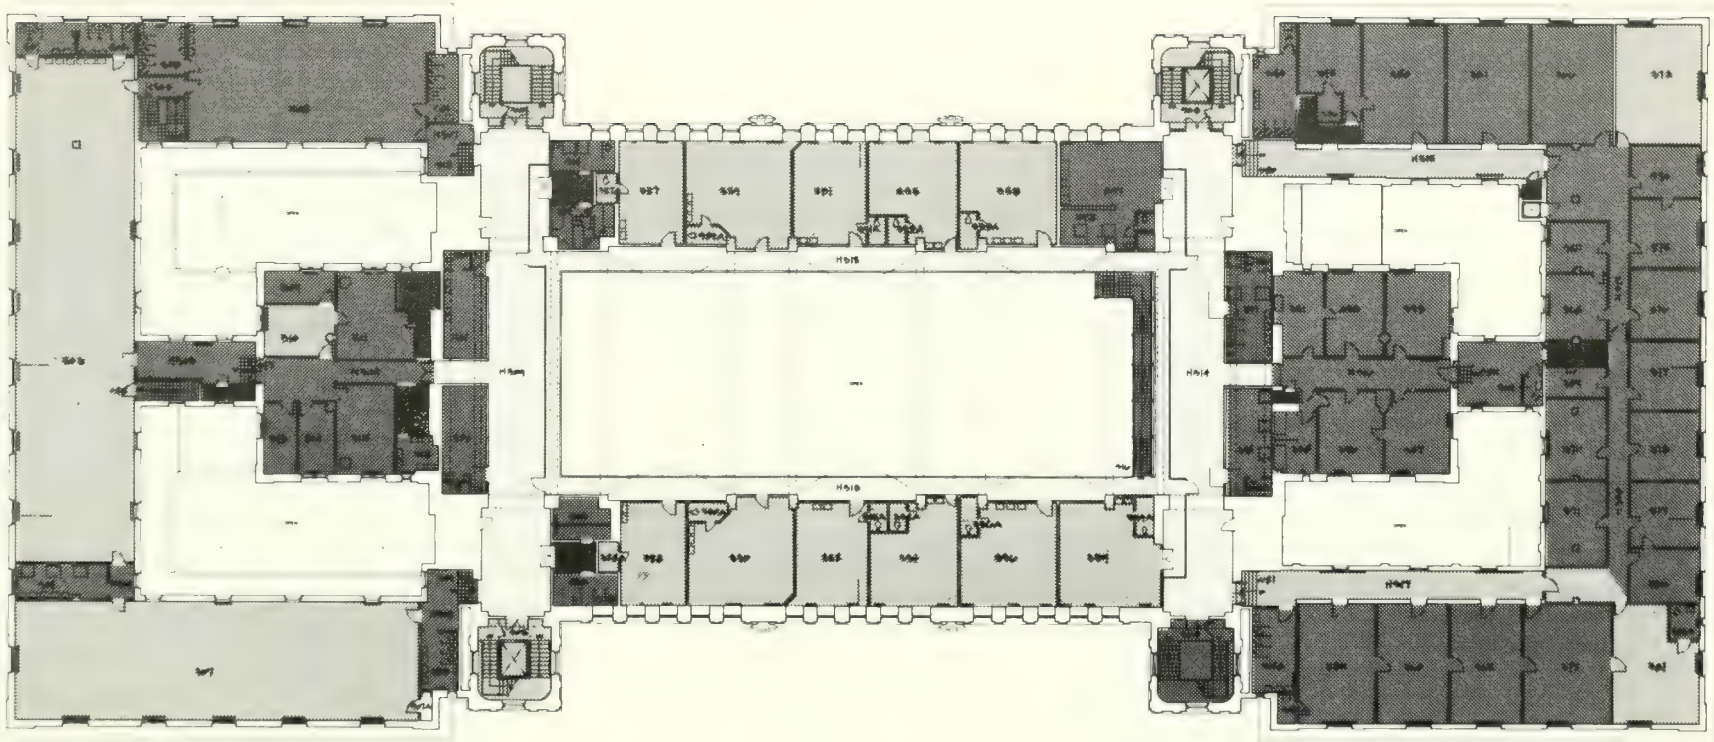

THIRD FLOOR PLAN

ARCHITECTURAL SIGNIFICANCE

- MOST
- SOME
- MINOR
- NEGLIGIBLE

356	26,003 / 6 of 9
DSC	JUL 88

IV. INVENTORY

A. BASEMENT

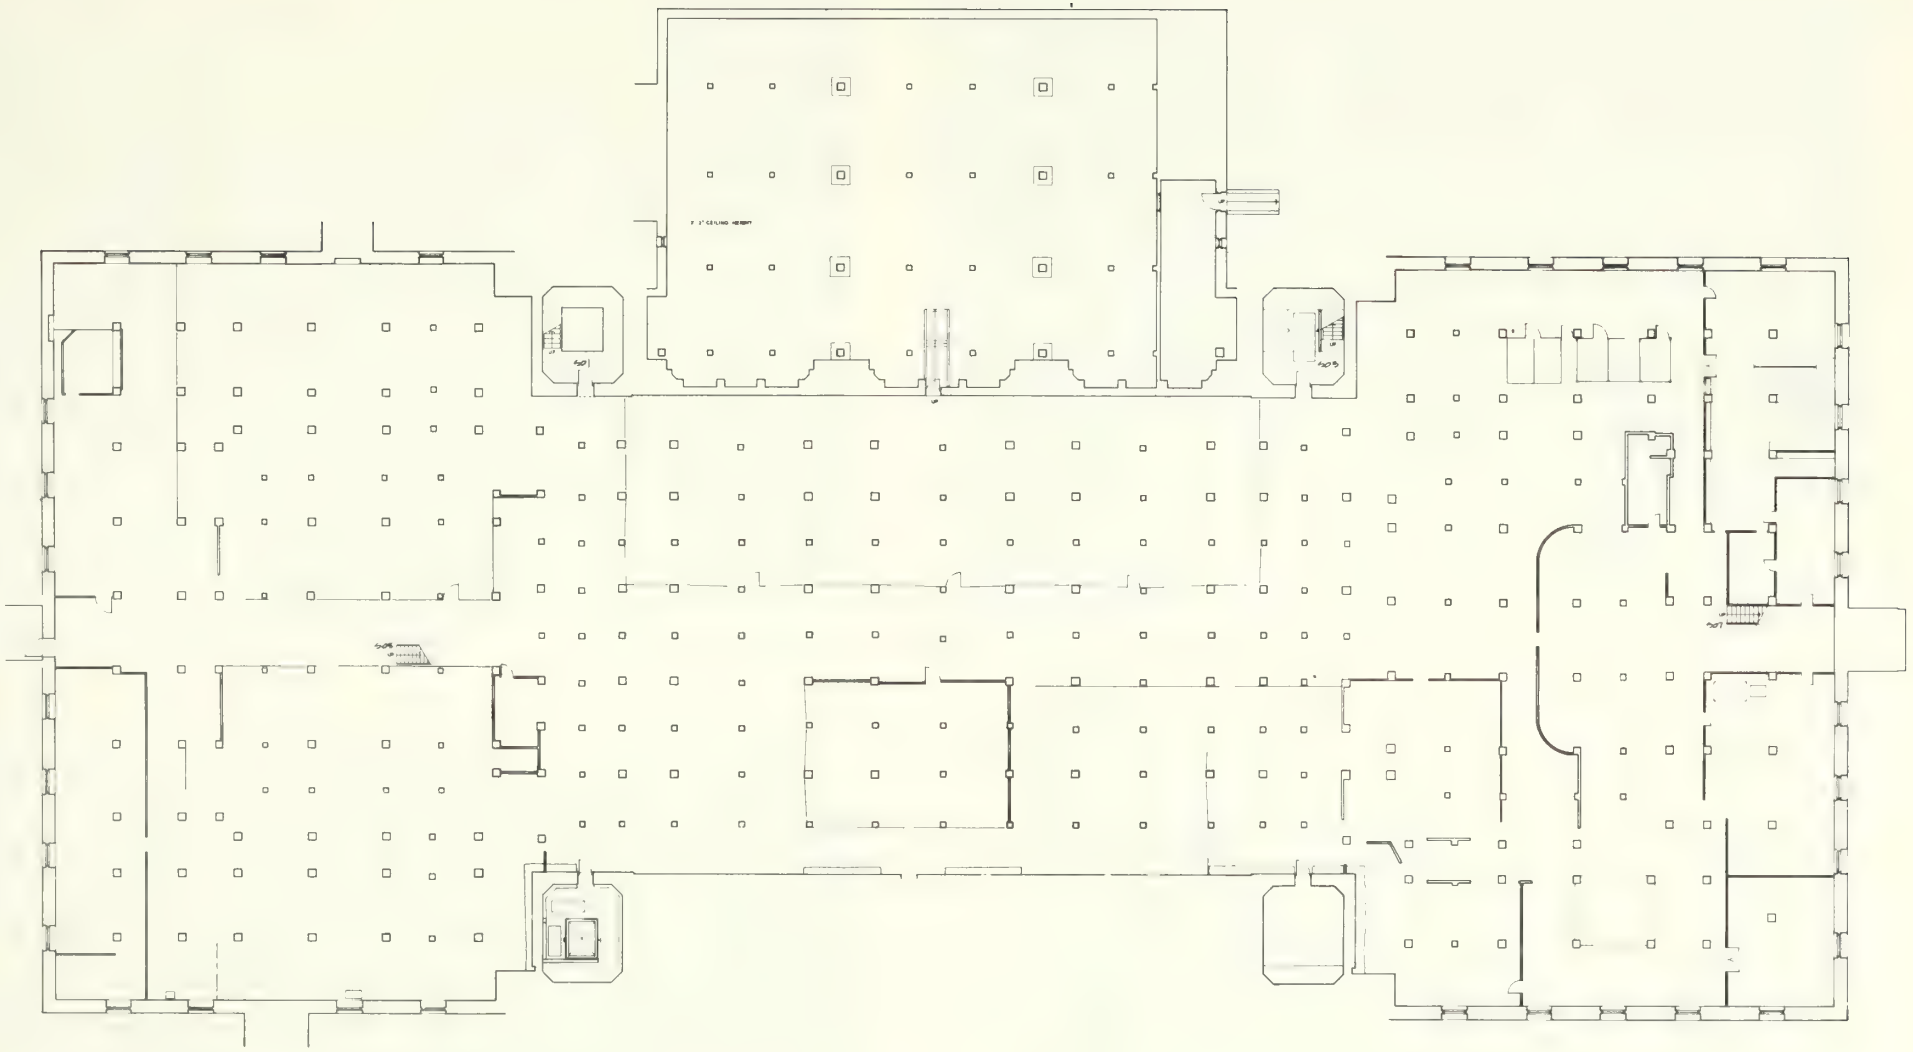

'AS FOUND' DRAWING

BASEMENT PLAN

356	26,003 / 7 of 9
DSC	JUL 88

ROOM NO: Basement LAST KNOWN USE Storage, Mechanical SQUARE FEET: 50,745 s.f. CEILING HEIGHT: 7'-10" DATE: 23 Sept. 1983

DESCRIPTION:

The basement has square brick columns, a concrete floor, & a low ceiling. Various spaces have been created for mechanical equipment, storage and work rooms. Areas have been partitioned with wood & chain link fence. Prisoners' cells are also located in the basement. Pipes & wiring run along most of the ceiling. Stair 05 has been closed up with terracotta blocks. The only access is via Stair 07 at the east end of the first floor. A crawl space exists under the Railroad Ticket Office.

CONDITION:

The walls, floor & ceiling appear to be in fair condition.

		Good	X	1900-1906			Most

PHOTOGRAPHS: 1. East wing, view west; Stair 07 at right. 2. Room in northeast corner, view northeast. 3. Cell, east wing. 4. West wing, view north.

ROOM NO. Basement

PHOTOGRAPHS: 5. West wing, view northwest
6. Room in northwest corner, view north
7. Crawl space under Railroad Ticket Office, view north.

ROOM NO. Basement

B. FIRST FLOOR

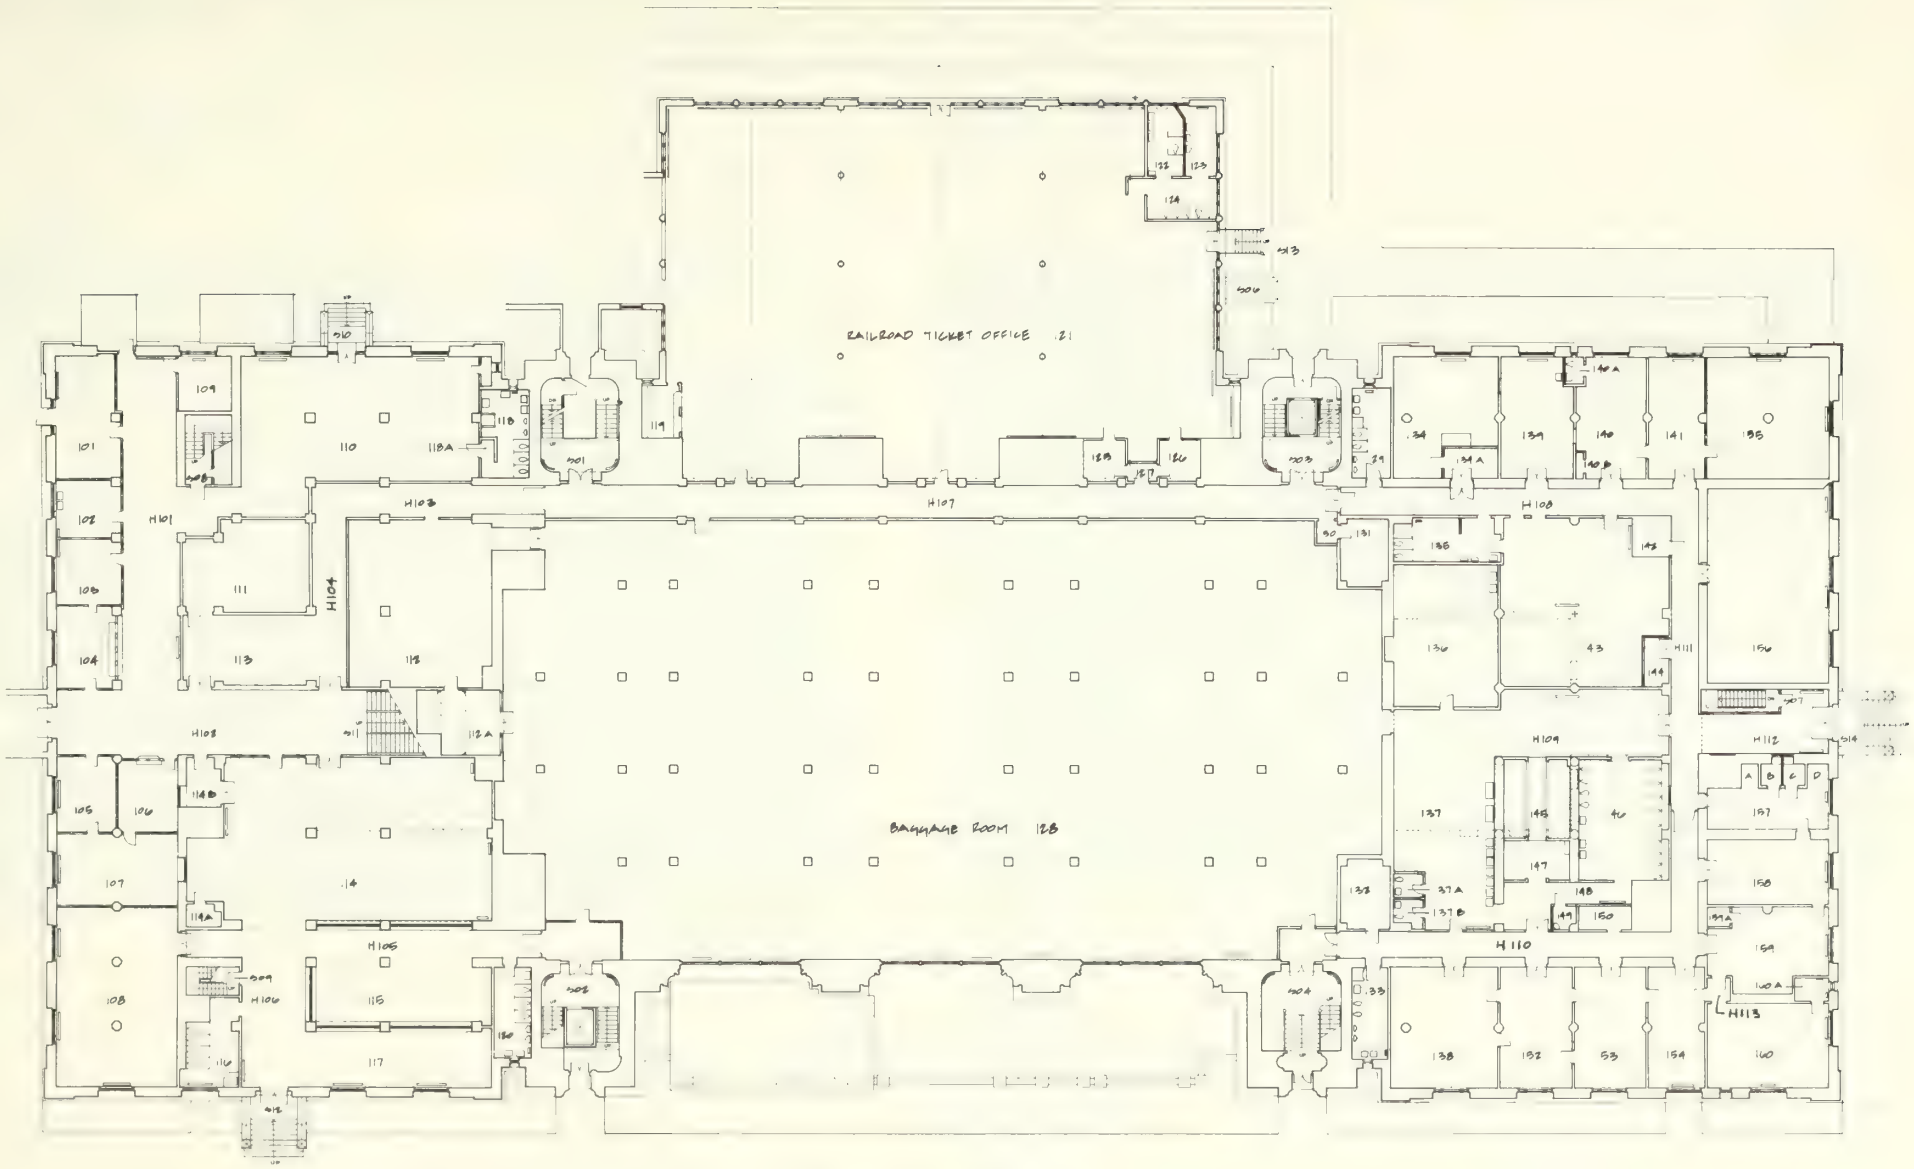

'AS FOUND' DRAWING

FIRST FLOOR PLAN

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 35

ROOM NO: 101 LAST KNOWN USE: Office, W.P.A. SQUARE FEET: 371 s.f. CEILING HEIGHT: 18'-5½" DATE: 19 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [X] Other: Concrete	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Red tile on e. side of room - 6"Sq. + 6"x9".
BASE:	[X] Wood [ ] Tile [X] Tile Wainscot [X] Other: Composition	[X] Good Wood, Tile [ ] Fair [ ] Poor [X] Destroyed Composition	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	Wainscot on column 85"h.
WALLS:	[X] Plaster [ ] Gypsum Board [X] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	E. wall - 8'6" partition S. wall - 7' partition 2 broken lights. part of cordice on partitions missing. Veneer buckling.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Doorknob missing.
LIGHTING:	[ ] Incandescent [ ] Fluorescent [X] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents Fans [ ] Fixtures [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY:	F B W C			**ARCHITECTURAL SIGNIFICANCE:**
	○ ○ ○ ○	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	[ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: (1) View northwest of Rm.101 from H101 (2) View north

ROOM NO. 101

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 37

ROOM NO: 102 LAST KNOWN USE: Office, W.P.A. SQUARE FEET: 168 s.f. CEILING HEIGHT: 18'-5½" DATE: 19 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [X] Other: Concrete	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Red tile on e. side of room - 6"sq's + 6"x9"
BASE:	[X] Wood [ ] Tile [X] Tile Wainscot [X] Other: Composition	[X] Good Wood, Tile [ ] Fair [ ] Poor [X] Destroyed Composition	[X] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	
WALLS:	[X] Plaster [ ] Gypsum Board [X] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor Wood Partitions [X] Destroyed Plaster	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	E. wall is 8'6"h partition. S. wall - 7'h. partition.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents Fans [ ] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	radiator 2 sinks
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ F ○ B ○ W ○ C	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: (1) View of Rm. 102 from H101, view west (2) View west (3) View southeast ROOM NO. 102

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 39

ROOM NO: 103 LAST KNOWN USE: Office, W.P.A. SQUARE FEET: 196 s.f. CEILING HEIGHT: 18'-5½" DATE: 19 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [ ] Vinyl [X] Linoleum [ ] Other:	[ ] Good [X] Fair DEBRIS [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
BASE:	[X] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	Wainscot - 85" h. Wood - 6" h.
WALLS:	[X] Plaster [ ] Gypsum Board [X] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	E. wall - 8'6" h. partition. S. wall - 7' h. partition. Broken light; s. wall is falling over. SW. corner - section of wall removed for drainpipe.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Missing doorknob.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Fixtures [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY:	○ F ○ B ○ W ○ C	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	**ARCHITECTURAL SIGNIFICANCE:**	[ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: (1) View of Rm. 103 from H101, view west (2) View west

ROOM NO. 103

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 41

ROOM NO: 104 LAST KNOWN USE: Post office SQUARE FEET: 225 s.f. CEILING HEIGHT: 18'-5½" DATE: 19 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [X] Linoleum [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Red tile on s. side of room - 6"sq. + 6"x9".
BASE:	[X] Wood [ ] Tile [X] Tile Wainscot [X] Other: Black Composition	[X] Good Wood, Tile [ ] Fair [X] Poor Composition [ ] Destroyed	[X] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	
WALLS:	[X] Plaster [ ] Gypsum Board [X] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor Wood [X] Destroyed Plaster	[X] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	N.+S. walls - 7' partitions. E. Wall - 8'6" partition. N. wall - falling over. Missing glass Veneer buckling.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [X] Other: Teller windows	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Teller windows on e. wall.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[X] Good 1 [X] Fair 1 [ ] Poor [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	2 fixtures - 1 w/ shade + globe 1 w/ shade + broken globe Blue globes.
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Fixtures [X] Other: Fan Shelf	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [X] In Question	
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY:	○ F ○ B ○ W ○ C	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	**ARCHITECTURAL SIGNIFICANCE:**	[ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: (1) View of Rm.104 from H101, viewwest (2) View northeast ROOM NO. 104

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 43

ROOM NO: 105 LAST KNOWN USE: Welfare Office SQUARE FEET: 200 s.f. CEILING HEIGHT: 18'-5½" DATE: 20 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [ ] Vinyl [ ] Linoleum [X] Other: Terrazzo	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [X] Other: Terrazzo	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	6"h.
WALLS:	[X] Plaster [ ] Gypsum Board [X] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	cast plaster molding at n. end of W. wall.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [X] Fair 1 [ ] Poor [X] Destroyed 1	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	1 shade w/ broken globe 1 destroyed
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ F ○ B ○ W ○ C	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: (1) View southeast

ROOM NO. 105

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 45

ROOM NO: 106 LAST KNOWN USE: Welfare Office SQUARE FEET: 195 s.f. CEILING HEIGHT: 18'-5½" DATE: 20 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [ ] Vinyl [ ] Linoleum [X] Other: Terrazzo	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [X] Other: Terrazzo	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	6"h.
WALLS:	[X] Plaster [ ] Gypsum Board [X] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair Plaster [X] Poor Wood Partitions [ ] Destroyed	[X] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	N.+S. walls - 8'6"h partitions. W. wall - 7'h. partition Glass missing ; cornice missing Mechanically pulled plaster dado molding, s. end of e. wall Teller-like windows, counter on n. wall.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~ Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	Window on e. wall.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[X] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	1 fixture w/ globe + shade 1 fixture w/ shade/no globe
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents / Fans [ ] Fixtures [X] Other: None	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:	[ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY: ○ F ○ B ○ W ○ C

[X] Good
[X] Fair
[ ] Poor
[ ] Destroyed

[X] 1900-1906
[ ] 1907-1923
[X] 1924-Present
[ ] In Question

ARCHITECTURAL SIGNIFICANCE:

[ ] Most
[X] Some
[ ] Minor
[ ] Negligible

PHOTOGRAPHS: (1) View Southwest (2) View northeast ROOM NO. 106

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 47

ROOM NO: 107 LAST KNOWN USE: Welfare Office SQUARE FEET: 390 s.f. CEILING HEIGHT: 18'-5½" DATE: 20 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [ ] Vinyl [ ] Linoleum [X] Other: Terrazzo	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [X] Other: Terrazzo	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
WALLS:	[X] Plaster [ ] Gypsum Board [X] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Window on e. wall.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[X] Good 1 [X] Fair 1 [ ] Poor [X] Destroyed 2	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	1 fixture w/ shade + globe 1 fixture w/ shade / broken globe 2 destroyed.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents / Fans [ ] Fixtures [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:	[ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY: ( ) F ( ) B ( ) W ( ) C

[ ] Good
[ ] Fair
[X] Poor
[ ] Destroyed

[X] 1900-1906
[ ] 1907-1923
[X] 1924-Present
[ ] In Question

ARCHITECTURAL SIGNIFICANCE:

[ ] Most
[X] Some
[ ] Minor
[ ] Negligible

PHOTOGRAPHS: (1) View east (2) View southwest ROOM NO. 107

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 49

ROOM NO: 108 LAST KNOWN USE: Welfare office SQUARE FEET: 1014 s.f. CEILING HEIGHT: 18'-5½" DATE: 20 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [ ] Vinyl [ ] Linoleum [X] Other: Terrazzo	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [X] Other: Terrazzo	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
WALLS:	[X] Plaster [ ] Gypsum Board [X] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	N. wall - 7' h. 3'x4' sec. removed n. window on w. wall. cast plaster molding.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Transom Doubledoors to hall.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[X] Good 3 [ ] Fair [ ] Poor [X] Destroyed 2	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	3 fixtures w/ globes + shades. 2 missing fixtures.
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Fixtures [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	3 radiators
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY:	○ E	○ B	○ W	○ C	[ ] Good [ ] Fair [X] Poor	[X] 1900-1906 [X] 1907-1923 [X] 1924-Present	**ARCHITECTURAL SIGNIFICANCE:**	[X] Most [ ] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: (1) View southeast (2) View northwest (3) Column capital (4) Terrazzo floor + Column base ROOM NO. 108

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 51

ROOM NO: 109 LAST KNOWN USE: Toilet SQUARE FEET: 1385 s.f. CEILING HEIGHT: 18'-5½" DATE: 20 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Red tile - 6" sq.
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	6" sq ?s. 82" h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Walls appear to have been recently replastered / touched up.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Ceiling appears to have been recently replastered / touched up.
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents / Fans [ ] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Radiator Decorative curve along top of radiator
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	( ) F ( ) B ( ) W ( ) C	[X] **Good** [ ] **Fair** [ ] **Poor** [ ] **Destroyed**	[X] **1900-1906** [ ] **1907-1923** [ ] **1924-Present** [ ] **In Question**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) View east

ROOM NO. 109

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 53

ROOM NO: 110, 110A LAST KNOWN USE: Laborer Locker Room SQUARE FEET: 1389 s.f. CEILING HEIGHT: 18'-4½" DATE: 20 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☐ Linoleum ☒ Other: Concrete	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☒ 1924-Present ☐ In Question	
BASE:	☐ Wood ☒ Tile ☐ Tile Wainscot ☒ Other: Cast Plaster	☒ Good Tile ☐ Fair ☐ Poor ☒ Destroyed Plaster	☒ 1900-1906 ☒ 1907-1923 ☒ 1924-Present ☐ In Question	
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Glazed Wood Partitions ☒ Other: Wire mesh	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1906 ☒ 1907-1923 ☒ 1924-Present ☐ In Question	S. wall- wire mesh above plaster.
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	Columns support beams along ceiling.
DOORS/ OPENINGS:	☒ Wood/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☒ 1907-1923 ☒ 1924-Present ☐ In Question	
LIGHTING:	☒ Incandescent ☐ Fluorescent ☐ Missing ☐ Other:	☐ Good ☐ Fair ☒ Poor ☒ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	5 fixtures w/ shades in poor condition + no globes several destroyed fixtures.
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents/Fans ☐ Fixtures ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	2 radiators 2 mirrors
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
SUMMARY:	○ F ○ B ○ W ○ C	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☒ 1924-Present ☐ In Question	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☒ Some ☐ Minor ☐ Negligible

PHOTOGRAPHS: (1) East wall, RM. 110A (2) View northeast (3) View southwest ROOM NO. 110, 110A

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 55

ROOM NO: 111 LAST KNOWN USE: Store Room SQUARE FEET: 508sf. CEILING HEIGHT: 18'-4½" DATE: 20 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [X] Vinyl [ ] Linoleum [ ] Other:	[ ] Good [ ] Fair DEBRIS [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	9" sq.
BASE:	[ ] Wood [X] Tile ? [ ] Tile Wainscot [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [X] Other: Wire mesh	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Wire mesh above plaster.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] Wood/~~Glass~~ Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Double door - 1 door missing, 1 poor.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[X] Good 2 [X] Fair 2 [ ] Poor [X] Destroyed 2	[ ] Pre-1924 [X] Post-1924 [ ] In Question	2 suspended fixtures with shades + globes (1 blue globe). 2 suspended fixtures with shades + broken blue globes. 2 missing.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [X] Vents/Fans [ ] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Fan shelf on W. wall Pipes along ceiling.
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ F ○ B ○ W ○ C	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: ① View northeast

ROOM NO. 111

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 57

ROOM NO: 112 LAST KNOWN USE: Store Room SQUARE FEET: 1116 s.f. CEILING HEIGHT: 18'-4½" DATE: 20 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☐ Linoleum ☒ Other: Concrete	☐ Good ☐ Fair DEBRIS ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☒ 1924-Present ☐ In Question	
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☒ Other: Cast Plaster	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☒ 1924-Present ☐ In Question	9"h.
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Glazed Wood Partitions ☒ Other: Wire mesh	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☒ 1924-Present ☐ In Question	Wire mesh above plaster n. + w. walls.
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	Columns support beams along ceiling.
DOORS/ OPENINGS:	☒ Wood/~~Glass~~ Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☒ Fair ☐ Poor ☒ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	Door to H103 is missing Door to underside of SH - Dutch door.
LIGHTING:	☒ Incandescent ☐ Fluorescent ☐ Missing ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	9 suspended fixtures w/ shades/no globes.
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☒ Vents/Fans ☐ Fixtures ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	Well fan - e. wall near ne. corner. very rusted. Exposed pipes along ceiling.
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
SUMMARY:	○ F ○ B ○ W ○ C	☐ **Good** ☐ **Fair** ☒ **Poor** ☐ **Destroyed**	☐ **1900-1906** ☐ **1907-1923** ☒ **1924-Present** ☐ **In Question**	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS: (1) View southwest (2) View northeast ROOM NO. 112

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 59

ROOM NO: 112A LAST KNOWN USE: Unknown SQUARE FEET: 217.5 s.f. CEILING HEIGHT: 5'3" to 12' DATE: 23 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [ ] Vinyl [ ] Linoleum [X] Other: Concrete	[ ] Good [ ] Fair DEBRIS [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
BASE:	[ ] Wood [ ] Tile [ ] Tile Wainscot [X] Other: Composition	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	The underside of Sill runs along the ceiling. Plaster is destroyed under the stairs & they are visible.
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [X] Other: Dutch Door	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Door has glass transom + flanking windows. Door to Rm. 112- Dutch Door.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Fixtures [X] Other: None	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY: ( ) F ( ) B ( ) W ( ) C

[ ] Good
[X] Fair
[ ] Poor
[ ] Destroyed

[X] 1900-1906
[ ] 1907-1923
[ ] 1924-Present
[ ] In Question

ARCHITECTURAL SIGNIFICANCE:

[ ] Most
[ ] Some
[ ] Minor
[X] Negligible

PHOTOGRAPHS: (1) View west

ROOM NO. 112A

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 61

ROOM NO: 113 LAST KNOWN USE: Store Room SQUARE FEET: 420 s.f. CEILING HEIGHT: 18'-4½" DATE: 20 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [X] Vinyl [ ] Linoleum [ ] Other:	[ ] Good [ ] Fair [ ] Poor DEBRIS [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
BASE:	[ ] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[ ] Good [ ] Fair [ ] Poor DEBRIS [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [X] Other: Wire mesh	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	wire mesh above plaster.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Skylight covered over.
DOORS/ OPENINGS:	[X] Wood/~~Glass~~ Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [X] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Galv. metal door is glazed, sm. window.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [X] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	2 suspended fixtures w/ shades others destroyed.
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents Fans [ ] Fixtures [X] Other: None	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ F ○ B ○ W ○ C	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) View northeast (2) Skylight + ceiling, view east ROOM NO. 113

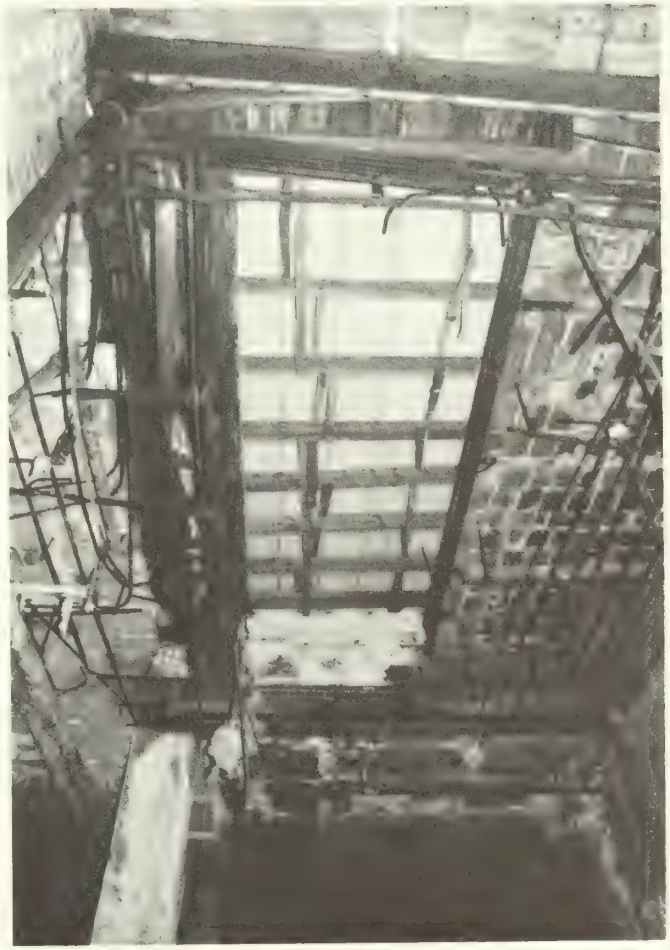

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 63

ROOM NO: 114 LAST KNOWN USE: Information Bureau SQUARE FEET: 2142 s.f. CEILING HEIGHT: 18'-6¼"; 11'-10½" DATE: 20 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 1¼"
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	S'h. major area missing on column on s. wall.
WALLS:	[X] Plaster [ ] Gypsum Board [X] Glazed Wood Partitions [X] Other: Glass	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	S. wall - Tile to lower counterht., surmounted by screen window + glass (multi-light w/ steel mullions. Part of n. wall, w. of door - vertical wood, glazed.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	skylight covered over.
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Window on w. wall (to Rm. 106/107).
LIGHTING:	[ ] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	1 suspended globe; All others destroyed
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	4 radiators
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ F ○ B ○ W ○ C	[ ] **Good** [ ] **Fair** [X] **Poor** [ ] **Destroyed**	[X] **1900-1906** [X] **1907-1923** [ ] **1924-Present** [ ] **In Question**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: (1) View southeast (2) Skylight (3) View northeast (4) View southwest ROOM NO. 114

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 65

ROOM NO: 114A LAST KNOWN USE: Closet SQUARE FEET: 36.25 s.f. CEILING HEIGHT: 11' - 10½" DATE: 20 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☐ Linoleum ☐ Other:	☐ Good ☐ Fair DEBRIS ☐ Poor ☐ Destroyed	☐ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☒ Other: Black Composition	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Glazed Wood Partitions ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
DOORS/ OPENINGS:	☒ ~~Wood~~/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
LIGHTING:	☒ Incandescent ☐ Fluorescent ☐ Missing ☐ Other:	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents Fans ☐ Fixtures ☒ Other: None	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
SUMMARY:	○ F ○ B ○ W ○ C	☒ **Good** ☐ **Fair** ☐ **Poor** ☐ **Destroyed**	☒ **1900-1906** ☐ **1907-1923** ☐ **1924-Present** ☐ **In Question**	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☐ Minor ☒ Negligible

PHOTOGRAPHS: (1) South wall

ROOM NO. 114A

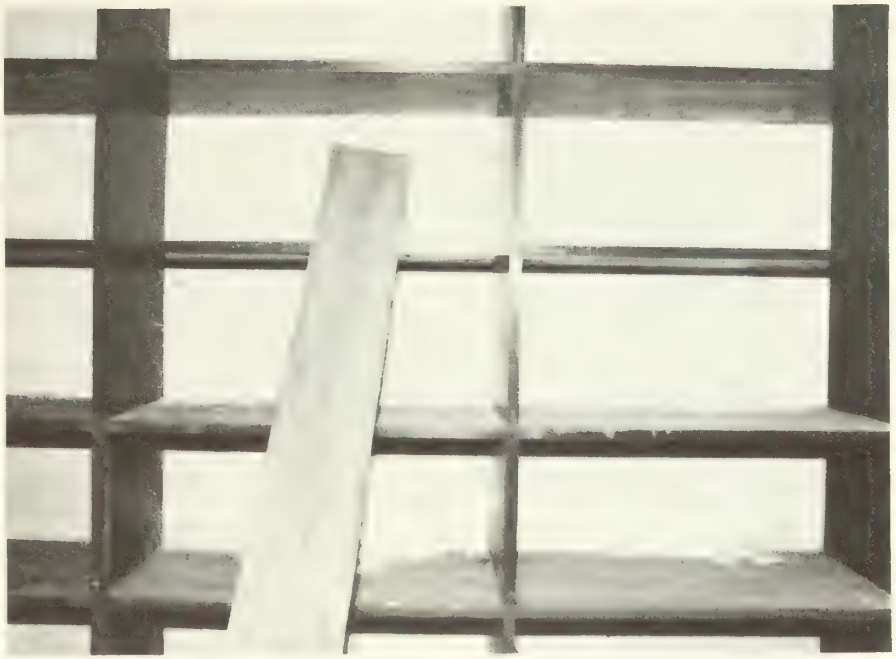

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 67

ROOM NO: 114B LAST KNOWN USE: Closet SQUARE FEET: 78.75 s.f. CEILING HEIGHT: 11'-10" DATE: 20 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 1'1/4"
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	5'h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [X] Other: Window	[ ] Good [X] Fair Window [X] Poor Door [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Window w/ Transom on W. wall. Double door on E. wall
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents Fans [ ] Fixtures [X] Other: None	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY:	◯ F ◯ B ◯ W ◯ C	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	**ARCHITECTURAL SIGNIFICANCE:**	[ ] Most [ ] Some [ ] Minor [X] Negligible

PHOTOGRAPHS: (1) View south

ROOM NO. 114B

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 69

ROOM NO: 115, H105 LAST KNOWN USE: Interview Room / Passage SQUARE FEET: 788 s.f. CEILING HEIGHT: 18'-6¼" DATE: 20 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 1¼"
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	5'h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [X] Other: Glass	[ ] Good [X] Fair Steel Sash [X] Poor Plaster [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	n, s, + w. walls - Tile to low counter ht. surmounted by screen windows + glass (multi-light w/ steel mullions). some glass broken.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other: Wire mesh	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Wire mesh door across e. end of hall.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[X] Good 2 [ ] Fair [ ] Poor [X] Destroyed 2	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	2 fixtures w/ globes
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Fixtures [X] Other: None	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:	[ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY:	○ F ○ B ○ W ○ C	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	**ARCHITECTURAL SIGNIFICANCE:**	[ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: ① View west ② View east ③ View east, H105 center, Rm. 115 right ROOM NO. 115, H 105

PHOTOGRAPHS: (4) View west, H105

ROOM NO. 115, H105

PHOTOGRAPHS:

ROOM NO.

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 73

ROOM NO: 116 LAST KNOWN USE: Bathroom SQUARE FEET: 197 s.f. CEILING HEIGHT: 18'-6 1/4" DATE: 20 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Dark blue, lt. blue diamonds
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	78"h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	W. wall nr. window - 3 'x4' section removed.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [X] Fixtures [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	radiator 4 toilets; marble partitions (chipped); doors missing; 1 slop sink; sinks on e. wall are missing. sm. vents in n. + w. walls.
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY:				**ARCHITECTURAL SIGNIFICANCE:**	
○ F ○ B ○ W ○ C	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question		[ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) View southwest (2) West wall near window ROOM NO. 116

PHOTOGRAPHS: (3) Tile floor + wainscot ROOM NO. 116

PHOTOGRAPHS:

ROOM NO.

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 77

ROOM NO: 117 LAST KNOWN USE: Information Bureau SQUARE FEET: 480 s.f CEILING HEIGHT: 18'-6 1/4" DATE: 20 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 1"1/4"
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	5'h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [X] Other: Glass	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Multi-light w/ steel mullions
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [X] Poor Not much is visible [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [X] Other: None	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
LIGHTING:	[ ] Incandescent [ ] Fluorescent [X] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	2 radiators
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY: ( ) E ( ) B ( ) W ( ) C

[ ] Good
[X] Fair
[ ] Poor
[ ] Destroyed

[X] 1900-1906
[ ] 1907-1923
[X] 1924-Present
[ ] In Question

ARCHITECTURAL SIGNIFICANCE:

[ ] Most
[ ] Some
[X] Minor
[ ] Negligible

PHOTOGRAPHS: ① View east

ROOM NO. 117

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 79

ROOM NO: 118, 118A LAST KNOWN USE: Bathroom SQUARE FEET: 199.5 s.f. CEILING HEIGHT: 18'-4½" DATE: 20 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 1'1/4" Floor slopes to drain.
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [X] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	radiator 3 pedestal sinks; 2 urinals; 3 toilets; marble partitions; wood panel doors; 1 mirror;
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY:	○ F ○ B ○ W ○ C	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	**ARCHITECTURAL SIGNIFICANCE:**	[ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) View northeast (2) East wall ROOM NO. 118, 118A

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 81

ROOM NO: 119 LAST KNOWN USE: Law + Registry Division SQUARE FEET: 88 s.f. CEILING HEIGHT: 14'5" DATE: 20 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☐ Linoleum ☐ Other:	☐ Good ☐ Fair DEBRIS ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
BASE:	☐ Wood ☒ Tile ☐ Tile Wainscot ☐ Other:	☒ Good ☐ Fair DEBRIS ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Glazed Wood Partitions ☒ Other: Wood / Chainlink	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☒ 1907-1923 ☒ 1924-Present ☐ In Question	E. wall is wood w/ openings + counters, surmounted by chain link fence + screen.
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other:	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☐ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	
DOORS/ OPENINGS:	☐ Wood / Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
LIGHTING:	☒ Incandescent ☐ Fluorescent ☐ Missing ☐ Other:	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents/Fans ☐ Fixtures ☒ Other: None	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
SUMMARY:	○ E ○ B ○ W ○ C	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☐ 1900-1906 ☒ 1907-1923 ☒ 1924-Present ☐ In Question	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS: (1) Exterior view of east wall, from Railroad Ticket Office (2) View southwest ROOM NO. 119

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 83

ROOM NO: 120 LAST KNOWN USE: Bathroom SQUARE FEET: 160 s.f. CEILING HEIGHT: 18'-6¼" DATE: 20 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair DEBRIS [ ] Poor [ ] Destroyed	[X] 1900-1906 ? [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 1 1/4". This bathroom was renovated in 1913 - the exact nature of the changes is unknown.
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 ? [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Transom
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents Fans [X] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [X] Destroyed 1 toilet	[X] 1900-1906 ? [X] 1907-1923 [ ] 1924-Present [ ] In Question	2 pedestal sinks; 3 toilets; marble dividers; wood panel doors (poor); slop sink; 2 urinals - 1 broken; paper towel dispenser 1 radiator
MISCELLANEOUS:	[ ] [ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY: ( ) F ( ) B ( ) W ( ) C

[ ] Good
[ ] Fair
[X] Poor
[ ] Destroyed

[X] 1900-1906
[X] 1907-1923
[ ] 1924-Present
[ ] In Question

ARCHITECTURAL SIGNIFICANCE:

[ ] Most
[ ] Some
[X] Minor
[ ] Negligible

PHOTOGRAPHS: (1) View south

ROOM NO. 120

ROOM NO: 121 LAST KNOWN USE: Law and Registry Division SQUARE FEET: 8,551.5 s.f. CEILING HEIGHT: 19'-6" to 14'-5" (gabled) DATE: 23 Sept. 1983

DESCRIPTION: RAILROAD TICKET OFFICE

General: Large one-story open space with a triple butterfly roof. Columns support a series of pitched Pratt trusses and cross beams. Rows of windows on the north, east, and west walls.

Floor: Hexagonal 1¼" ceramic tile.

Base: White tile, 9" h. Red tile on part of south wall.

Walls: Plaster over terra cotta block. Chainlink fence and screen above wood on the exterior of Room 119. Tile on the exterior of Room 124. Masonite on the exterior of Rooms 125, 126, and 127. Wire mesh above plaster on parts of the south wall.

Ceiling: Plaster over terra cotta block. Glass block skylights. Pitched Pratt trusses and cross beams.

Doors/ Openings: Glass panelled.

Lighting: Suspended fixtures.

Heating: 8 S-pipe radiators. 2 regular radiators.

Misc.: Columns: 6 columns.

CONDITION:

Floor: Fair condition. Some large cracks.

Base: Tile is missing along west wall and in poor condition on the north wall. Good condition on east and south walls.

Walls: The overall condition is poor. Brick and terra cotta block are exposed on most of the north and west walls. Base coat is exposed in some other areas, particularly behind pipes. The upper portions of east and south walls are in good condition except under the roof.

Ceiling: The overall condition is poor. Terra cotta blocks are exposed in several large areas. Base coat is exposed and plaster is flaking in other areas. Many beams are rusted. Skylights have been restored.

Doors/ Openings: Good condition.

Lighting: Fair condition. Fixtures have shades but no globes.

Heating: Radiators are very rusted.

Misc.: Columns: The lower third of each column is crumbling.

SUMMARY:

F B W C

- [ ] Good
- [ ] Fair
- [X] Poor
- [ ] Destroyed

- [ ] 1900-1906
- [X] 1907-1923
- [ ] 1924-Present
- [ ] In Question

ARCHITECTURAL SIGNIFICANCE:

- [X] Most
- [ ] Some
- [ ] Minor
- [ ] Negligible

PHOTOGRAPHS: 1. View northeast 2. View northwest 3. View southeast 4. View south

ROOM NO. Railroad Ticket Office (121)

PHOTOGRAPHS: 5. Truss & fan,detail. 6. Skylight.

ROOM NO. Railroad Ticket Office (121)

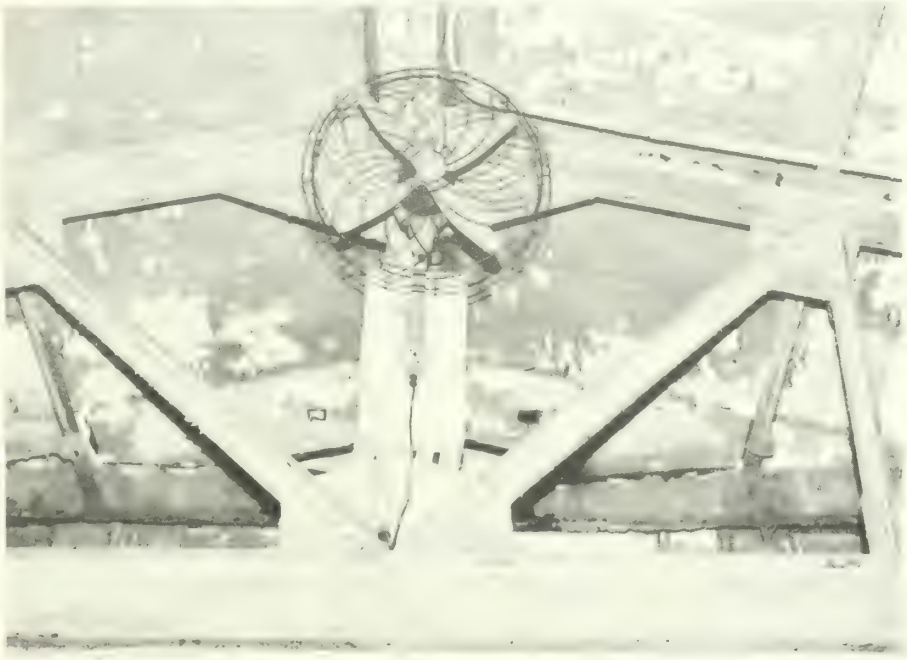

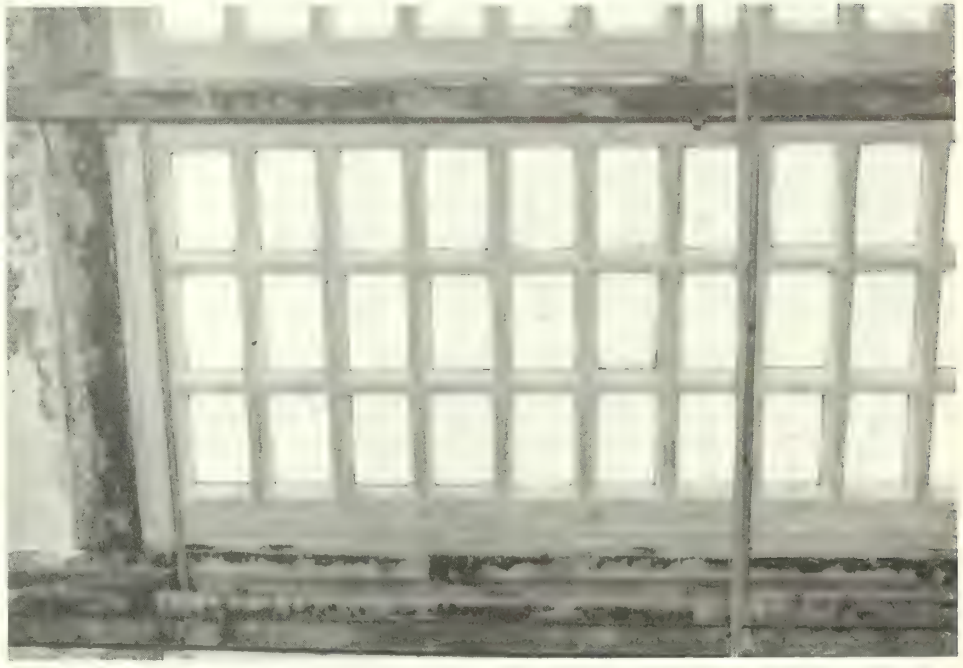

PHOTOGRAPHS:

ROOM NO.

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 89

ROOM NO: 122 LAST KNOWN USE: Bathroom SQUARE FEET: 109.5 s.f. CEILING HEIGHT: DATE: 20 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 1 1/4" Floor slopes to drain.
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	71"h. An
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Angled wall near window removed except for bottom 3'.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	shaft in ceiling open to sky.
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [X] Other: None/Missing	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents Fans [X] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Slopsink; 3 pedestal sinks; 1 mirror; 1 Toilet extant / 1 toilet missing; marble partitions: Graffiti - Chinese, Spanish, obscene doodles, on partitions. 1940's?
MISCELLANEOUS:	[ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY:	( ) F ( ) B ( ) W ( ) C	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	**ARCHITECTURAL SIGNIFICANCE:**	[ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) View north

ROOM NO. 122

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 91

ROOM NO: 123 LAST KNOWN USE: Bathroom SQUARE FEET: 100.5 s.f. CEILING HEIGHT: 14'-5" DATE: 20 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed DEBRIS PLANTS GROWING.	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	7'h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Angled wall near window removed except for bottom 3'.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Airshaft in ceiling open to sky.
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [X] Other: none / missing	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents / Fans [X] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [X] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	3 urinals extant; 2 urinals destroyed. 2 sinks destroyed
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY: ( ) F ( ) B ( ) W ( ) C

[ ] Good
[ ] Fair
[X] Poor
[ ] Destroyed

[ ] 1900-1906
[X] 1907-1923
[ ] 1924-Present
[ ] In Question

ARCHITECTURAL SIGNIFICANCE:

[ ] Most
[ ] Some
[X] Minor
[ ] Negligible

PHOTOGRAPHS: ① View north

ROOM NO. 123

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 93

ROOM NO: 124 LAST KNOWN USE: Toilet SQUARE FEET: 135 s.f. CEILING HEIGHT: DATE: 20 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 1"1/4"
BASE:	[ ] Wood [X] Tile [ ] Tile Wainscot [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [X] Other: Tile	[X] Good Tile [ ] Fair [X] Poor Plaster [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [X] Other: none/missing	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
LIGHTING:	[ ] Incandescent [ ] Fluorescent [ ] Missing [X] Other: None	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [X] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	6 toilets
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY: ( ) F ( ) B ( ) W ( ) C

[ ] Good
[ ] Fair
[X] Poor
[ ] Destroyed

[ ] 1900-1906
[ ] 1907-1923
[X] 1924-Present
[ ] In Question

ARCHITECTURAL SIGNIFICANCE:

[ ] Most
[ ] Some
[X] Minor
[ ] Negligible

PHOTOGRAPHS: (1) View Southeast

ROOM NO. 124

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 95

ROOM NO: 125 LAST KNOWN USE: Law + Registry Division SQUARE FEET: 81 s.f. CEILING HEIGHT: DATE: 20 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 1 1/4".
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [X] Other: Tile	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	6"h. - tile 2"h. - wood
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [X] Other: Masonite/Wire Mesh	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	Wire mesh on S. wall above plaster.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~ Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	Suspended fixture w/ rusted shade, rim splitting off. / no globe.
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents Fans [ ] Fixtures [X] Other: None	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY: F B W C

[X] Good / Fair / [ ] Poor / [ ] Destroyed

[ ] 1900-1906 / [ ] 1907-1923 / [X] 1924-Present / [ ] In Question

ARCHITECTURAL SIGNIFICANCE: [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) View southwest

ROOM NO. 125

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 97

ROOM NO: 126 LAST KNOWN USE: Law + Registry Division SQUARE FEET: 24 s.f. CEILING HEIGHT: DATE: 20 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 1 1/4"
BASE:	[X] Wood [X] Tile [ ] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	Red tile - 6"h. wood 2"h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [X] Other: Masonite/Wire Mesh	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	Wire mesh on s. wall above plaster.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	1 suspended shade / no globe.
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Fixtures [X] Other: None	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:	[ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ ○ ○ ○	[X] **Good** [ ] **Fair** [ ] **Poor**	[ ] **1900-1906** [ ] **1907-1923** [X] **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor

PHOTOGRAPHS: ① View southeast

ROOM NO. 126

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 99

ROOM NO: 127 LAST KNOWN USE: Passage SQUARE FEET: 81 s.f. CEILING HEIGHT: DATE: 20 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 1 1/4".
BASE:	[X] Wood [X] Tile [ ] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	6"h. tile 2"h. wood
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [X] Other: Masonite/Wire Mesh	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	Wire mesh above plaster on s. wall.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	1 suspended fixture w/ rusted shade/ no globe.
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Fixtures [X] Other: None	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:	[ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY: ○ F ○ B ○ W ○ C

[X] Good [ ] Fair [ ] Poor [ ] Destroyed

[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question

ARCHITECTURAL SIGNIFICANCE: [ ] Most [ ] Some [ ] Minor [X] Negligible

PHOTOGRAPHS: ① View west

ROOM NO. 127

ROOM NO: 128 LAST KNOWN USE: Record Room SQUARE FEET: 17,029.25 s.f. CEILING HEIGHT: 18'-5" DATE: 23 Sept. 1983

DESCRIPTION: BAGGAGE ROOM	CONDITION:
General: Large central space on the first floor with a colonnade of square columns. The south wall is dominated by large segmental windows.	
Floor: Tile on the sides of the room: hexagonal 1¼" tile with borders of 3" sq. tile. Concrete floor in the center of the room (1937).	Floor: The overall condition is fair. Tile has numerous small patched areas and cracks. Concrete has some large cracks and small patched areas.
Base: Red tile to a height of 6".	Base: Good condition.
Walls: Plaster over terra cotta block on the west, east, and south walls. The north wall, added post-1937, has wire mesh above plaster.	Walls: The overall condition is fair. Major areas of terra cotta block exposed on the south wall and in the northeast corner. Patches of base coat exposed in various locations. West wall: Narrow opening for a pipe.
Ceiling: Plaster over terra cotta block. Columns support beams along the ceiling. Cove ceiling at south end.	Ceiling: Generally in good condition.
Doors/ Openings: Wood doors and galvanized metal double doors with windows.	Doors/ Openings: The wood doors are in good condition. One of the galvanized metal doors is badly corroded, while the other is missing.
Lighting: Suspended fixtures and wall sconces. The suspended fixtures date from 1936.	Lighting: The suspended fixtures are in fair condition with shades but no globes. The wall sconces are corroded.
Heating: 11 radiators, 2 fans mounted on columns. Vents in various locations. Electric box on west wall.	Heating: Radiators are in fair condition with some rust. Electric box and fans are corroded.
Misc.: Columns.	Misc.: Brick is totally exposed on one column. One steel column is exposed. Many columns have rusted corner guards.

SUMMARY: ○ F ○ B ○ W ○ C

- [ ] Good
- [X] Fair
- [ ] Poor
- [ ] Destroyed

- [X] 1900-1906
- [ ] 1907-1923
- [ ] 1924-Present
- [ ] In Question

ARCHITECTURAL SIGNIFICANCE:

- [X] Most
- [ ] Some
- [ ] Minor
- [ ] Negligible

PHOTOGRAPHS: 1. View north 2. View northeast 3. View northwest 4. View south

ROOM NO. Baggage Room 128

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 103

ROOM NO: 129 LAST KNOWN USE: Bathroom SQUARE FEET: 156 s.f. CEILING HEIGHT: 18'-8" DATE: 21 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed DEBRIS	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 1 1/4"
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	79"h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [X] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	2 pedestal sinks; 1 shower stall; 2 toilets; marble partitions; wood slat doors; 2 upright urinals.
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ F ○ B ○ W ○ C	[ ] **Good** [ ] **Fair** [X] **Poor** [ ] **Destroyed**	[X] **1900-1906** [ ] **1907-1923** [ ] **1924-Present** [ ] **In Question**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) View north

ROOM NO. 129

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 105

ROOM NO: 130 LAST KNOWN USE: Passage SQUARE FEET: 16 S.F. CEILING HEIGHT: 8'-8" DATE: 21 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 1'1/4".
BASE:	[ ] Wood [X] Tile [ ] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Red tile
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
CEILING:	[ ] Plaster [ ] Acoustic panels [ ] Cove [X] Other: Wire mesh	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Glazed door. - Leads to Rm. 131
LIGHTING:	[ ] Incandescent [ ] Fluorescent [ ] Missing [X] Other: None	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents Fans [ ] Fixtures [X] Other: None	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY: ( ) F ( ) B ( ) W ( ) C

[X] Good [ ] Fair [ ] Poor [ ] Destroyed

[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question

ARCHITECTURAL SIGNIFICANCE: [ ] Most [ ] Some [ ] Minor [X] Negligible

PHOTOGRAPHS: ① View south

ROOM NO. 130

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 107

ROOM NO: 131 LAST KNOWN USE: Store Room SQUARE FEET: 140 s.f. CEILING HEIGHT: DATE: 21 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [ ] Vinyl [ ] Linoleum [X] Other: Concrete	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	77" h.; none on w. wall.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Glazed door
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents Fans [ ] Fixtures [X] Other: None	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ F ○ B ○ W ○ C	[ ] **Good** [ ] **Fair** [X] **Poor** [ ] **Destroyed**	[X] **1900-1906** [ ] **1907-1923** [ ] **1924-Present** [ ] **In Question**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [ ] Minor [X] Negligible

PHOTOGRAPHS: (1) View Southwest

ROOM NO. 131

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 109

ROOM NO: 132 LAST KNOWN USE: Unknown SQUARE FEET: 157.5 s.f. CEILING HEIGHT: DATE: 21 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☐ Linoleum ☒ Other: Wood	☐ Good ☐ Fair DEBRIS ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☐ Good ☐ Fair DEBRIS ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Glazed Wood Partitions ☐ Other:	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other:	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
DOORS/ OPENINGS:	☐ Wood Glass Panelled ☐ Wood Veneer ☒ Galvanized Metal ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	Glazed door
LIGHTING:	☐ Incandescent ☐ Fluorescent ☒ Missing ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents Fans ☐ Fixtures ☒ Other: None	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
SUMMARY:	○ F ○ B ○ W ○ C	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☐ Minor ☒ Negligible

PHOTOGRAPHS: (1) View north

ROOM NO. 132

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: ///

ROOM NO: 133 LAST KNOWN USE: Bathroom SQUARE FEET: 150 s.f. CEILING HEIGHT: 18'-9" DATE: 21 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	X Tile Vinyl Linoleum Other:	X Good Fair Poor Destroyed	X 1900-1906 1907-1923 1924-Present In Question	Hex. 1'1/4" Floor slopes to drain.
BASE:	Wood Tile X Tile Wainscot Other:	Good Fair X Poor Destroyed	X 1900-1906 1907-1923 1924-Present In Question	78"h.
WALLS:	X Plaster Gypsum Board Glazed Wood Partitions Other:	Good Fair X Poor Destroyed	X 1900-1906 1907-1923 1924-Present In Question	
CEILING:	X Plaster Acoustic panels Cove Other:	Good Fair Poor X Destroyed	X 1900-1906 1907-1923 1924-Present In Question	
DOORS/ OPENINGS:	X ~~Wood~~/Glass Panelled Wood Veneer Galvanized Metal Other:	Good Fair X Poor Destroyed	X 1900-1906 1907-1923 1924-Present In Question	Transom
LIGHTING:	X Incandescent Fluorescent Missing Other:	Good Fair Poor X Destroyed	Pre-1924 Post-1924 In Question	
HEATING/ VENTILATION PLUMBING:	X Radiators Vents Fans X Fixtures Other:	Good X Fair Poor X Destroyed - Toilet	X 1900-1906 1907-1923 X 1924-Present In Question	slop sink; 2 toilets; 2 urinals; 2 pedestal sinks; paper towel dispenser; metal shower stall.
MISCELLANEOUS:		Good Fair Poor Destroyed	1900-1906 1907-1923 1924-Present In Question	
SUMMARY:	○ F ○ B ○ W ○ C	Good Fair X Poor Destroyed	X 1900-1906 1907-1923 1924-Present In Question	**ARCHITECTURAL SIGNIFICANCE:** Most / Some / X Minor / Negligible

PHOTOGRAPHS: (1) View south

ROOM NO. 133

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING

ROOM NO: 134, 134A LAST KNOWN USE: Medical Division SQUARE FEET: 585 s.f. CEILING HEIGHT: 18'-8" DATE: 21 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [ ] Vinyl [ ] Linoleum [X] Other: Wood	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	10.5"h. + 4"h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [X] Other: Wood panelled	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Wood panelled partitions of 134A: 7 1/4½" h.; rusted wire mesh. Hole in E. wall of 134 - 14" diam. Picture molding
CEILING:	[X] Plaster [ ] Acoustic panels [X] Cove [X] Other: Wire mesh	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Rm. 134A has wire mesh ceiling.
DOORS/ OPENINGS:	[X] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [X] Other: Wire mesh	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Door to Rm. 134 is boarded over. Wood panelled door w/ wire mesh opening leads to Rm. 134. Wire mesh door in hall in front of Rm. 134A - outside dbl. doors.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [X] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	2 hanging fixtures - shades/no globes.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:	[X] Counter w/ cupboards	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Located on S. wall of 134; part of N. wall (back side) of 134A.

SUMMARY:	F B W C			**ARCHITECTURAL SIGNIFICANCE:**	
		[ ] Good	[X] 1900-1906		[ ] Most
		[X] Fair	[ ] 1907-1923		[X] Some
		[ ] Poor	[X] 1924-Present		[ ] Minor
		[ ] Destroyed	[ ] In Question		[ ] Negligible

PHOTOGRAPHS: ① View east, 134 A ② View northeast ③ View southeast ROOM NO. 134, 134 A

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 115

ROOM NO: 135 LAST KNOWN USE: Bathroom SQUARE FEET: 218.5 s.f. CEILING HEIGHT: 11'-11" DATE: 21 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[ ] Good [ ] Fair DEBRIS [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Hex 1'1/4"
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [X] Other: Missing	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Transom
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents Fans [X] Fixtures [ ] Other:	[ ] Good [ ] Fair [X] Poor [X] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Slop sink; 2 toilets; marble dividers; marble shower stall; 2 urinals; pedestal sinks missing.
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY: ( ) F ( ) B ( ) W ( ) C

[ ] Good
[ ] Fair
[X] Poor
[ ] Destroyed

[X] 1900-1906
[ ] 1907-1923
[ ] 1924-Present
[ ] In Question

ARCHITECTURAL SIGNIFICANCE:

[ ] Most
[ ] Some
[X] Minor
[ ] Negligible

PHOTOGRAPHS: (1) View southwest

ROOM NO. 135

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 117

ROOM NO: 136 LAST KNOWN USE: Records SQUARE FEET: 697.5 s.f. CEILING HEIGHT: 11'-11"; 18'-6½" DATE: 21 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[ ] Good [ ] Fair DEBRIS [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 1 1/4"
BASE:	[ ] Wood [X] Tile [ ] Tile Wainscot [ ] Other:	[ ] Good [ ] Fair DEBRIS [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	10"h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] Wood ~~Glass~~ Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [X] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	sink at n. end of e. wall
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY: ○ F ○ B ○ W ○ C

[ ] Good
[ ] Fair
[X] Poor
[ ] Destroyed

[X] 1900-1906
[X] 1907-1923
[ ] 1924-Present
[ ] In Question

ARCHITECTURAL SIGNIFICANCE:

[ ] Most
[ ] Some
[X] Minor
[ ] Negligible

PHOTOGRAPHS: ① View north

ROOM NO. 136

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 119

ROOM NO: 137 LAST KNOWN USE: Lavatory SQUARE FEET: 718.75 S.F. CEILING HEIGHT: 18'-6 1/2"; 12'-1" DATE: 21 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[ ] Good [ ] Fair DEBRIS [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	HEX. 1 1/4"
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [ ] Fair DEBRIS [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [X] Other: Concrete	[X] Good Concrete [ ] Fair [X] Poor Plaster [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Wire mesh guard over transom.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	7 suspended fixtures w/ shades/no globes.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [X] Fixtures [ ] Other:	[ ] Good [ ] Fair [X] Poor [X] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	radiator 7 pedestal sinks; 2 dbl. sinks; 8 missing sinks; 2 mirrors; lg. wall fan on S. wall.
MISCELLANEOUS:	[ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY:	◯ F ◯ B ◯ W ◯ C	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	**ARCHITECTURAL SIGNIFICANCE:**	[ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) View southeast

ROOM NO. 137

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 121

ROOM NO: 137A LAST KNOWN USE: Toilet SQUARE FEET: 32.5 s.f. CEILING HEIGHT: 12'-1" DATE: 21 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[ ] Good [ ] Fair DEBRIS [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 1 1/4"
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [X] Fixtures [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Toilet Sink
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ F ○ B ○ W ○ C	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) View west

ROOM NO. 137A

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING

ROOM NO: 137 B LAST KNOWN USE: Toilet SQUARE FEET: 35 S.F. CEILING HEIGHT: 12'-1" DATE: 21 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[ ] Good [ ] Fair DEBRIS [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 1 1/4".
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Fixtures [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	1 toilet 1 sink
MISCELLANEOUS:	[ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ F ○ B ○ W ○ C	[ ] **Good** [ ] **Fair** [X] **Poor** [ ] **Destroyed**	[ ] **1900-1906** [ ] **1907-1923** [X] **1924-Present** [ ] **In Question**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) View west

ROOM NO. 137B

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 125

ROOM NO: 138 LAST KNOWN USE: Primary Inspection SQUARE FEET: 598 s.f. CEILING HEIGHT: 18'-7½" DATE: 22 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☒ Vinyl ☐ Linoleum ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☒ 1924-Present ☐ In Question	9"sq's.
BASE:	☒ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	10.5"h.
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Glazed Wood Partitions ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
CEILING:	☒ Plaster ☐ Acoustic panels ☒ Cove ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	Columns support beams along ceiling.
DOORS/ OPENINGS:	☒ Wood/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	3 doors
LIGHTING:	☐ Incandescent ☒ Fluorescent ☐ Missing ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ Pre-1924 ☒ Post-1924 ☐ In Question	6 fixtures.
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents/Fans ☐ Fixtures ☒ Other: Electric Heating	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☒ 1924-Present ☐ In Question	
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	

SUMMARY:	○ F ○ B ○ W ○ C	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	**ARCHITECTURAL SIGNIFICANCE:**	☐ Most ☒ Some ☐ Minor ☐ Negligible

PHOTOGRAPHS: (1) View south (2) View southwest ROOM NO. 138

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 127

ROOM NO: 139 LAST KNOWN USE: Medical Division SQUARE FEET: 391 s.f. CEILING HEIGHT: 18'-8" DATE: 21 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [ ] Vinyl [X] Linoleum [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	10.5"h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Transom
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [X] Fair 3 [ ] Poor [X] Destroyed 6	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	3 shades without globes 6 destroyed.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [X] Vents/Fans [X] Fixtures [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	radiator vents s. wall next to transom. sink + paper towel dispenser one wall.
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	( ) F ( ) B ( ) W ( ) C	[ ] **Good** [ ] **Fair** [X] **Poor** [ ] **Destroyed**	[X] **1900-1906** [ ] **1907-1923** [ ] **1924-Present** [ ] **In Question**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: ① View north

ROOM NO. 139

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 129

ROOM NO: 140 LAST KNOWN USE: Medical Division SQUARE FEET: 366 s.f. CEILING HEIGHT: 18'-8" DATE: 22 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [X] Vinyl [ ] Linoleum [ ] Other:	[ ] Good [ ] Fair [X] Poor (Pieces of Copper Roofing Obscure Floor + Base) [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	10.5"h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Picture molding
CEILING:	[X] Plaster [ ] Acoustic panels [X] Cove [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] Wood/~~Glass~~ Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Opening in door has wire mesh. Door to hall boarded over.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Fixtures [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	( ) F ( ) B ( ) W ( ) C	[ ] **Good** [ ] **Fair** [X] **Poor** [ ] **Destroyed**	[X] **1900-1906** [ ] **1907-1923** [ ] **1924-Present** [ ] **In Question**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: ① View northwest

ROOM NO. 140

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING

ROOM NO: 140 A LAST KNOWN USE: Toilet SQUARE FEET: 22 s.f. CEILING HEIGHT: 18'-8" DATE: 22 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☐ Linoleum ☒ Other: Marble	☐ Good ☐ Fair ☐ Poor DEBRIS ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☒ Other: Marble	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	Missing on e. + part of s. wall.
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Glazed Wood Partitions ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☒ Other: No door	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
LIGHTING:	☒ Incandescent ☐ Fluorescent ☐ Missing ☐ Other:	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	Wall pendant / no globe.
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents/Fans ☒ Fixtures ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	1 sink 1 toilet
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
SUMMARY:	○ F ○ B ○ W ○ C	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS: ① View northwest

ROOM NO. 140A

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 133

ROOM NO: 141 LAST KNOWN USE: Medical Division SQUARE FEET: 312 s.f. CEILING HEIGHT: 18'-8" DATE: 22 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [X] Vinyl [ ] Linoleum [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed Pieces of Copper Roof Obscure Floor+base	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	9" Sq.'s.
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	10.5"h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Picture molding
CEILING:	[X] Plaster [ ] Acoustic panels [X] Cove [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] Wood/~~Glass~~ Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Wire mesh over openings to Rm. 140. Door to Rm. 155 is off hinges, leaning against the wall.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Fixtures [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ F ○ B ○ W ○ C	[X] **Good** [X] **Fair** [ ] **Poor** [ ] **Destroyed**	[X] **1900-1906** [ ] **1907-1923** [ ] **1924-Present** [ ] **In Question**	**ARCHITECTURAL SIGNIFICANCE:** [X] **Most** [ ] **Some** [ ] **Minor** [ ] **Negligible**

PHOTOGRAPHS: (1) View north

ROOM NO. 141

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 135

ROOM NO: 143 LAST KNOWN USE: Records SQUARE FEET: 1166 s.f. CEILING HEIGHT: 11'-11" 18'-6½" DATE: 21 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[ ] Good [ ] Fair DEBRIS [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 1¼"
BASE:	[ ] Wood [X] Tile [ ] Tile Wainscot [ ] Other:	[ ] Good [ ] Fair DEBRIS [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	10" h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [X] Other: Masonite	[ ] Good [X] Fair Masonite [X] Poor Plaster [ ] Destroyed	[X] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	2 holes in masonite on e. wall- one 5" diam, the other 10" diam.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair 1 [ ] Poor [X] Destroyed 3	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Door has wire mesh over glass.
LIGHTING:	[ ] Incandescent [ ] Fluorescent [X] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Fixtures [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY: ○ F ○ B ○ W ○ C

[ ] Good [X] Fair [X] Poor [ ] Destroyed

[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question

ARCHITECTURAL SIGNIFICANCE: [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) View southwest (2) View southeast ROOM NO. 143

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 137

ROOM NO: 144 LAST KNOWN USE: Unknown SQUARE FEET: 55 s.f. CEILING HEIGHT: 11'-10" DATE: 21 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[ ] Good [ ] Fair DEBRIS [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 1 1/4"
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	10"
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [X] Other: Masonite	[ ] Good [X] Fair Masonite [X] Poor Plaster [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	1 sm. hole, 5" diam, on n. wall. 1 hole, 10" diam., on W. wall.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Double door with wire mesh over glass transom.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents Fans [ ] Fixtures [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ F ○ B ○ W ○ C	[X] **Good** [ ] **Fair** [ ] **Poor** [ ] **Destroyed**	[ ] **1900-1906** [ ] **1907-1923** [X] **1924-Present** [ ] **In Question**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [ ] Minor [X] Negligible

PHOTOGRAPHS: (1) View west

ROOM NO. 144

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING

ROOM NO: 145 LAST KNOWN USE: Shower Room SQUARE FEET: 238 s.f. CEILING HEIGHT: 18'-6½" DATE: 21 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [X] Other: Concrete	[ ] Good [ ] Fair DEBRIS [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	Raised concrete platform on e.&w. sides for showers. Hex. 1'1/4" -center aisle
BASE:	[ ] Wood [ ] Tile [ ] Tile Wainscot [X] Other: none	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [X] Other: Concrete Partitions	[ ] Good [X] Fair Concrete [X] Poor Plaster [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [X] Other: None	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [X] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	1 badly rusted shade / no globe.
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [X] Fixtures [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Holes + screws in walls + raised platforms indicate that there were showers.
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	( ) F ( ) B ( ) W ( ) C	[ ] Good [ ] Fair [X] Poor	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor

PHOTOGRAPHS: (1) View south

ROOM NO. 145

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 141

ROOM NO: 146 LAST KNOWN USE: Bathroom SQUARE FEET: 468 s.f. CEILING HEIGHT: 12'-1" DATE: 21 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☐ Linoleum ☐ Other:	☐ Good ☐ Fair DEBRIS ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
BASE:	☐ Wood ☐ Tile ☒ Tile Wainscot ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	Wainscot along part of S. wall.
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Glazed Wood Partitions ☒ Other: Concrete partition	☒ Good Concrete ☒ Fair Plaster ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☒ 1924-Present ☐ In Question	Pier on W. wall - brick fully exposed.
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other:	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☒ Other: None	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
LIGHTING:	☒ Incandescent ☐ Fluorescent ☐ Missing ☐ Other:	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents Fans ☒ Fixtures ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☒ 1924-Present ☐ In Question	4 urinals; 9 toilets; 2 pedestal sinks; 1 slop sink; 1 mirror.
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
SUMMARY:	○ F ○ B ○ W ○ C	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☒ 1924-Present ☐ In Question	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor

PHOTOGRAPHS: (1) View South

ROOM NO. 146

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 143

ROOM NO: 147 LAST KNOWN USE: Unknown SQUARE FEET: 119 s.f. CEILING HEIGHT: 12'-1" DATE: 21 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☐ Linoleum ☐ Other:	☐ Good ☐ Fair DEBRIS ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☒ Other: None	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
WALLS:	☐ Plaster ☐ Gypsum Board ☐ Glazed Wood Partitions ☒ Other: Concrete Partitions	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☒ 1924-Present ☐ In Question	
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other:	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☒ Other: None	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
LIGHTING:	☒ Incandescent ☐ Fluorescent ☐ Missing ☐ Other:	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents/Fans ☐ Fixtures ☒ Other: None	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
SUMMARY:	○ F ○ B ○ W ○ C	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☒ 1924-Present ☐ In Question	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☐ Minor ☑ Negligible

PHOTOGRAPHS: (1) View South

ROOM NO. 147

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 145

ROOM NO: 148 LAST KNOWN USE: Passage SQUARE FEET: 195.75 s.f. CEILING HEIGHT: 12'-1" DATE: 21 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☐ Linoleum ☐ Other:	☐ Good ☐ Fair DEBRIS ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
BASE:	☐ Wood ☒ Tile ☐ Tile Wainscot ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	10"h.
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Glazed Wood Partitions ☒ Other: Concrete Partitions	☒ Good Concrete ☐ Fair ☒ Poor Plaster ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☒ 1924-Present ☐ In Question	
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other:	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
DOORS/ OPENINGS:	☒ ~~Wood~~/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☒ 1924-Present ☐ In Question	Transom Double doors have wire mesh over glass + transom.
LIGHTING:	☐ Incandescent ☐ Fluorescent ☒ Missing ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents Fans ☐ Fixtures ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
SUMMARY:	E B W C	☐ Good ☐ Fair ☒ Poor	☒ 1900-1906 ☐ 1907-1923 ☒ 1924-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☐ Minor

PHOTOGRAPHS: ① View east

ROOM NO. 148

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 147

ROOM NO: 149 LAST KNOWN USE: Toilet SQUARE FEET: 25 s.f. CEILING HEIGHT: 12'-1" DATE: 21 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☐ Linoleum ☐ Other:	☐ Good ☐ Fair DEBRIS ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
BASE:	☐ Wood ☒ Tile ☐ Tile Wainscot ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	10"h.
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Glazed Wood Partitions ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☒ 1924-Present ☐ In Question	
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other:	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
DOORS/ OPENINGS:	☒ ~~Wood~~/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☒ 1924-Present ☐ In Question	
LIGHTING:	☐ Incandescent ☐ Fluorescent ☒ Missing ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☒ Vents/Fans ☒ Fixtures ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☒ 1924-Present ☐ In Question	Toilet Sink
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
SUMMARY:	○ F ○ B ○ W ○ C	☐ **Good** ☐ **Fair** ☒ **Poor** ☐ **Destroyed**	☐ **1900-1906** ☐ **1907-1923** ☒ **1924-Present** ☐ **In Question**	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☐ Minor

PHOTOGRAPHS: (1) View Southwest

ROOM NO. 149

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING

ROOM NO: 150 LAST KNOWN USE: Toilet SQUARE FEET: 55 s.f. CEILING HEIGHT: 12'-1" DATE: 21 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[ ] Good [ ] Fair [ ] Poor DEBRIS [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
BASE:	[ ] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[ ] Good [ ] Fair [ ] Poor DEBRIS [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [X] Other: Missing	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents Fans [ ] Fixtures [X] Other: None	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:	[X] Cupboards	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
SUMMARY:	( ) E ( ) B ( ) W ( ) C	[ ] Good [ ] Fair [X] Poor	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [ ] Minor

PHOTOGRAPHS: (1) View north

ROOM NO. 151

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 151

ROOM NO: 152 LAST KNOWN USE: Medical Division SQUARE FEET: 403 s.f. CEILING HEIGHT: 18'-7½" DATE: 22 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [X] Vinyl [ ] Linoleum [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	9" sq's.
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	10.5" h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [X] Cove [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Columns support beams along ceiling
DOORS/ OPENINGS:	[X] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	1 dbl. door 4 doors
LIGHTING:	[ ] Incandescent [X] Fluorescent [ ] Missing [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	3 suspended fixtures
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Fixtures [X] Other: Electric heater	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ F ○ B ○ W ○ C	[ ] **Good** [X] **Fair** [ ] **Poor** [ ] **Destroyed**	[X] **1900-1906** [ ] **1907-1923** [ ] **1924-Present** [ ] **In Question**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: (1) View south (2) View southeast ROOM NO. 152

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 153

ROOM NO: 153 LAST KNOWN USE: Medical Division SQUARE FEET: 403 s.f. CEILING HEIGHT: 18'-7½" DATE: 21 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☒ Vinyl ☐ Linoleum ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☒ 1924-Present ☐ In Question	9"sq's.
BASE:	☒ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	10.5"h.
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Glazed Wood Partitions ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	
CEILING:	☒ Plaster ☐ Acoustic panels ☒ Cove ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	Columns support beams along ceiling
DOORS/ OPENINGS:	☒ ~~Wood~~/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	Double door 3 single doors
LIGHTING:	☐ Incandescent ☒ Fluorescent ☐ Missing ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ Pre-1924 ☒ Post-1924 ☐ In Question	3 suspended fixtures.
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents/Fans ☐ Fixtures ☒ Other: Electric heater	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☒ 1924-Present ☐ In Question	Radiators missing.
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	

SUMMARY: ○ F ○ B ○ W ○ C

☐ Good ☒ Poor

☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present

ARCHITECTURAL SIGNIFICANCE: ☐ Most ☒ Some ☐ Minor

PHOTOGRAPHS: (1) View South (2) Column base ROOM NO. 153

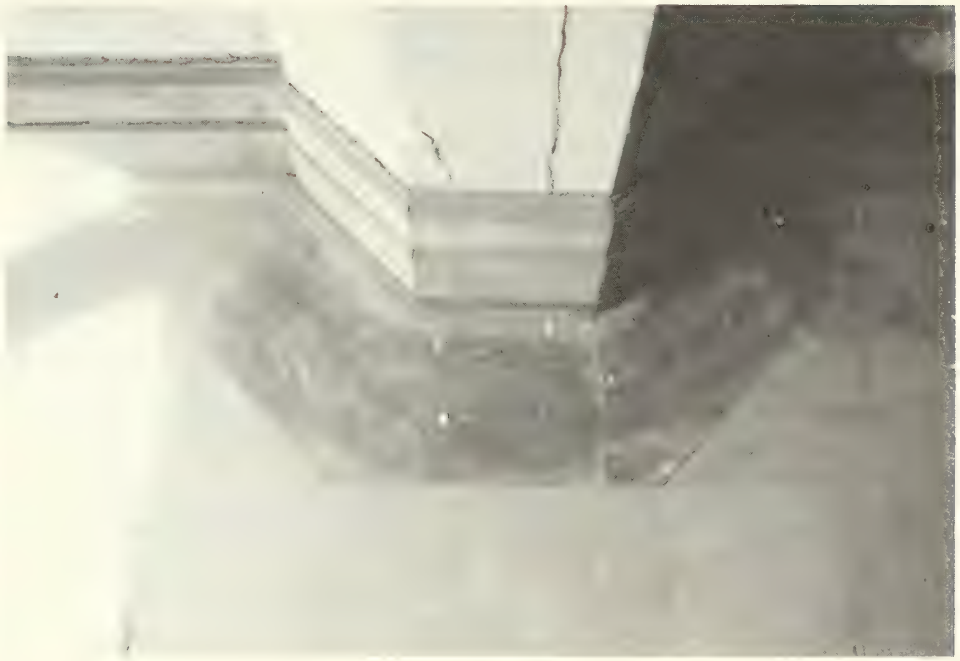

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 155

ROOM NO: 154 LAST KNOWN USE: Medical Division SQUARE FEET: 312 s.f. CEILING HEIGHT: 18'-7½" DATE: 21 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [X] Vinyl [ ] Linoleum [ ] Other:	[ ] Good [X] Fair DEBRIS [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	9"sq's.
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[ ] Good [ ] Fair [ ] Poor DEBRIS [ ] Destroyed	[X] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	10.5"h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [X] Cove [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Columns support beams along ceiling.
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Double doors. 2 single doors.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair 2 [ ] Poor [ ] Destroyed 1	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	1 suspended fixture w/ shade/no globe 1 wall fixture 1 destroyed fixture
HEATING/ VENTILATION PLUMBING:	[X] Radiators [X] Vents/Fans [ ] Fixtures [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	radiator vent on n. wall
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	( ) F ( ) B ( ) W ( ) C	[X] **Good** [ ] **Fair** [ ] **Poor** [ ] **Destroyed**	[X] **1900-1906** [ ] **1907-1923** [ ] **1924-Present** [ ] **In Question**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: (1) View south

ROOM NO. 154

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 157

ROOM NO: 155 LAST KNOWN USE: Medical Division SQUARE FEET: 676 s.f. CEILING HEIGHT: 18'-8" DATE: 22 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [X] Vinyl [ ] Linoleum [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	9"Sq's.
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [X] Cove [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Columns support beams along ceiling.
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Door is in good condition, but off hinges, leaning against
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	2 suspended fixtures with shades / no globes.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Fixtures [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	2 radiators
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	◯ ◯ ◯ ◯	[X] **Good** [ ] **Fair** [ ] **Poor**	[X] **1900-1906** [ ] **1907-1923** [ ] **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** [ ] **Most** [X] **Some** [ ] **Minor**

PHOTOGRAPHS: (1) Column capital (2) Cove ceiling (3) View northeast (4) View Southwest ROOM NO. 155

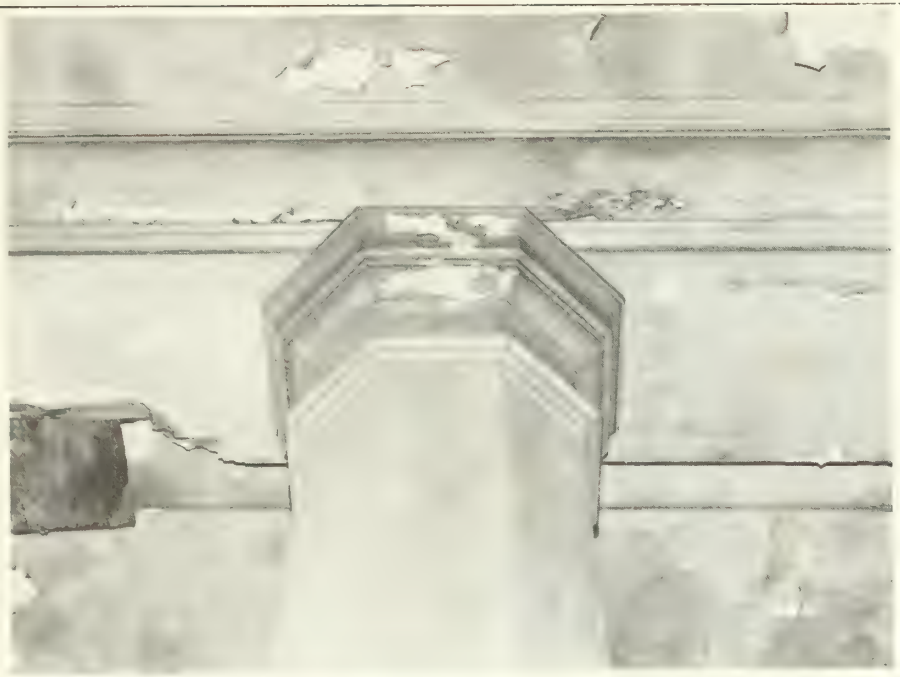

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 159

ROOM NO: 156 LAST KNOWN USE: Vault SQUARE FEET: 1092 s.f. CEILING HEIGHT: 17'-9½" DATE: 21 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [ ] Vinyl [X] Linoleum [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
BASE:	[ ] Wood [ ] Tile [ ] Tile Wainscot [X] Other: Stone?	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	E. + W. walls.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[X] Good 5 [ ] Fair [X] Poor 1 [X] Destroyed 5	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	5 suspended fixtures with globes 5 " " missing. 1 wall sconce - rusted.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	2 radiators
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ F ○ B ○ W ○ C	[X] **Good** [ ] **Fair** [ ] **Poor** [ ] **Destroyed**	[X] **1900-1906** [ ] **1907-1923** [ ] **1924-Present** [ ] **In Question**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor

PHOTOGRAPHS: (1) View east (2) View southwest ROOM NO. 156

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 161

ROOM NO: 157, 157A, 157B, 157C, 157D LAST KNOWN USE: Medical Locker Room SQUARE FEET: 2745.f. CEILING HEIGHT: 18'-8" DATE: 21 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☒ Vinyl ☐ Linoleum ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☒ 1924-Present ☐ In Question	9"Sq's.
BASE:	☒ Wood ☐ Tile ☒ Tile Wainscot ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Glazed Wood Partitions ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	Beam along ceiling.
DOORS/ OPENINGS:	☒ ~~Wood~~/Glass Panelled ☐ Wood Veneer ☒ Galvanized Metal ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	Galv. Metal doors - 1 has a small window.
LIGHTING:	☒ Incandescent ☐ Fluorescent ☐ Missing ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	2 suspended shades without globes 1 " globe. 1 wall fixture w/ metal grille over it.
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents Fans ☒ Fixtures ☐ Other:	☒ Good Radiator ☐ Fair ☒ Poor Fixtures ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	157 B has remnants of shower. 157 C has toilet + pedestal sink
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
SUMMARY:	◯ ◯ ◯ ◯	☒ **Good** ☐ **Fair** ☐ **Poor**	☒ **1900-1906** ☒ **1907-1923** ☐ **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor

PHOTOGRAPHS: (1) View northeast (2) northwest

ROOM NO. 157, 157A, 157B 157C, 157D

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 163

ROOM NO: 158 LAST KNOWN USE: Medical Division SQUARE FEET: 364 s.f. CEILING HEIGHT: 18'-8" DATE: 21 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [X] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	9"Sq's. Pieces of Copper Roof Obscure Floor
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	10.5"h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [X] Cove [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Beam along ceiling.
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Transom
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	1 suspended shade without globe.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	sm. vent on w. wall radiator
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	( ) F ( ) B ( ) W ( ) C	[ ] Good [X] Fair [ ] Poor	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor

PHOTOGRAPHS: (1) View east

ROOM NO. 158

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 165

ROOM NO: 159 LAST KNOWN USE: Medical Division Office SQUARE FEET: 414.5 s.f. CEILING HEIGHT: 18'-8" DATE: 21 Sept. 1981

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [X] Vinyl [ ] Linoleum [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed Pieces of copper roof obscure floor.	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	9" Sq's.
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	10.5"h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Section cut through to Rm. 160 on S. wall.
CEILING:	[X] Plaster [ ] Acoustic panels [X] Cove [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Column supports beam along ceiling.
DOORS/ OPENINGS:	[X] ~~Wood~~ Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	1 shade / no globe - corroded badly.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents / Fans [X] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	sink
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ F ○ B ○ W ○ C	[ ] **Good** [X] **Fair** [ ] **Poor** [ ] **Destroyed**	[X] **1900-1906** [ ] **1907-1923** [ ] **1924-Present** [ ] **In Question**	**ARCHITECTURAL SIGNIFICANCE:** [ ] **Most** [X] **Some** [ ] **Minor**

PHOTOGRAPHS: (1) View east

ROOM NO. 159

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 167

ROOM NO: 159A LAST KNOWN USE: Closet SQUARE FEET: 18 s.f. CEILING HEIGHT: DATE: 21 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☒ Vinyl ☐ Linoleum ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☒ 1924-Present ☐ In Question	9" sq's.
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☒ Other: None	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Glazed Wood Partitions ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
DOORS/ OPENINGS:	☒ ~~Wood~~/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
LIGHTING:	☐ Incandescent ☐ Fluorescent ☐ Missing ☒ Other: None	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents/Fans ☐ Fixtures ☒ Other: None	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
MISCELLANEOUS:	☒ hooks ☒ wood cupboards & drawers ☐ ☐	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☒ In Question	
SUMMARY:	○ F ○ B ○ W ○ C	☒ **Good** ☐ **Fair** ☐ **Poor** ☐ Destroyed	☒ **1900-1906** ☐ **1907-1923** ☐ **1924-Present** ☐ In Question	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☐ Minor

PHOTOGRAPHS: Not possible to photograph because of copper roof in front of door. ROOM NO. 159A

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 169

ROOM NO: 160 LAST KNOWN USE: Medical Division SQUARE FEET: 468 s.f. CEILING HEIGHT: 18'-10" DATE: 21 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [X] Vinyl [ ] Linoleum [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	9"sq's.
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	10.5"h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Large opening in n. wall - 42" wide at widest point. - beam exposed. W. wall - electric box / no door / wood frame.
CEILING:	[X] Plaster [ ] Acoustic panels [X] Cove [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~ / Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor 1 [X] Destroyed 1	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	3 suspended fixtures - shades / no globes.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents / Fans [ ] Fixtures [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	2 radiators.
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ F ○ B ○ W ○ C	[X] **Good** [ ] **Fair** [ ] **Poor** [ ] **Destroyed**	[X] **1900-1906** [ ] **1907-1923** [ ] **1924-Present** [ ] **In Question**	**ARCHITECTURAL SIGNIFICANCE:** [ ] **Most** [X] **Some** [ ] **Minor** [ ] **Negligible**

PHOTOGRAPHS: (1) Column, north wall (2) View southeast (3) View southwest ROOM NO. 160

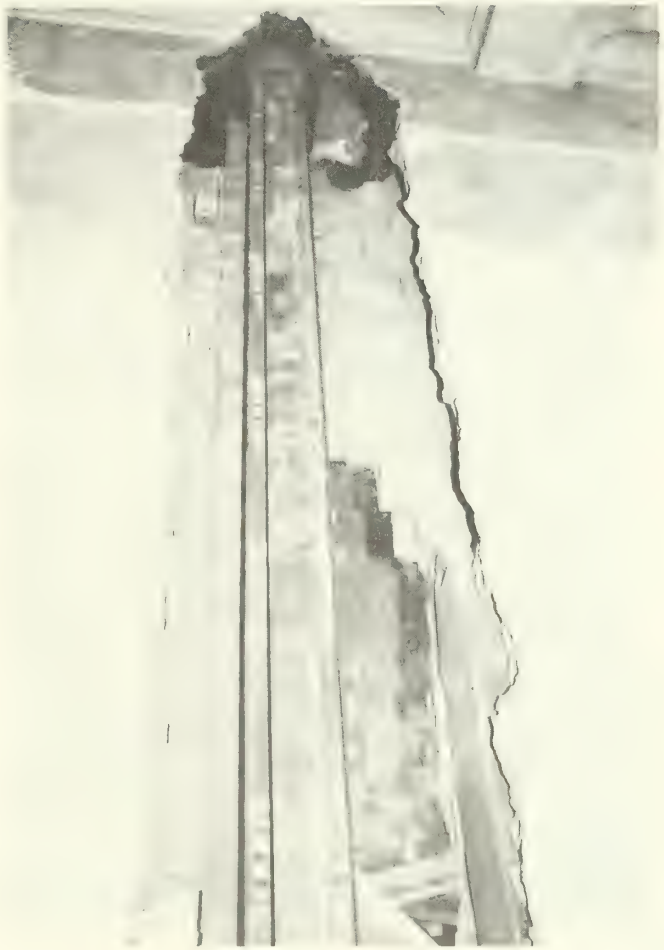

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 171

ROOM NO: 160A LAST KNOWN USE: Toilet SQUARE FEET: 35 S.F. CEILING HEIGHT: 18'-10" DATE: 21 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [X] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	9"Sq's.
BASE:	[ ] Wood [ ] Tile [ ] Tile Wainscot [X] Other: Marble wainscot	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Glass broken.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [X] Fixtures [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Sink; mirror; paper towel dispenser; Toilet; toilet paper holder; radiator
MISCELLANEOUS:	[ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY:	( ) F ( ) B ( ) W ( ) C	[X] Good / Fair / Poor / Destroyed	[X] 1900-1906 / 1907-1923 / 1924-Present / In Question	**ARCHITECTURAL SIGNIFICANCE:**	[ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) View northwest

ROOM NO. 160A

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 173

ROOM NO: H101 LAST KNOWN USE: Passage SQUARE FEET: 1116 s.f. CEILING HEIGHT: 18'-5½" DATE: 20 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	X Tile Vinyl Linoleum Other:	X Good Fair Poor Destroyed	1900-1906 1907-1923 X 1924-Present In Question	Red tile- 6"sq. + 6"x 9".
BASE:	X Wood X Tile Tile Wainscot Other:	X Good Fair Poor Destroyed	1900-1906 X 1907-1923 X 1924-Present In Question	6"h.
WALLS:	X Plaster Gypsum Board X Glazed Wood Partitions X Other: Wire mesh	Good Fair X Poor Destroyed	X 1900-1906 1907-1923 X 1924-Present In Question	s. half of e. wall - wire mesh above plaster. second column from south is totally exposed to beam on 3 sides (betw. Rms 103+104). Bulletin Board at s. end of e. wall.
CEILING:	X Plaster Acoustic panels Cove Other:	Good Fair X Poor Destroyed	X 1900-1906 1907-1923 1924-Present In Question	
DOORS/ OPENINGS:	X Wood Glass Panelled Wood Veneer Galvanized Metal Other:	Good X Fair Poor Destroyed	X 1900-1906 1907-1923 X 1924-Present In Question	
LIGHTING:	X Incandescent Fluorescent Missing Other:	Good Fair Poor X Destroyed	Pre-1924 Post-1924 In Question	
HEATING/ VENTILATION PLUMBING:	X Radiators Vents Fans Fixtures Other:	Good X Fair Poor Destroyed	X 1900-1906 1907-1923 1924-Present In Question	
MISCELLANEOUS:		Good Fair Poor Destroyed	1900-1906 1907-1923 1924-Present In Question	
SUMMARY:	○ F ○ B ○ W ○ C	Good Fair X Poor	X 1900-1906 1907-1923 X 1924-Present	**ARCHITECTURAL SIGNIFICANCE:** Most / X Some / Minor

PHOTOGRAPHS: (1) View north (2) View south (3) Tile floor ROOM NO. H101

PHOTOGRAPHS: (1) Short section of hall by Stair 08 & Rm. 110, view east ROOM NO. H101

PHOTOGRAPHS:

ROOM NO.

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 177

ROOM NO: H107 LAST KNOWN USE: Passage SQUARE FEET: 938 s.f. CEILING HEIGHT: 18'-5½" DATE: 20 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Red tile - 6" x 9", 6"sq.
BASE:	[X] Wood [X] Tile [ ] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	
WALLS:	[X] Plaster [ ] Gypsum Board [X] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor Wood [X] Destroyed Plaster	[X] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	Glass missing.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~ /Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	Transom Galv. metal door - sm. window. Dbl. doorway at e. end has glazed arched tympanum with fixed + pivoted windows.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Fixtures [X] Other: None	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	F B W C	[ ] **Good** [X] **Fair** [ ] **Poor** [ ] Destroyed	[X] **1900-1906** [X] **1907-1923** [X] **1924-Present** [ ] In Question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: (1) View east toward Stair 11

ROOM NO. H 102

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 179

ROOM NO: H103 LAST KNOWN USE: Passage SQUARE FEET: 325.55 s.f. CEILING HEIGHT: 18'-4½" DATE: 20 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Red Tile - 6" sq. + 6" x 9"
BASE:	[ ] Wood [X] Tile [ ] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Red Tile 5"
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [X] Other: Wire mesh	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Wire mesh above plaster. Electric box, rusted, door fallen off.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [X] Other: Wire mesh	[ ] Good [X] Fair [ ] Poor [X] Destroyed Door to Rm. 112	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Wire mesh door across e. end of hall.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Fixtures [X] Other: None	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:	[ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY:	○ F ○ B ○ W ○ C	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	**ARCHITECTURAL SIGNIFICANCE:**	[ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: ① View east

ROOM NO. H103

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 181

ROOM NO: H104 LAST KNOWN USE: Passage SQUARE FEET: 283.5 s.f. CEILING HEIGHT: 18'-4½" DATE: 20 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Red tile, 6"x 9" + 6" Sq.
BASE:	[ ] Wood [X] Tile [ ] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	5"h. Red tile.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [X] Other: Wire mesh	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Wire mesh above plaster.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Transom Dbl. doors.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents Fans [ ] Fixtures [X] Other: Pipes	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Pipes along ceiling rusted
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ F ○ B ○ W ○ C	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: ① View north

ROOM NO. H104

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 183

ROOM NO: H106 LAST KNOWN USE: Passage SQUARE FEET: 5645 s.f. CEILING HEIGHT: 18'-6 1/4" DATE: 20 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 1 1/4".
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	5'h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [X] Other: Glass	[ ] Good [X] Fair [X] Poor Plaster [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Steel mullions-some glass missing rear top; rusted.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair 1 [ ] Poor [X] Destroyed 1	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ F ○ B ○ W ○ C	[ ] **Good** [X] **Fair** [ ] **Poor** [ ] **Destroyed**	[ ] **1900-1906** [ ] **1907-1923** [X] **1924-Present** [ ] **In Question**	**ARCHITECTURAL SIGNIFICANCE:** [ ] **Most** [X] **Some** [ ] **Minor**

PHOTOGRAPHS: (1) View north

ROOM NO. H106

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 185

ROOM NO: H107 LAST KNOWN USE: Passage SQUARE FEET: 1197 S.f. CEILING HEIGHT: 18'-5" DATE: 20 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Hex. 1 1/4", 3" sq".
BASE:	[ ] Wood [X] Tile [ ] Tile Wainscot [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Red tile.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [X] Other: Wire mesh	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Wire mesh above plaster.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	Galv. Metal-glazed.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[X] Good 4 [ ] Fair [ ] Poor [X] Destroyed 5	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	4 suspended fixtures w/ globes 5 " w/out globes.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents Fans [ ] Fixtures [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	4 radiators
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY:	○ F ○ B ○ W ○ C	[X] Good / Fair / [ ] Poor / [ ] Destroyed	[ ] 1900-1906 / [ ] 1907-1923 / [X] 1924-Present / [ ] In Question	**ARCHITECTURAL SIGNIFICANCE:**	[ ] Most / [ ] Some / [X] Minor / [ ] Negligible

PHOTOGRAPHS: (1) View east (2) Tile floor ROOM NO. H107

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING

ROOM NO: H108 LAST KNOWN USE: Passage SQUARE FEET: 450 S.F. CEILING HEIGHT: 14'-3" DATE: 21 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 2"
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	67"h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Electric boxes on n. wall at e. end + on s. wall at w. end.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [X] Other: Wire mesh	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Transoms Wire mesh guards over transoms. Wire mesh door in front of Rm. 134A.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Fixtures [X] Other: None	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:	[ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	( ) F ( ) B ( ) W ( ) C	[ ] **Good** [X] **Fair** [ ] **Poor** [ ] **Destroyed**	[X] **1900-1906** [ ] **1907-1923** [ ] **1924-Present** [ ] **In Question**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor

PHOTOGRAPHS: (1) View west (2) View east ROOM NO. 1108

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 189

ROOM NO: H109 LAST KNOWN USE: Passage SQUARE FEET: 752 s.f. CEILING HEIGHT: 18'-6 1/2" DATE: 21 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 1'1/4"
BASE:	[X] Wood [X] Tile [ ] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	Tile - 10"h. Wood - 4"h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [X] Other: Masonite; Concrete	[X] Good Masonite, Concrete [ ] Fair [X] Poor Plaster [ ] Destroyed	[X] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Columns support beams along Ceiling.
DOORS/ OPENINGS:	[X] Wood/~~Glass~~ Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	Galv. Metal - windows
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	5 Suspended fixtures w/ shades/ no globes.
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents Fans [X] Fixtures [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Drinking fountain on s. wall. pipes along e. + s. walls.
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ E ○ B ○ W ○ C	[ ] **Good** [ ] **Fair** [X] **Poor**	[X] **1900-1906** [ ] **1907-1923** [X] **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor

PHOTOGRAPHS: ① View east

ROOM NO. H109

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 191

ROOM NO: H110 LAST KNOWN USE: Passage SQUARE FEET: 412.5 s.f. CEILING HEIGHT: 14'-3" DATE: 21 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 2".
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	67"h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Galv. Metal doors are glazed. Transoms Wire mesh guards over transoms.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ F ○ B ○ W ○ C	[X] **Good** [ ] **Fair** [ ] **Poor** [ ] **Destroyed**	[X] **1900-1906** [ ] **1907-1923** [ ] **1924-Present** [ ] **In Question**	**ARCHITECTURAL SIGNIFICANCE:** [ ] **Most** [X] **Some** [ ] **Minor** [ ] **Negligible**

PHOTOGRAPHS: ① View west ② View east ROOM NO. H 110

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 193

ROOM NO: H111 LAST KNOWN USE: Passage SQUARE FEET: 556 S.F. CEILING HEIGHT: 14'-3" DATE: 21 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 2".
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	67"h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~ /Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Wire mesh guards over transoms. Wire mesh door across center of hall.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents Fans [ ] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ F ○ R ○ W ○ C	[ ] **Good** [X] **Fair** [ ] **Poor**	[X] **1900-1906** [ ] **1907-1923** [ ] **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** [ ] **Most** [X] **Some** [ ] **Minor**

PHOTOGRAPHS: (1) View north (2) View south ROOM NO. H111

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 195

ROOM NO: H112 LAST KNOWN USE: Passage SQUARE FEET: 274 s.f. CEILING HEIGHT: 18'-6" DATE: 21 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 2".
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	67"h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Door to basement (S07) has wire mesh instead of glass in opening.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents Fans [ ] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	2 radiators
MISCELLANEOUS:	[ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ F ○ B ○ W ○ C	[X] **Good** [ ] **Fair** [ ] **Poor** [ ] **Destroyed**	[X] **1900-1906** [ ] **1907-1923** [ ] **1924-Present** [ ] **In Question**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor

PHOTOGRAPHS: (1) View east (2) View west ROOM NO. H112

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 197

ROOM NO: H113 LAST KNOWN USE: Passage SQUARE FEET: 18 S.f. CEILING HEIGHT: 14'-4" DATE: 21 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [X] Vinyl [ ] Linoleum [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	9"Sq's.
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	10.5"h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[X] Good [ ] Fair [ ] Poor [X] Destroyed Door to R.M. 160	[X] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Transoms
LIGHTING:	[ ] Incandescent [ ] Fluorescent [ ] Missing [X] Other: None	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents Fans [ ] Fixtures [X] Other: None	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ F ○ B ○ W ○ C	[X] **Good** **Fair** **Poor** Destroyed	[X] **1900-1906** **1907-1923** **1924-Present** In Question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [ ] Minor

PHOTOGRAPHS: ① View south

ROOM NO. H113

C. SECOND FLOOR

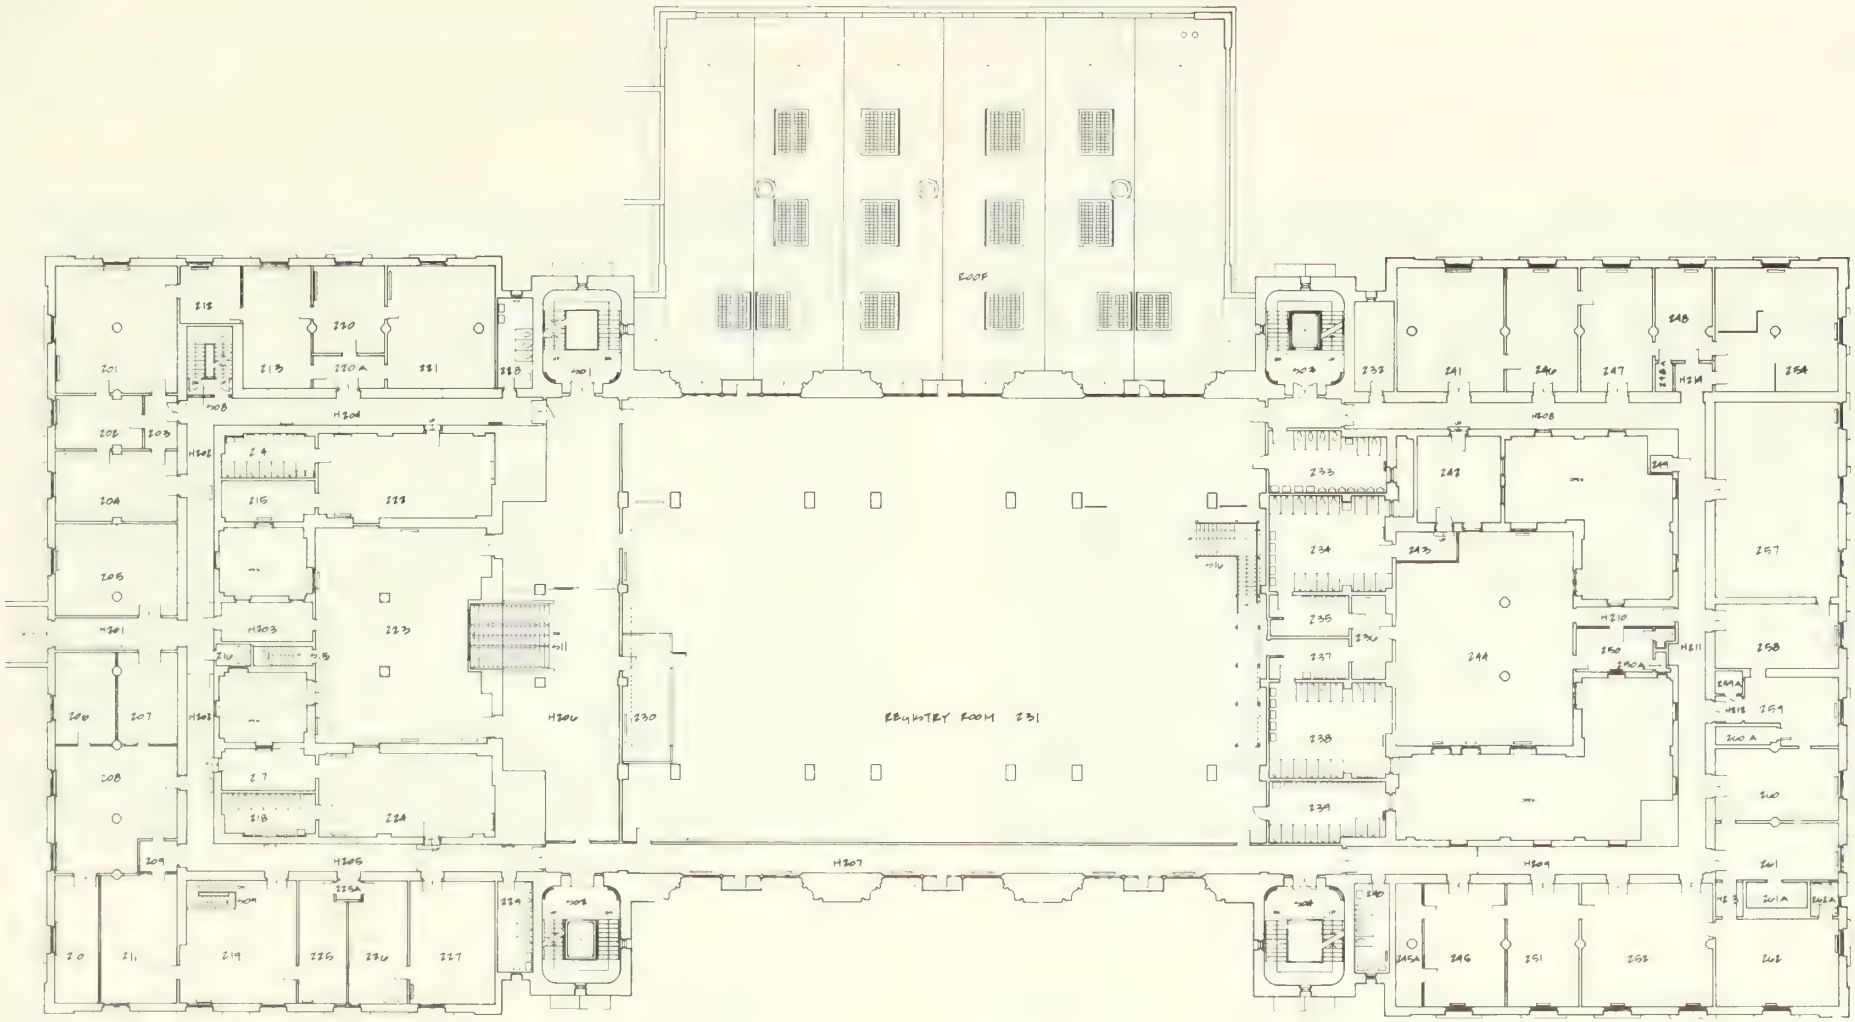

'AS FOUND' DRAWING

SECOND FLOOR PLAN

356	26,003 / 8 of 9
DSC	JUL 88

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 200

ROOM NO: 201 LAST KNOWN USE: office SQUARE FEET: 728.75 s.f. CEILING HEIGHT: 15'-6½" DATE: 14 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [ ] Vinyl [X] Linoleum [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	10.5"h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Picture molding + panel moldings - some still extant.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Inlay
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[X] Good 4 [X] Fair 1 [ ] Poor [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	5 fixtures with shades; 4 have globes.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents Fans [ ] Fixtures [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	2 radiators Numerous exposed pipes along ceiling.
MISCELLANEOUS:	[ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ F ○ B ○ W ○ C	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: (1) View southwest (2) View southeast ROOM NO. 201

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 202

ROOM NO: 202 LAST KNOWN USE: Office SQUARE FEET: 218.5 s.f. CEILING HEIGHT: 15'-6½" DATE: 14 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Linoleum ☐ Other:	☐ Good ☐ Fair ☒ Poor DEBRIS ☐ Destroyed	☐ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	
BASE:	☒ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☐ Good ☒ Fair DEBRIS ☐ Poor ☐ Destroyed	☒ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	10.5"h.
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Glazed Wood Partitions ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	E. wall is 9'4" high w/ wood entablature. Picture moldings. Panel moldings.
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	Piers support beam along ceiling.
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☒ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	Inlay 3 doors
LIGHTING:	☒ Incandescent ☐ Fluorescent ☐ Missing ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	2 suspended fixtures w/ shades + globes.
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents Fans ☐ Fixtures ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
SUMMARY:	○ F ○ B ○ W ○ C	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☐ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS: (1) View southwest (2) View southeast (2) Column base ROOM NO. 202

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 204

ROOM NO: 203 LAST KNOWN USE: Office SQUARE FEET: 80.5 s.f. CEILING HEIGHT: 15'-6½" DATE: 14 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Linoleum ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	
BASE:	☒ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	10.5"h.
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Glazed Wood Partitions ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	W. wall is 9'4" h. w/ wood entablature. Picture molding Panel moldings
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	Piers support beams along ceiling.
DOORS/ OPENINGS:	☒ ~~Wood~~/Glass Panelled ☒ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	Glass panelled double doors; 3 veneer doors. Inlay on veneer doors.
LIGHTING:	☒ Incandescent ☐ Fluorescent ☐ Missing ☐ Other:	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents/Fans ☐ Fixtures ☒ Other: None	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	

SUMMARY:	○ F ○ B ○ W ○ C	☒ **Good** ☐ **Fair** ☐ **Poor**	☐ **1900-1906** ☒ **1907-1923** ☐ **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** ☐ **Most** ☐ **Some** ☑ **Minor**

PHOTOGRAPHS: (1) West wall

ROOM NO. 203

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 206

ROOM NO: 204 LAST KNOWN USE: Office SQUARE FEET: 397.5 s.f. CEILING HEIGHT: 15'-6½" DATE: 14 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [ ] Vinyl [X] Linoleum [ ] Other:	[ ] Good [X] Fair Debris [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	W. wall is missing top portion of molding. 10.5"h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Picture molding Panel moldings
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Piers support beam along ceiling.
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Glass panelled double door 3 veneer doors. - Inlay
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[X] Good 2 [ ] Fair [ ] Poor [X] Destroyed 2	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	2 fixtures with shades + globes 2 " missing.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Fixtures [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	◯ ◯ ◯ ◯	[ ] Good [ ] Fair [ ] Poor	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor

PHOTOGRAPHS: (1) View west (2) View east ROOM NO. 204

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 208

ROOM NO: 205 LAST KNOWN USE: Office SQUARE FEET: 530 s.f. CEILING HEIGHT: 15'-6½" DATE: 14 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [ ] Vinyl [X] Linoleum [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	10.5"h. Deteriorated on w. wall.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Section removed on n. wall. Picture moldings. Panel moldings.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Pier + column supports beam along ceiling.
DOORS/ OPENINGS:	[X] ~~Wood~~ Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Transom
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] Pre-1924 [X] Post-1924 [ ] In Question	5 fixtures with metal shades + blue globes
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents Fans [ ] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ F ○ B ○ W ○ C	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: (1) View northwest (2) View southeast ROOM NO. 205

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 210

ROOM NO: 206 LAST KNOWN USE: Office SQUARE FEET: 253.5 s.f. CEILING HEIGHT: 15'-3" DATE: 14 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Linoleum ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☐ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	
BASE:	☒ Wood ☐ Tile ☐ Tile Wainscot ☒ Other: Black composition	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☒ 1907-1923 ☒ 1924-Present ☐ In Question	
WALLS:	☒ Plaster ☐ Gypsum Board ☒ Glazed Wood Partitions ☐ Other:	☐ Good ☒ Fair Wood ☒ Poor Plaster ☐ Destroyed	☒ 1900-1906 ☒ 1907-1923 ☒ 1924-Present ☐ In Question	Wood Partitions missing lights. E. Wall - only 95" h. S. wall - Panelled + glazed wood partition with fluted pilasters.
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other:	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	Columns support beam along ceiling.
DOORS/ OPENINGS:	☒ ~~Wood~~/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	Transom
LIGHTING:	☒ Incandescent ☐ Fluorescent ☐ Missing ☐ Other:	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents / Fans ☐ Fixtures ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
SUMMARY:	○ F ○ B ○ W ○ C	☐ **Good** ☐ **Fair** ☒ **Poor**	☒ **1900-1906** ☒ **1907-1923** ☒ **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☒ Some ☐ Minor

PHOTOGRAPHS: (1) Southeast corner

ROOM NO. 206

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 212

ROOM NO: 207 LAST KNOWN USE: Office SQUARE FEET: 253.5 s.f. CEILING HEIGHT: 15'-3" DATE: 14 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Linoleum ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☐ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	
BASE:	☒ Wood ☐ Tile ☐ Tile Wainscot ☒ Other: Black Composition	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☒ 1907-1923 ☒ 1924-Present ☐ In Question	
WALLS:	☒ Plaster ☐ Gypsum Board ☒ Glazed Wood Partitions ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☒ 1907-1923 ☒ 1924-Present ☐ In Question	W. wall - only 95" h. - missing glass. S. Wall - panelled + glazed wood partition with fluted pilasters.
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	Columns support beam along ceiling.
DOORS/ OPENINGS:	☒ ~~Wood~~/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☐ 1900-1906 ☒ 1907-1923 ☒ 1924-Present ☐ In Question	Transom
LIGHTING:	☒ Incandescent ☐ Fluorescent ☐ Missing ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	2 suspended globes.
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☒ Vents/Fans ☐ Fixtures ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☒ In Question	Fan shelf on e. wall.
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
SUMMARY:	○ ○ ○ ○	☒ **Good** ☒ **Fair** ☒ **Poor**	☒ **1900-1906** ☒ **1907-1923** ☒ **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** ☐ **Most** ☒ **Some** ☐ **Minor**

PHOTOGRAPHS: (1) View Southwest

ROOM NO. 207

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING

ROOM NO: 208 LAST KNOWN USE: Special Inquiry Div. office SQUARE FEET: 665 s.f. CEILING HEIGHT: 15'-3" DATE: 14 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Linoleum ☐ Other:	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☐ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	Deteriorating wood floor exposed now.
BASE:	☒ Wood ☐ Tile ☐ Tile Wainscot ☒ Other: Black composition	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	
WALLS:	☒ Plaster ☐ Gypsum Board ☒ Glazed Wood Partitions ☐ Other:	☐ Good ☒ Fair Wood ☒ Poor Plaster ☐ Destroyed	☒ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	Partitions - missing glass.
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other:	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	Columns support beam along ceiling.
DOORS/ OPENINGS:	☒ ~~Wood~~ Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☒ Fair 4 ☐ Poor ☒ Destroyed 1	☒ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	Pair of double doors 2 single doors 1 door missing
LIGHTING:	☒ Incandescent ☐ Fluorescent ☐ Missing ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	5 fixtures with shades / no globes
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents Fans ☐ Fixtures ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	2 radiators
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
SUMMARY:	◯ ◯ ◯ ◯ E B W C	☐ **Good** ☐ **Fair** ☒ **Poor**	☒ **1900-1906** ☒ **1907-1923** ☐ **1924-Present** ☐ **In Question**	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☒ Some ☐ Minor ☐ Negligible

PHOTOGRAPHS: ① View southwest ② View northeast ③ Wood partition, north wall

ROOM NO. 208

PHOTOGRAPHS: (4) Column capital ROOM NO. 208

PHOTOGRAPHS:

ROOM NO.

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 218

ROOM NO: 209 LAST KNOWN USE: Passage SQUARE FEET: 52 s.f. CEILING HEIGHT: 15'-3" DATE: 15 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [ ] Vinyl [X] Linoleum [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	10.5"h.
WALLS:	[X] Plaster [ ] Gypsum Board [X] Glazed Wood Partitions [ ] Other:	[X] Good Wood [ ] Fair [X] Poor plaster [ ] Destroyed	[X] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Pivoted window on e. wall.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Transom
LIGHTING:	[ ] Incandescent [ ] Fluorescent [X] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents Fans [ ] Fixtures [X] Other: None	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ ○ ○ ○ F B W C	[ ] **Good** [X] **Fair** [ ] **Poor** [ ] **Destroyed**	[X] **1900-1906** [ ] **1907-1923** [ ] **1924-Present** [ ] **In Question**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) View west

ROOM NO. 209

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 220

ROOM NO: 210 LAST KNOWN USE: Board Secretaries SQUARE FEET: 261.25 s.f. CEILING HEIGHT: Original 15'-0" DATE: 15 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Linoleum ☐ Other:	☐ Good ☐ Fair ☒ Poor DEBRIS ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
BASE:	☒ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☒ Good DEBRIS ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☒ 1924-Present ☐ In Question	10.5" on n, w, s. walls 6.5" on e. wall.
WALLS:	☒ Plaster ☒ Gypsum Board ☐ Glazed Wood Partitions ☐ Other:	☐ Good ☐ Fair ☒ Poor Gypsum Board ☒ Destroyed Plaster	☒ 1900-1906 ☐ 1907-1923 ☒ 1924-Present ☐ In Question	
CEILING:	☒ Plaster Original ☒ Acoustic panels ☐ Cove ☐ Other:	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☒ 1924-Present ☐ In Question	
DOORS/ OPENINGS:	☒ ~~Wood~~ Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other.	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	Transom
LIGHTING:	☒ Incandescent ☐ Fluorescent ☐ Missing ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	2 fixtures w/shades + globes.
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents/Fans ☐ Fixtures ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	

SUMMARY:	○ F ○ B ○ W ○ C	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☒ 1924-Present ☐ In Question	**ARCHITECTURAL SIGNIFICANCE:**	☐ Most ☐ Some ☐ Minor ☒ Negligible

PHOTOGRAPHS: (1) View South

ROOM NO. 210

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 222

ROOM NO: 211 LAST KNOWN USE: Board Secretaries SQUARE FEET: 453.75 s.f CEILING HEIGHT: Original: 15'-0" DATE: 15 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [ ] Vinyl [X] Linoleum [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	10.5" on n, s, e. walls 6.5" on w. wall.
WALLS:	[X] Plaster [X] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
CEILING:	[ ] Plaster [X] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Ceiling was dropped; some missing, bowed panels.
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Entrance has glass panelled door, flanked + surmounted by glass + panelling.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[X] Good 2 [X] Fair 1 [ ] Poor [X] Destroyed 1	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	Four fixtures - 2 w/ shade + globes 1 w/ shade w/out globe 1 missing
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents Fans [ ] Fixtures [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ ○ ○ ○	[ ] **Good** [X] **Fair** [ ] **Poor**	[X] **1900-1906** [ ] **1907-1923** [X] **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor

PHOTOGRAPHS: (1) View southwest (2) View north ROOM NO. 211

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 224

ROOM NO: 212 LAST KNOWN USE: Office SQUARE FEET: 156 s.f. CEILING HEIGHT: 15'-6½" DATE: 15 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [ ] Vinyl [X] Linoleum [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	10.5" h. on n, w, + s. walls. 6.5" h. on e. wall.
WALLS:	[X] Plaster [ ] Gypsum Board [X] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	E. wall - 84" h.; broken glass. Picture molding. Panel molding.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~ Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents Fans [ ] Fixtures [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	( ) ( ) ( ) ( )	[ ] **Good** [ ] **Fair** [X] **Poor** [ ] **Destroyed**	[X] **1900-1906** [ ] **1907-1923** [ ] **1924-Present** [ ] **In Question**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) View east

ROOM NO. 212

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 226

ROOM NO: 213 LAST KNOWN USE: Office SQUARE FEET: 384.25 s f CEILING HEIGHT: 15'-6½" DATE: 16 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☐ Linoleum ☒ Other: Terrazzo	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	Mosaic border on w., n., + s. walls.
BASE:	☒ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☒ Good DEBRIS ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☒ 1907-1923 ☒ 1924-Present ☐ In Question	10.5"h. on n, w, + s walls 6.5"h on e. wall.
WALLS:	☒ Plaster ☐ Gypsum Board ☒ Glazed Wood Partitions ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1906 ☒ 1907-1923 ☒ 1924-Present ☐ In Question	Broken glass
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	Column supports beam along ceiling.
DOORS/ OPENINGS:	☒ ~~Wood~~/Glass Panelled ☒ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☐ 1900-1906 ☒ 1907-1923 ☒ 1924-Present ☐ In Question	3 doors
LIGHTING:	☒ Incandescent ☐ Fluorescent ☐ Missing ☐ Other:	☒ Good 1 ☐ Fair ☐ Poor ☒ Destroyed 1	☐ Pre-1924 ☐ Post-1924 ☐ In Question	1 fixture w/ shade + globe 1 missing fixture.
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents/Fans ☐ Fixtures ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	Exposed pipes along ceiling + w. wall + s. wall. New drainpipe at sw corner.
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
SUMMARY:	◯ ◯ ◯ ◯	☐ **Good** ☒ **Fair** ☐ **Poor**	☒ **1900-1906** ☒ **1907-1923** ☐ **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☒ Some ☐ Minor

PHOTOGRAPHS: (1) View northeast (2) View southeast (3) Mosaic border + terrazzo floor ROOM NO. 213

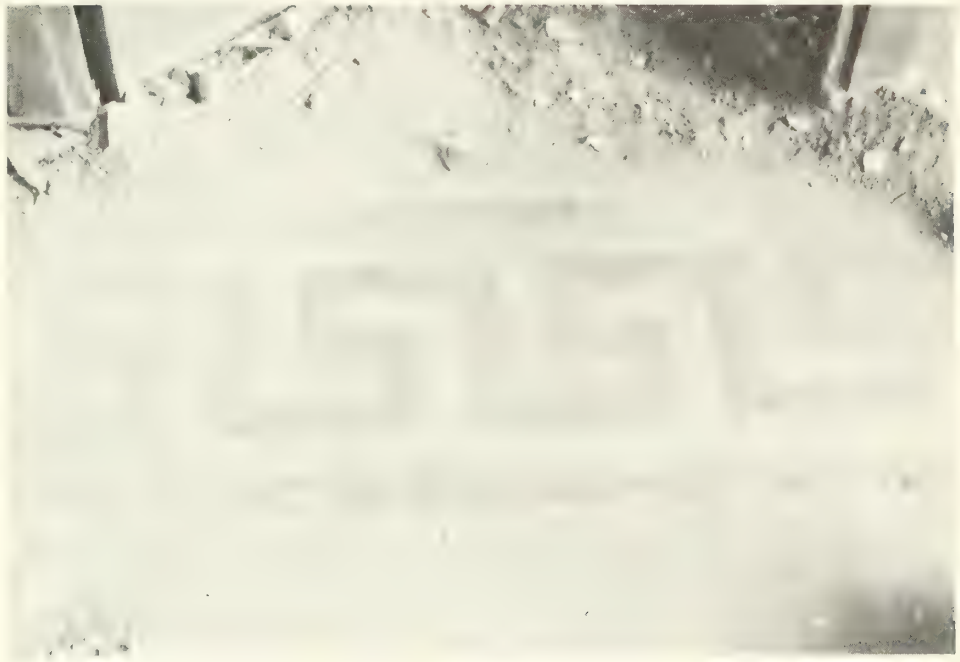

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 228

ROOM NO: 214 LAST KNOWN USE: Bathroom SQUARE FEET: 190 s.f. CEILING HEIGHT: Slopes: 15'-2" to 12'-2" DATE: 16 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed DEBRIS	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 2".
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	85" h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	open at S.E. corner - 4' x 10'. Sloping ceiling.
DOORS/ OPENINGS:	[X] Wood/~~Glass~~ Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [X] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	4 pedestal sinks; 1 slop sink; 4 urinals; 6 toilets; marble partitions; wood panel doors; 1 partition cracked. Graffiti + doodles (obscene) on partitions (1947 date)
MISCELLANEOUS:	[ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY:	○ F ○ B ○ W ○ C	[X] Good [ ] Fair [ ] Poor	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	**ARCHITECTURAL SIGNIFICANCE:**	[ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) View west

ROOM NO. 214

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 230

ROOM NO: 215 LAST KNOWN USE: Men Employees' Locker Room SQUARE FEET: 180 s.f. CEILING HEIGHT: Slopes 17'-2" to 15'-3" DATE: 16 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[ ] Good [ ] Fair DEBRIS [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 2".
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	85"h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Open section, n.e. corner, 12" x 10'. Sloping ceiling.
DOORS/ OPENINGS:	[X] Wood/~~Glass~~ Panelled [ ] Wood Veneer [ ] Galvanized Metal [X] Other: Wood Slat	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Wood slat door inside of panelled door.
LIGHTING:	[ ] Incandescent [ ] Fluorescent [X] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Fixtures [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ E ○ B ○ W ○ C	[X] **Good** [ ] **Fair** [ ] **Poor** [ ] **Destroyed**	[ ] **1900-1906** [X] **1907-1923** [ ] **1924-Present** [ ] **In Question**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) View west

ROOM NO. 215

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 232

ROOM NO: 216 LAST KNOWN USE: Sink room SQUARE FEET: 33.75 s.f. CEILING HEIGHT: DATE: 14 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☐ Linoleum ☐ Other:	☐ Good DEBRIS ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☐ Good ☐ Fair DEBRIS ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Glazed Wood Partitions ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	
CEILING:	☐ Plaster ☐ Acoustic panels ☐ Cove ☒ Other: Underside of	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☐ Wood Veneer ☒ Galvanized Metal ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	Glazed door
LIGHTING:	☐ Incandescent ☐ Fluorescent ☐ Missing ☒ Other: None	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents Fans ☒ Fixtures ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☒ In Question	Slop sink
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
SUMMARY:	○ ○ ○ ○	☐ **Good** ☐ **Fair** ☒ **Poor** ☐ **Destroyed**	☒ **1900-1906** ☐ **1907-1923** ☐ **1924-Present** ☐ **In Question**	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☐ Minor ☒ Negligible

PHOTOGRAPHS: (1) View east

ROOM NO. 216

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 234

ROOM NO: 217 LAST KNOWN USE: Rest Room SQUARE FEET: 180 s.f. CEILING HEIGHT: slopes: 17'-6½" to 16'-4" DATE: 15 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	X Tile Vinyl Linoleum Other:	X Good Fair DEBRIS Poor Destroyed	1900-1906 X 1907-1923 1924-Present In Question	Hex. 2".
BASE:	Wood Tile X Tile Wainscot Other:	Good X Fair Poor Destroyed	1900-1906 X 1907-1923 1924-Present In Question	85" h.
WALLS:	X Plaster Gypsum Board Glazed Wood Partitions Other:	X Good Fair Poor Destroyed	1900-1906 X 1907-1923 1924-Present In Question	
CEILING:	X Plaster Acoustic panels Cove Other:	Good X Fair Poor Destroyed	1900-1906 X 1907-1923 1924-Present In Question	S.E. corner - lath bent downward.
DOORS/ OPENINGS:	Wood/Glass Panelled Wood Veneer X Galvanized Metal Other:	Good Fair Poor X Destroyed	1900-1906 X 1907-1923 1924-Present In Question	Panelled
LIGHTING:	X Incandescent Fluorescent Missing Other:	Good Fair Poor X Destroyed	Pre-1924 Post-1924 In Question	
HEATING/ VENTILATION PLUMBING:	X Radiators Vents/Fans Fixtures Other:	Good X Fair Poor Destroyed	1900-1906 X 1907-1923 1924-Present In Question	
MISCELLANEOUS:		Good Fair Poor Destroyed	1900-1906 1907-1923 1924-Present In Question	
SUMMARY:	○ E ○ P ○ W ○ C	X Good Fair Poor Destroyed	X 1900-1906 X 1907-1923 1924-Present In Question	**ARCHITECTURAL SIGNIFICANCE:** Most / Some / X Minor / Negligible

PHOTOGRAPHS: (1) View east

ROOM NO. 217

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 236

ROOM NO: 218 LAST KNOWN USE: Toilet SQUARE FEET: 170 s.f. CEILING HEIGHT: slopes; 15'-2¼" to 13'-1" DATE: 15 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair DEBRIS [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 2"
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	85"
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] Wood/~~Glass~~ Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents Fans [X] Fixtures [ ] Other:	[X] Good [ ] Fair [ ] Poor [X] Destroyed 2 partitions	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	6 pedestal sinks; 1 slop sink; 6 toilets; marble partitions - 2 destroyed. 1 radiator
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ F ○ P ○ W ○ S	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) View

ROOM NO. 218

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 238

ROOM NO: 219 LAST KNOWN USE: Witness Room SQUARE FEET: 662.5 s.f. CEILING HEIGHT: 15'-0" DATE: 15 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [X] Linoleum [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 Tile [X] 1907-1923 Linoleum [ ] 1924-Present [ ] In Question	Poor linoleum in part of room; Hex. 1/4" tile in the rest of the room + under linoleum
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	58" h. w/ molding at top.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Picture molding Panel moldings Graffiti on W. wall: 1901 date, Italian names.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~ Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[X] Good 3 [ ] Fair [ ] Poor [X] Destroyed 2	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	3 fixtures with globes + shades.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents 'Fans [ ] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	radiator drinking fountain - chipped
MISCELLANEOUS:	[X] Stairs (509) See separate form. [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	( ) ( ) ( ) ( )	[ ] Good [ ] Fair [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present	**ARCHITECTURAL SIGNIFICANCE:** [X] Most Some Minor

PHOTOGRAPHS: (1) View southwest (2) View north (3) West wall with graffiti exposed (4) Graffiti: 1901 date ROOM NO. 219

PHOTOGRAPHS: (5) Graffiti (6) Graffiti ROOM NO. 219

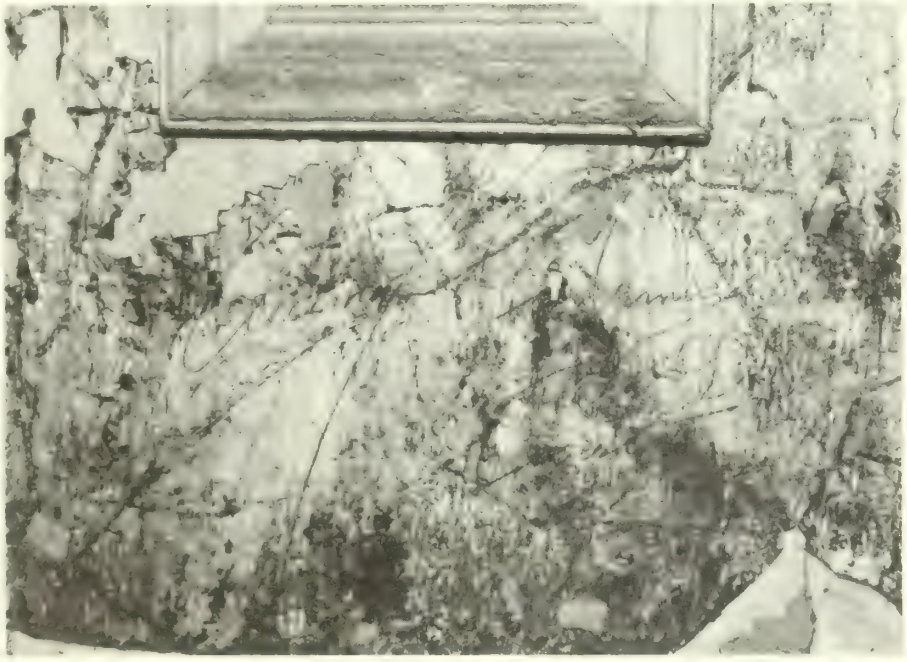

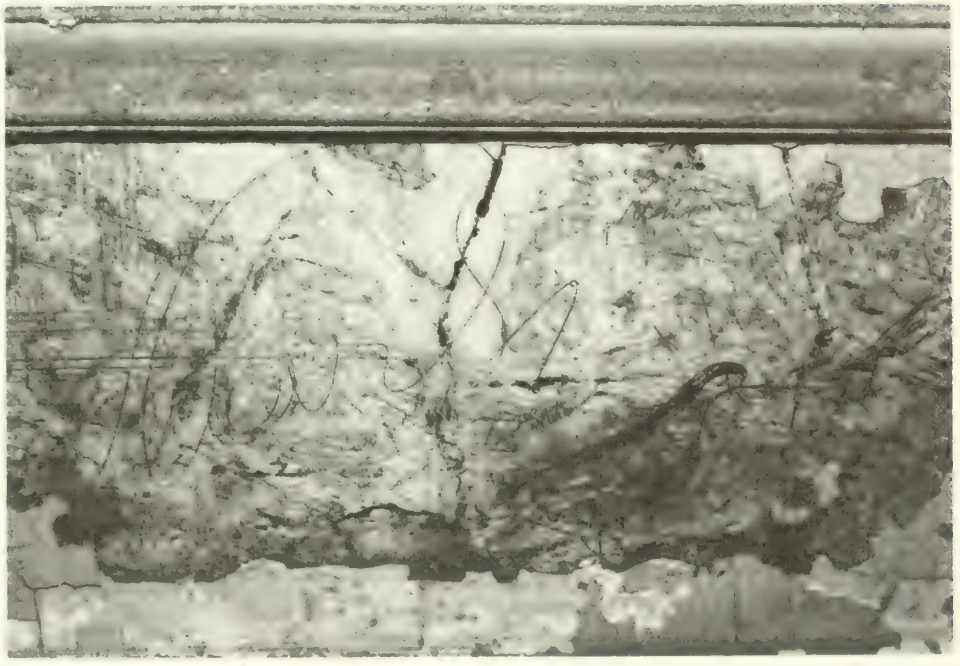

PHOTOGRAPHS:

ROOM NO.

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 242

ROOM NO: 220, 220A LAST KNOWN USE: Witness Room SQUARE FEET: 403 s.f. CEILING HEIGHT: 15'-6" DATE: 16 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☐ Linoleum ☒ Other: Terrazzo	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	Mosaic border on n. wall of 220, s. wall of 220A, + around column.
BASE:	☐ Wood ☒ Tile ☐ Tile Wainscot ☒ Other: Black composition	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	6"h.
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Glazed Wood Partitions ☒ Other: Wire mesh	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1906 ☒ 1907-1923 ☒ 1924-Present wire mesh ☐ In Question	Wall between Rm. 220 + 220A is plaster w/ wood entablature, surmounted by wire mesh. Picture molding.
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	Columns support beam along ceiling.
DOORS/ OPENINGS:	☒ ~~Wood~~/Glass Panelled ☒ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☐ Fair ☒ Poor ☒ Destroyed	☒ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	6 doors: 1 of the double doors leading to Rm. 220A is missing, other has broken glass; Door to 221 is missing.
LIGHTING:	☒ Incandescent ☐ Fluorescent ☐ Missing ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	3 fixtures w/ shades + globes.
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents Fans ☐ Fixtures ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
SUMMARY:	○ F ○ B ○ W ○ C	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS: Rm. 220: ① View north ② View South ③ Mosaic + terrazzo Floor ④ Entablature, Southwall **ROOM NO.** 220, 220A

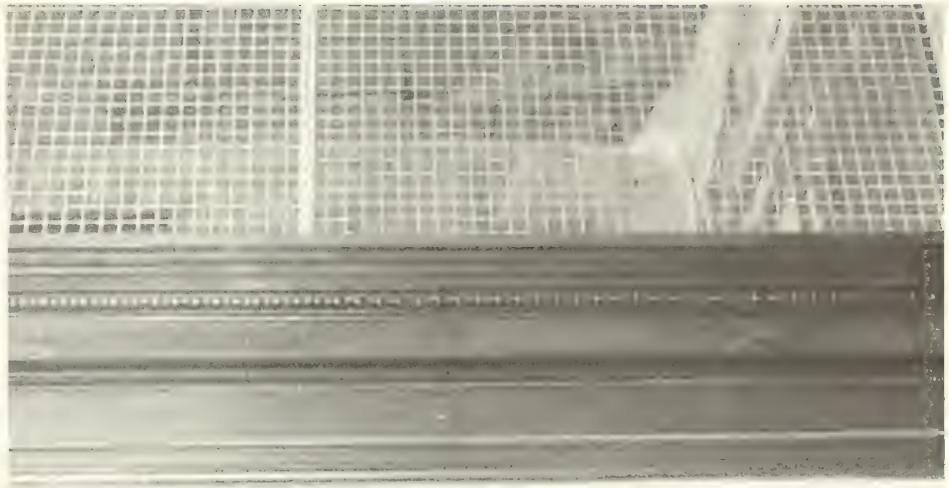

PHOTOGRAPHS: (1) View west, Rm. 220A

ROOM NO. 220, 220A

PHOTOGRAPHS:

ROOM NO.

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 246

ROOM NO: 221 LAST KNOWN USE: Board Room SQUARE FEET: 609.5 s.f. CEILING HEIGHT: 15'-6" DATE: 16 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [ ] Vinyl [ ] Linoleum [X] Other: Terrazzo	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Mosaic border on n., e. + s. walls + around column - cracks.
BASE:	[ ] Wood [X] Tile [ ] Tile Wainscot [X] Other: Black Composition	[ ] Good [ ] Fair DEBRIS [X] Poor [ ] Destroyed	[X] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	6"h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Picture molding
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Columns support beam along ceiling.
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor 1 [X] Destroyed 1	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	2 doors - 1 missing.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	9 fixtures: 8 w/ shades + globes, 1 w/ shade / no globe.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ F ○ B ○ W ○ C	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: (1) View northwest (2) South wall ROOM NO. 221

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 248

ROOM NO: 222 LAST KNOWN USE: Men's Locker Room SQUARE FEET: 684 s.f. CEILING HEIGHT: slopes 17'-2" to 13'-2" DATE: 16 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[ ] Good [ ] Fair DEBRIS [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 2".
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	85"h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	Good condition except for doorway on s. wall that was filled in + is now exposed terracotta block surmounted by wire mesh. TC block to 92"h.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Sloping ceiling skylight covered over.
DOORS/ OPENINGS:	[X] Wood/~~Glass~~ Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	3 doors
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Fixtures [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	3 radiators fan shelf at base of window to hall.
MISCELLANEOUS:	[ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	◯ ◯ ◯ ◯	[ ] **Good** [X] **Fair** [ ] **Poor** [ ] **Destroyed**	[ ] **1900-1906** [X] **1907-1923** [ ] **1924-Present** [ ] **In Question**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) View west (2) View ROOM NO. 222

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 250

ROOM NO: 223 LAST KNOWN USE: Men's + Women's Locker Rooms SQUARE FEET: 1677 s.f. CEILING HEIGHT: 18'-8½" DATE: 15 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	X Tile Vinyl Linoleum Other:	X Good Fair Poor Destroyed	X 1900-1906 1907-1923 1924-Present In Question	Hex. 2" Some discoloration, a few chips, noticeable patches.
BASE:	Wood Tile X Tile Wainscot Other:	X Good Fair Poor Destroyed	X 1900-1906 1907-1923 1924-Present In Question	85"h.
WALLS:	X Plaster Gypsum Board Glazed Wood Partitions Other:	Good Fair X Poor Destroyed	X 1900-1906 1907-1923 X 1924-Present In Question	Monumental doorways on n. + s. walls filled in with plaster surmounted by wire mesh. (1924-present). Plaster to 92"h.
CEILING:	X Plaster Acoustic panels Cove Other:	Good Fair X Poor Destroyed	X 1900-1906 1907-1923 1924-Present In Question	Columns support beams along ceiling.
DOORS/ OPENINGS:	X ~~Wood~~/Glass Panelled Wood Veneer X Galvanized Metal Other:	Good X Fair Poor Destroyed	X 1900-1906 1907-1923 1924-Present In Question	2 pairs Galv. Metal Double doors 2 glass panelled doors. Segmental arched window on e. wall (originally this was w. wall of Registry Rm.)
LIGHTING:	X Incandescent Fluorescent Missing Other:	X Good 4 Fair Poor X Destroyed 6	Pre-1924 Post-1924 In Question	4 intact suspended globes 6 destroyed.
HEATING/ VENTILATION PLUMBING:	X Radiators X Vents, Fans Fixtures Other:	Good X Fair Poor Destroyed	X 1900-1906 1907-1923 1924-Present In Question	5 radiators 2 vents, 38"x27" 2 holes in ceiling for airshafts(?)
MISCELLANEOUS:		Good Fair Poor Destroyed	1900-1906 1907-1923 1924-Present In Question	

SUMMARY:					**ARCHITECTURAL SIGNIFICANCE:**
	F	B	W	C	
	○	○	○	○	
					Good
					X **Fair**
					Poor
					Destroyed
					X **1900-1906**
					1907-1923
					1924-Present
					In Question
					Most
					X Some
					Minor
					Negligible

PHOTOGRAPHS: (1) View northwest (2) View southeast ROOM NO. 223

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING

ROOM NO: 224 LAST KNOWN USE: Women's Locker Room SQUARE FEET: 684 s.f. CEILING HEIGHT: slopes: 17'-4½" to 13'-1" DATE: 15 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	X Tile Vinyl Linoleum Other:	Good Fair DEBRIS Poor Destroyed	1900-1906 1907-1923 1924-Present In Question	Hex. 1¼"
BASE:	Wood Tile X Tile Wainscot Other:	X Good Fair Poor Destroyed	1900-1906 X 1907-1923 1924-Present In Question	85"h.
WALLS:	X Plaster Gypsum Board Glazed Wood Partitions X Other: Wire mesh	Good X Fair Poor Destroyed	1900-1906 X 1907-1923 X 1924-Present In Question	Door opening on n. wall filled in 1924-present with plaster to 92" surmounted by wire mesh.
CEILING:	X Plaster Acoustic panels Cove Other:	Good Fair X Poor Destroyed	1900-1906 X 1907-1923 1924-Present In Question	Skylight, ceiling hanging down around perimeter. Skylight covered over.
DOORS/ OPENINGS:	X Wood/~~Glass~~ Panelled Wood Veneer Galvanized Metal Other:	Good X Fair 2 Poor X Destroyed 1	1900-1906 X 1907-1923 1924-Present In Question	2 doors extant; 1 missing
LIGHTING:	X Incandescent Fluorescent Missing Other:	X Good 3 Fair Poor X Destroyed 3	Pre-1924 Post-1924 In Question	3 suspended globes 3 missing.
HEATING/ VENTILATION PLUMBING:	X Radiators Vents Fans Fixtures Other:	Good X Fair Poor Destroyed	1900-1906 X 1907-1923 1924-Present In Question	3 radiators
MISCELLANEOUS:		Good Fair Poor Destroyed	1900-1906 1907-1923 1924-Present In Question	
SUMMARY:	○ ○ ○ ○	X **Good** **Fair** **Poor** **Destroyed**	X **1900-1906** **1907-1923** **1924-Present** **In Question**	**ARCHITECTURAL SIGNIFICANCE:** Most / Some / X Minor / Negligible

PHOTOGRAPHS: (1) View southeast (2) View northwest (3) Skylight, covered over **ROOM NO.** 224

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 254

ROOM NO: 225 LAST KNOWN USE: Board Room SQUARE FEET: 251.5 s.f. CEILING HEIGHT: Gyp. Bd. - 8'-6" DATE: 15 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Linoleum ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
BASE:	☒ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1906 ☒ 1907-1923 ☒ 1924-Present ☐ In Question	10.5"h on n, w, + s walls 4.5"h. on e. wall.
WALLS:	☒ Plaster ☒ Gypsum Board ☐ Glazed Wood Partitions ☐ Other:	☐ Good ☒ Fair Gyp. Bd. ☒ Poor Plaster ☐ Destroyed	☒ 1900-1906 ☒ 1907-1923 ☒ 1924-Present ☐ In Question	2 ft. section removed by window. Panel mouldings on Plaster walls (n, w, + s).
CEILING:	☒ Plaster Orig. ☒ Acoustic panels Dropped ☐ Cove ☐ Other:	☐ Good ☒ Fair Acoustic ☒ Poor Plaster ☐ Destroyed	☒ 1900-1906 Plaster ☐ 1907-1923 ☒ 1924-Present Acoustic ☐ In Question	Ceiling dropped.
DOORS/ OPENINGS:	☒ ~~Wood~~/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☒ Fair 1 ☐ Poor ☒ Destroyed 1	☐ 1900-1906 ☒ 1907-1923 ☒ 1924-Present ☐ In Question	2 doors
LIGHTING:	☒ Incandescent ☐ Fluorescent ☐ Missing ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	3 fixtures w/ shades + globes.
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents/Fans ☐ Fixtures ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
SUMMARY:	○ ○ ○ ○	☐ **Good** ☐ **Fair** ☒ **Poor**	☒ **1900-1906** ☒ **1907-1923** ☒ **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor

PHOTOGRAPHS: (1) View southwest (2) View north ROOM NO. 225

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 256

ROOM NO: 225A LAST KNOWN USE: Passage SQUARE FEET: 205 s.f. CEILING HEIGHT: 14'-9" DATE: 15 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Linoleum ☐ Other:	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
BASE:	☒ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☒ 1924-Present ☐ In Question	4.5"h.
WALLS:	☐ Plaster ☒ Gypsum Board ☐ Glazed Wood Partitions ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☒ 1924-Present ☐ In Question	
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other:	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
DOORS/ OPENINGS:	☒ ~~Wood~~/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☒ Fair ☐ Poor ☒ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☒ 1924-Present ☐ In Question	Double doors to hall + Rm. 225 missing.
LIGHTING:	☒ Incandescent ☐ Fluorescent ☐ Missing ☐ Other:	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents Fans ☐ Fixtures ☒ Other: None	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
SUMMARY:	○ E ○ P ○ W ○ C	☐ **Good** ☐ **Fair** ☒ **Poor**	☐ **1900-1906** ☐ **1907-1923** ☒ **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☐ Minor ☒ Negligible

PHOTOGRAPHS: (1) South wall

ROOM NO. 225A

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 258

ROOM NO: 226 LAST KNOWN USE: Board Room SQUARE FEET: 317.75 s.f. CEILING HEIGHT: Gyp. Board: 8'-6" DATE: 15 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [ ] Vinyl [X] Linoleum [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	10.5"h. on n, e, + s. walls. 4.5"h. on w. wall.
WALLS:	[X] Plaster [X] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair Gyp. Bd. [X] Poor Plaster [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Gypsum wall - 2' section missing near window.
CEILING:	[X] Plaster Original [X] Acoustic panels Dropped [ ] Cove [ ] Other:	[ ] Good [X] Fair Acoustic [ ] Poor [X] Destroyed Plaster	[X] 1900-1906 Plaster [ ] 1907-1923 [X] 1924-Present Acoustic [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	3 ceiling mounted fixtures w/ shades + globes.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents Fans [ ] Fixtures [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ F ○ E ○ W ○ C	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) View southeast (2) View northwest ROOM NO. 226

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 260

ROOM NO: 227 LAST KNOWN USE: Stenographer's office SQUARE FEET: 477 s.f. CEILING HEIGHT: 14'-9" DATE: 15 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Linoleum ☐ Other:	☐ Good ☒ Fair DEBRIS ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☒ Other: Black composition	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	4"h.
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Glazed Wood Partitions ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	Picture molding Panel moldings.
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
DOORS/ OPENINGS:	☒ ~~Wood~~ Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	Broken glass in double doors
LIGHTING:	☒ Incandescent ☐ Fluorescent ☐ Missing ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	8 suspended fixtures: 7 w/ shades + globes 1 w/ shade / no globe
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents / Fans ☐ Fixtures ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
SUMMARY:	○ ○ ○ ○	☐ **Good** ☒ **Fair** ☐ **Poor** ☐ **Destroyed**	☒ **1900-1906** ☐ **1907-1923** ☐ **1924-Present** ☐ **In Question**	**ARCHITECTURAL SIGNIFICANCE:** ☐ **Most** ☒ **Some** ☐ **Minor** ☐ **Negligible**

PHOTOGRAPHS: (1) View southeast (2) View north ROOM NO. 227

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 262

ROOM NO: 228 LAST KNOWN USE: Bathroom SQUARE FEET: 146.25 s.f. CEILING HEIGHT: 15'-4½" DATE: 16 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[ ] Good [ ] Fair DEBRIS [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 1 1/4"
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	82" h. w/ molding.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[X] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents Fans [X] Fixtures [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	radiator 3 toilets; marble partitions, wood slat doors; 2 sinks; 1 large mirror; paper towel dispenser; 1 slop sink.
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	◯ ◯ ◯ ◯	[ ] **Good** [ ] **Fair** [X] **Poor** [ ] **Destroyed**	[X] **1900-1906** [ ] **1907-1923** [ ] **1924-Present** [ ] **In Question**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) View north

ROOM NO. 228

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 264

ROOM NO: 229 LAST KNOWN USE: Bathroom SQUARE FEET: 146.25 s.f. CEILING HEIGHT: 14'-11½" DATE: 15 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good DEBRIS [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 1'1/4"
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	7'h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~ Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	2 suspended globes.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents Fans [ ] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	radiator 2 pedestal sinks 1 slop sink 1 toilet; 2 more under debris; marble partitions; wood panel doors; 2 urinels 1 toilet paper holder.
MISCELLANEOUS:	[ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ E ○ P ○ W ○ C	[X] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) View South

ROOM NO. 229

ROOM NO: 231 LAST KNOWN USE: Detention Room SQUARE FEET: 13,344 s.f. CEILING HEIGHT: 18'-1" (under balconies) 58'-2" (top of vault) DATE: 23 Sept. 1983

DESCRIPTION: REGISTRY ROOM

General: Large central space on the second story. Two stories high with a barrel vault. Columns support a balcony on all sides. 3 large arched windows on the north wall, second & third floors as well as on the south wall of the third floor. The east & west walls each have a large arched window.

Floor: Red tile, 6" sq's. + 6" x 9". Laid in an oblique pattern with rectilinear borders. Tiled 1918.

Base:
1. Red tile, 6" h. on north wall (1918). Tile wainscott, 83" h. on east, west, and south walls (1924) painted over.
2. Balcony wainscot is 4' h.

Walls:
1. Plaster over terracotta blocks on the north wall. East, west, and south walls have a narrow band of plaster above a tile wainscot surmounted by 4-light & 2-light windows.
2. Balcony: Plaster over terracotta with an entablature at the spring of the vault on north & south walls. Gypsum board partitions on east & west walls (1937).
3. End Walls: Plaster over brick.

CONDITION:

General: The space was originally larger. East, west, and south walls were added in 1924. The south wall blocks the arched windows that originally opened into the room.

Floor: Good condition.

Base: Good condition. Paint peeling. Balcony wainscot: fair condition.

Walls:
1. Most of the plaster has been destroyed. Patches of basecoat are exposed in other areas. Glass walls are in good condition.
2. Balcony: Plaster is in poor condition. Some of the earlier Caen Stone (1918) is exposed where the later plaster is destroyed. Some sections of wall & entablature have been removed for structural investigations. Gypsum board partitions are in poor condition with numerous holes & cracks.
3. End walls have large areas of exposed brick.

(Continued)

SUMMARY: ○ ○ ○ ○

	Good
X	Fair
	Poor

X	1900-1906
X	1907-1923
X	1924-Present

ARCHITECTURAL SIGNIFICANCE:

X	Most
	Some
	Minor

PHOTOGRAPHS: 1. View east 2. View northwest 3. Balcony, view northwest 4. Balcony, view southwest **ROOM NO.** Registry Room 231

ROOM NO. 231 Registry Room LAST KNOWN USE: Detention Room SQUARE FEET: 13,344 s.f. CEILING HEIGHT: DATE: 23 Sept. 1983

Continued

	DESCRIPTION:	CONDITION:
Ceiling:	1. Second floor under balcony rooms: Plaster over terracotta block.	1. Large areas of exposed terracotta block.
	2. Guastavino vault (1918).	2. Vault is in good condition.
Doors/ Openings:	1. Galvanized metal panelled doors. (1924)	1. 7 doors in fair condition, 1 missing.
	2. Balcony: Galvanized metal doors, glazed on upper half. (1908)	2. Fair condition.
	3. Balcony: Pivotal windows to balcony dormitory rooms. (1908)	3. Surrounds rusted; several panes of glass broken.
Lighting:	1. 3 chandeliers suspended from the vault.	1. Good condition; recently restored.
	2. Suspended fixtures under balconies.	2. Good condition; globes intact.
	3. Lights along edge of balcony.	3. Outlets intact; no bulbs or fixtures.
Heating:	11 radiators.	Most radiators are in good condition. Some rust.
Misc:	1. Columns: Tile wainscot 83" h.	1. The tile wainscots of some of the columns have been covered with wall-paper and painted; the wallpaper is now peeling. One steel column has been totally exposed and another on the east wall has exposed steel & brick.
	2. Low wood frame partitions with glass are located along the north row of columns.	2. Missing pane of glass; one section is missing; top of a wood frame.
	3. Wood partition (3' h) enclosure at west end	3. Good condition.

(Continued)

SUMMARY:

○ ○ ○ ○

- [ ] Good
- [X] Fair
- [ ] Poor

- [X] 1900-1906
- [X] 1907-1923
- [X] 1924-Present

ARCHITECTURAL SIGNIFICANCE:

- [X] Most
- [ ] Some
- [ ] Minor

PHOTOGRAPHS: 5. Guastavino vault, view west 6. Red tile floor

ROOM NO. Registry Room 231

Registry Room
ROOM NO: 231 LAST KNOWN USE: Detention Room SQUARE FEET: 13,344 s.f. CEILING HEIGHT: DATE: 23 Sept. 1983
Continued

DESCRIPTION:	CONDITION:
4. Cast iron rails & wood handrails along balcony.	4. Good condition.
5. Stair (S-16)	5. Good condition - for more details see separate form for S-16.

For more detailed information and photographs of the balconies, see separate forms for H309, H312, H313 & H314.

SUMMARY:						ARCHITECTURAL SIGNIFICANCE:		
	◯◯◯◯		Good	X	1900-1906		X	Most
		X	Fair	X	1907-1923			Some
			Poor	X	1924-Present			Minor

PHOTOGRAPHS: 7. Exposed shaft, north wall 8. Ceiling under balcony **ROOM NO.** Registry Room 231

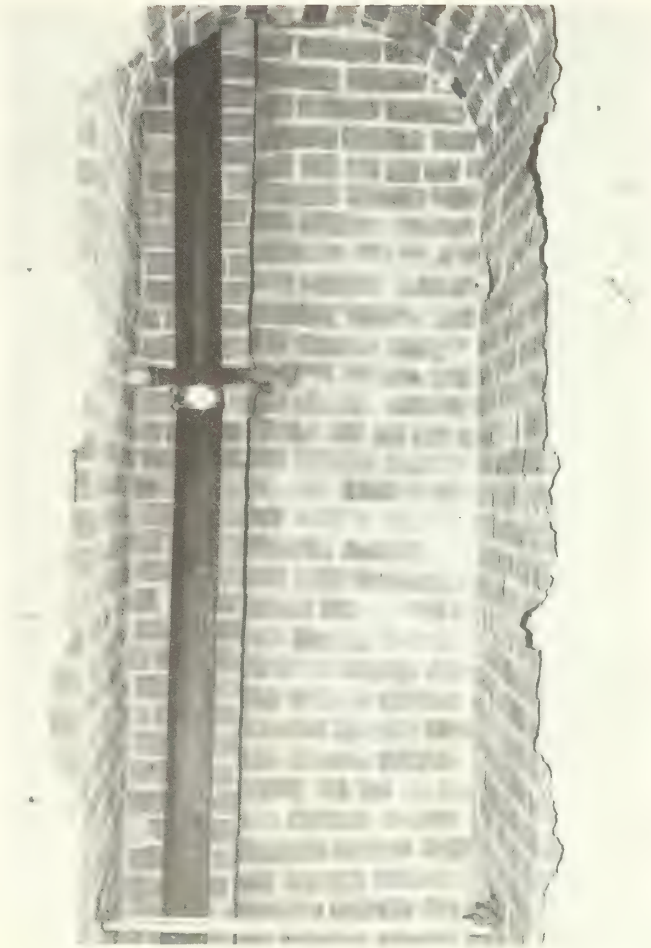

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 272

ROOM NO: 232 LAST KNOWN USE: Unknown SQUARE FEET: 156 s.f. CEILING HEIGHT: 15'-6" DATE: 16 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [ ] Vinyl [ ] Linoleum [X] Other: Wood	[ ] Good [ ] Fair DEBRIS [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[ ] Good [X] Fair DEBRIS [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	6.5"
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents Fans [ ] Fixtures [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	radiator sun. vents in n. wall
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	( ) ( ) ( ) ( )	[ ] **Good** [ ] **Fair** [X] **Poor**	[X] **1900-1906** [ ] **1907-1923** [ ] **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [ ] Minor

PHOTOGRAPHS: (1) View south

ROOM NO. 232

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 274

ROOM NO: 233 LAST KNOWN USE: Bathroom SQUARE FEET: 325 s.f CEILING HEIGHT: 18'-7" / 19'-10"; DATE: 19 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[ ] Good [ ] Fair DEBRIS [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Hex. 1'1/4"
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	83"h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [X] Other: Glass	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	W. wall - upper half is glazed. e. wall - window to light court boarded over.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Galv. Metal - panelled. 2 doors
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [X] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	4 pedestal sinks; 7 urinals; 6 toilets, marble partitions; wood panel doors. Paper towel dispenser.
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	◯ ◯ ◯ ◯	[ ] Good [X] Fair [ ] Poor	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor

PHOTOGRAPHS: ① View east

ROOM NO. 233

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 276

ROOM NO: 234 LAST KNOWN USE: Bathroom SQUARE FEET: 522.75 s.f. CEILING HEIGHT: 18'-7½"; 17'-10" DATE: 19 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Hex. 1'1/4" Floor slopes to drain.
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	83"h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [X] Other: Glass	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	W. Wall - upper half is glazed. e. wall - window to light court boarded over.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	section missing in ne. corner
DOORS/ OPENINGS:	[X] Wood ~~Glass~~ Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Galv. Metal-panelled 2 doors
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	2 hanging globes.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents Fans [X] Fixtures [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	radiator 5 pedestal sinks; 15 toilets; marble dividers; wood panel doors; slop sink; 2 paper towel dispensers; 3 mirrors.
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ F ○ P ○ W ○ C	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) View southwest (2) View northeast ROOM NO. 234

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 278

ROOM NO: 235 LAST KNOWN USE: Lavatory SQUARE FEET: 153 s.f. CEILING HEIGHT: 18'-7½" DATE: 19 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed Mattresses + Bedframes obscure floor + base	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Hex. 1 1/4"
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	83"h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [X] Other: Glass	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	west wall - upper half is glazed.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] Wood ~~Glass~~ Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Galvanized metal is panelled. 2 doors.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [X] Fixtures [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	4 pedestal sinks 3 mirrors
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ ○ ○ ○ E P W C	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) View northwest

ROOM NO. 235

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 280

ROOM NO: 236 LAST KNOWN USE: Passage SQUARE FEET: 141 s.f. CEILING HEIGHT: 18'-7½" DATE: 19 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair DEBRIS [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Hex. 1'1/4" Floor slopes to drain.
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	83"h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~ /Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Galv. Metal- panelled.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents Fans [X] Fixtures [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	1 Slop Sink 1 radiator
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ F ○ P ○ W ○ C	[X] **Good** [ ] **Fair** [ ] **Poor**	[ ] **1900-1906** [ ] **1907-1923** [X] **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [ ] Minor [X] Negligible

PHOTOGRAPHS: (1) View southeast

ROOM NO. 236

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 282

ROOM NO: 237 LAST KNOWN USE: Lavatory SQUARE FEET: 153 s.f. CEILING HEIGHT: 18'-7½" DATE: 19 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[ ] Good [ ] Fair DEBRIS [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Hex. 1'1/4"
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	83" h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [X] Other: Glass	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	West wall is glazed in upper half.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Galv. metal - panelled
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [X] Fixtures [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	radiator 4 pedestal sinks
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ E ○ B ○ W ○ C	[X] **Good** [ ] **Fair** [ ] **Poor**	[ ] **1900-1906** [ ] **1907-1923** [X] **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [ ] Minor [X] Negligible

PHOTOGRAPHS: (1) View southwest

ROOM NO. 237

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 284

ROOM NO: 238 LAST KNOWN USE: Bathroom SQUARE FEET: 533 s.f. CEILING HEIGHT: 18'-6" / 17'-8½" DATE: 19 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Hex. 1 1/4" Floor slopes to drain.
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	83"h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [X] Other: Glass	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	West wall is glazed in upper half. Window on e. wall to light court boarded over.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood 'Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Galvanized metal door - panelled
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents Fans [X] Fixtures [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	radiator 5 pedestal sinks; 14 toilets; marble partitions; 3 mirrors; wood panel doors; 1 double slop sink
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	◯ ◯ ◯ ◯	[X] **Good** [ ] **Fair** [ ] **Poor**	[ ] **1900-1906** [ ] **1907-1923** [V] **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor

PHOTOGRAPHS: (1) View southeast (2) View northwest ROOM NO. 238

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING

ROOM NO: 239 LAST KNOWN USE: Bathroom SQUARE FEET: 325 s.f. CEILING HEIGHT: 18'-7" / 17'-8½" DATE: 19 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed Benches obscure floor + base	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Hex. 1'1/4"
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	83"h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [X] Other: Glass	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	W. Wall is glazed in upper half - some glass broken. window on e. wall to light court - boarded over.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Galv. Metal - panelled.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [X] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [X] Destroyed 1 toilet	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	4 pedestal sinks; 4 urinals; double slop sink; 8 toilets; marble dividers
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	( ) ( ) ( ) ( )	[ ] Good [X] Fair [ ] Poor	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [✓] Minor

PHOTOGRAPHS: (1) View east

ROOM NO. 239

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 288

ROOM NO: 240 LAST KNOWN USE: Bathroom SQUARE FEET: 142.5 s.f. CEILING HEIGHT: 15'-4½" DATE: 19 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[ ] Good [ ] Fair DEBRIS [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 1'1/4"
BASE:	[ ] Wood [ ] Tile [ ] Tile Wainscot [X] Other: None	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~ Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [X] Vents Fans [X] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	radiator 4 sinks; 1 mirror; 4 toilets; marble partitions; wood panel doors (1 destroyed); 1 slop sink; 2 small vents on n. wall
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	( ) ( ) ( ) ( )	[ ] **Good** [ ] **Fair** [X] **Poor** [ ] **Destroyed**	[X] **1900-1906** [ ] **1907-1923** [ ] **1924-Present** [ ] **In Question**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Non-Visible

PHOTOGRAPHS: (1) View north (2) Sinks, west wall ROOM NO. 240

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 290

ROOM NO: 241 LAST KNOWN USE: office SQUARE FEET: 609.5 s.f. CEILING HEIGHT: 15'-6" DATE: 16 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Linoleum ☐ Other:	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
BASE:	☒ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	10.5"h.
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Glazed Wood Partitions ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	Picture molding
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other:	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
DOORS/ OPENINGS:	☒ ~~Wood~~/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	2 doors - 1 pr. of dbl. doors; 1 single door. Broken glass in door to Rm. 246.
LIGHTING:	☒ Incandescent ☐ Fluorescent ☐ Missing ☐ Other:	☐ Good ☒ Fair 3 ☒ Poor 2 ☒ Destroyed 2	☐ Pre-1924 ☒ Post-1924 ☐ In Question	3 fixtures w/ shades / no globes 2 fixtures w/ broken blue globes + shades 2 missing.
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☒ Vents/Fans ☐ Fixtures ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	radiator wall fan
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
SUMMARY:	◯ ◯ ◯ ◯	☐ **Good** ☐ **Fair** ☒ **Poor**	☒ **1900-1906** ☒ **1907-1923** ☐ **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☒ Some ☐ Minor

PHOTOGRAPHS: (1) View northwest (2) View southwest ROOM NO. 241

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 292

ROOM NO: 242 LAST KNOWN USE: Unknown SQUARE FEET: 333 s.f. CEILING HEIGHT: 11'-1" DATE: 19 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [ ] Vinyl [ ] Linoleum [X] Other: Terrazzo	[ ] Good [ ] Fair DEBRIS [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Mosaic border
BASE:	[ ] Wood [X] Tile ? [ ] Tile Wainscot [ ] Other:	[ ] Good [ ] Fair DEBRIS [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Transom Door to Rm. 243 is 51" wide.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	2 s-coil radiators
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	( ) ( ) ( ) ( )	[ ] **Good** [ ] **Fair** [X] **Poor** [ ] **Destroyed**	[ ] **1900-1906** [X] **1907-1923** [ ] **1924-Present** [ ] **In Question**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) View South

ROOM NO. 242

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 294

ROOM NO: 243 LAST KNOWN USE: Unknown SQUARE FEET: 75 s.f. CEILING HEIGHT: 7'-9" ± DATE: 19 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Linoleum ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☒ Other: Black comp.	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☒ 1924-Present ☐ In Question	6"h.
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Glazed Wood Partitions ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☒ 1924-Present ☐ In Question	S. wall is base coat + plaster over "Pyrobar" (US Gypsum Co.).
CEILING:	☐ Plaster ☐ Acoustic panels ☐ Cove ☒ Other: Masonite below wire mesh	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☒ 1924-Present ☐ In Question	
DOORS/ OPENINGS:	☒ Wood/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	2 doors
LIGHTING:	☒ Incandescent ☐ Fluorescent ☐ Missing ☐ Other:	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents/Fans ☐ Fixtures ☒ Other: None	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
MISCELLANEOUS:	☒ 2 steps up to Rm. 242	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	
SUMMARY:	○ F ○ B ○ W ○ C	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☒ 1924-Present ☐ In Question	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☐ Minor ☑ Negligible

PHOTOGRAPHS: (1) View north

ROOM NO. 243

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 296

ROOM NO: 244 LAST KNOWN USE: File Room SQUARE FEET: 1657 s.f. CEILING HEIGHT: 18'-9" DATE: 19 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [ ] Vinyl [X] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [X] Other: Black composition	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Part of n. wall (Rm. 243) is plaster over Pyroban.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Columns support beams.
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair 1 [X] Poor 1 [X] Destroyed 1	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Windows to light courts are boarded over.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[X] Good 15 [X] Fair 2 [ ] Poor [X] Destroyed 1	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	15 shades + globes 2 shades/no globes 1 destroyed.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Fixtures [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	3 radiators
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	◯ ◯ ◯ ◯ E S W C	[X] **Good** [ ] **Fair** [ ] **Poor** [ ] **Destroyed**	[X] **1900-1906** [ ] **1907-1923** [ ] **1924-Present** [ ] **In Question**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor

PHOTOGRAPHS: (1) View northeast (2) View northwest ROOM NO. 244

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 298

ROOM NO: 245 LAST KNOWN USE: Office SQUARE FEET: 450.5 s.f. CEILING HEIGHT: 15'-5" DATE: 17 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [ ] Vinyl [X] Linoleum [ ] Other:	[X] Good [ ] Fair DEBRIS [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	10.5"h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Picture molding
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Door to Rm. 251 boarded over. 1 double door; 3 single doors
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[X] Good 3 [X] Fair 1 [ ] Poor [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	3 fixtures with globes + shades (2 of these are blue glass) 1 shade/no globe 1 fixture + wire molding have fallen.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Fixtures [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:	[ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ ○ ○ ○ F E W C	[ ] **Good** [X] **Fair** [ ] **Poor** [ ] **Destroyed**	[X] **1900-1906** [ ] **1907-1923** [ ] **1924-Present** [ ] **In Question**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: ① View south

ROOM NO. 245

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 300

ROOM NO: 245A LAST KNOWN USE: Vault SQUARE FEET: 145.75 s.f. CEILING HEIGHT: 15'-5" DATE: 19 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [ ] Vinyl [X] Linoleum [ ] Other:	[ ] Good [X] Fair DEBRIS [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
BASE:	[ ] Wood [ ] Tile [ ] Tile Wainscot [X] Other: Black composition	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	6"h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	2 doors
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [X] Fair 1 [ ] Poor [X] Destroyed 1	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	1 fixture w/ shade / no globe 1 destroyed
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents / Fans [ ] Fixtures [X] Other: None	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:	[X] Wood beam w/ hooks	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [X] In Question	
SUMMARY:	◯ ◯ ◯ ◯	[ ] **Good** [X] **Fair** [ ] **Poor**	[X] **1900-1906** [ ] **1907-1923** [ ] **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [ ] Minor [X] Negligible

PHOTOGRAPHS: (1) View north

ROOM NO. 245A

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 302

ROOM NO: 246 LAST KNOWN USE: Office SQUARE FEET: 397.5 S.f CEILING HEIGHT: 15'-6" DATE: 16 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Linoleum ☐ Other:	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
BASE:	☒ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	10.5"h.
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Glazed Wood Partitions ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	Picture molding
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other:	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
DOORS/ OPENINGS:	☒ ~~Wood~~/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	Double door Single door
LIGHTING:	☒ Incandescent ☐ Fluorescent ☐ Missing ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents/Fans ☐ Fixtures ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	6 fixtures - 5 have shades + globes; 1 has shade/no globe. Fan shelf.
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
SUMMARY:	◯ ◯ ◯ ◯	☐ Good ☐ Fair ☒ Poor	☒ 1900-1906 ☒ 1907-1923 ☐ 1924-Present	**ARCHITECTURAL** ☐ Most ☒ Some

PHOTOGRAPHS: (1) View north (2) View southwest (3) Ceiling + wall, northeast corner ROOM NO. 246

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 304

ROOM NO: 247 LAST KNOWN USE: Office SQUARE FEET: 397.5 S.f. CEILING HEIGHT: 15'-6" DATE: 16 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [ ] Vinyl [X] Linoleum [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Picture molding Panel moldings
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [X] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Dbl. door Single door 1 missing door
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	3 fixtures - 2 shades w/ blue globes, 1 intact, 1 broken; 1 shade/no globe
HEATING/ VENTILATION PLUMBING:	[X] Radiators [X] Vents/Fans [ ] Fixtures [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	radiator small vents
MISCELLANEOUS:	[ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ ○ ○ ○	[ ] Good [ ] Fair [X] Poor	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor

PHOTOGRAPHS: (1) View north (2) view southeast ROOM NO. 247

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 306

ROOM NO: 248 LAST KNOWN USE: Office SQUARE FEET: 240 s.f. CEILING HEIGHT: 15'-6" DATE: 16 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [ ] Vinyl [X] Linoleum [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	10.5"h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Picture molding
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~ 'Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [X] Other: Steel - 248A	[X] Good 2 [X] Fair 1 [ ] Poor [X] Destroyed 1	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	4 doors - 1 destroyed
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[X] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	1 fixture w/ shade + blue globe. others destroyed.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents Fans [ ] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:	[ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	E H W L	[ ] Good [ ] Fair [X] Poor	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor

PHOTOGRAPHS: (1) View south (2) View north ROOM NO. 248

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 308

ROOM NO: 248A LAST KNOWN USE: Vault SQUARE FEET: 215 s.f. CEILING HEIGHT: 15'-6" DATE: 16 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☐ Linoleum ☒ Other: Steel	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	Rusted.
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☒ Other: None	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
WALLS:	☐ Plaster ☐ Gypsum Board ☐ Glazed Wood Partitions ☒ Other: Steel	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	Rusted.
CEILING:	☐ Plaster ☐ Acoustic panels ☐ Cove ☒ Other: Steel	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	Rusted.
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☒ Other: Steel	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	Rusted.
LIGHTING:	☐ Incandescent ☐ Fluorescent ☐ Missing ☒ Other: None	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents/Fans ☐ Fixtures ☒ Other: None	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
SUMMARY:	○ ○ ○ ○	☒ **Good** ☐ **Fair** ☐ **Poor**	☒ **1900-1906** ☐ **1907-1923** ☐ **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☒ Some ☐ Minor

PHOTOGRAPHS: (1) View south

ROOM NO. 248A

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 310

ROOM NO: 250, 250A LAST KNOWN USE: Office SQUARE FEET: 183 s.f CEILING HEIGHT: 9'-0½" DATE: 19 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [ ] Vinyl [ ] Linoleum [X] Other: Terrazzo	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Mosaic border
BASE:	[ ] Wood [X] Tile [ ] Tile Wainscot [X] Other: black composition-250A	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	6"h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Picture molding Boarded over windows on s. wall.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	3 doors
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[X] Good 1 [ ] Fair [ ] Poor [X] Destroyed 1	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	1 fixture w/ globe (ceiling mounted) 1 destroyed
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [X] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Radiator Toilet 1 Pedestal Sink
MISCELLANEOUS:	[ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ ○ ○ ○	[X] **Good** [ ] **Fair** [ ] **Poor** [ ] **Destroyed**	[X] **1900-1906** [ ] **1907-1923** [ ] **1924-Present** [ ] **In Question**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor

PHOTOGRAPHS: (1) View east (2) View west; Rm. 250A at left. ROOM NO. 250, 250A

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 312

ROOM NO: 251 LAST KNOWN USE: Office SQUARE FEET: 410.75 s.f. CEILING HEIGHT: 15'-5" DATE: 19 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [ ] Vinyl [X] Linoleum [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	10.5"h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Picture molding
CEILING:	[X] Plaster [ ] Acoustic panels [X] Cove [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Columns support beam
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Dbl. door; 2 single doors. Door to Rm. 245 is boarded up.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents Fans [ ] Fixtures [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:	[ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY: ( ) F ( ) B ( ) W ( ) C

[ ] Good [X] Fair [ ] Poor [ ] Destroyed

[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question

ARCHITECTURAL SIGNIFICANCE: [ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: (1) View south (2) Column capital + cove ceiling ROOM NO. 251

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 314

ROOM NO: 252 LAST KNOWN USE: Office SQUARE FEET: 742 s.f. CEILING HEIGHT: 14'-11" DATE: 19 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Linoleum ☐ Other:	☐ Good ☒ Fair DEBRIS ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
BASE:	☒ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	10.5"h. S. wall badly deteriorated.
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Glazed Wood Partitions ☐ Other:	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	Picture molding Section open near SW. corner for drainpipe.
CEILING:	☒ Plaster ☐ Acoustic panels ☒ Cove ☐ Other:	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
DOORS/ OPENINGS:	☒ ~~Wood~~/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
LIGHTING:	☒ Incandescent ☐ Fluorescent ☐ Missing ☐ Other:	☒ Good 2 ☒ Fair 1 ☐ Poor ☒ Destroyed 1	☐ Pre-1924 ☐ Post-1924 ☐ In Question	2 fixtures w/ globes+ shades 1 fixture w/ globe/no shade 1 destroyed.
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents Fans ☐ Fixtures ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	2 radiators
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
SUMMARY:	◯ ◯ ◯ ◯	☐ **Good** ☐ **Fair** ☒ **Poor** ☐ Destroyed	☒ **1900-1906** ☐ **1907-1923** ☐ **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☒ Some ☐ Minor ☐ Negligible

PHOTOGRAPHS: (1) View southwest (2) View northwest (3) Ceiling, southwest corner ROOM NO. 252

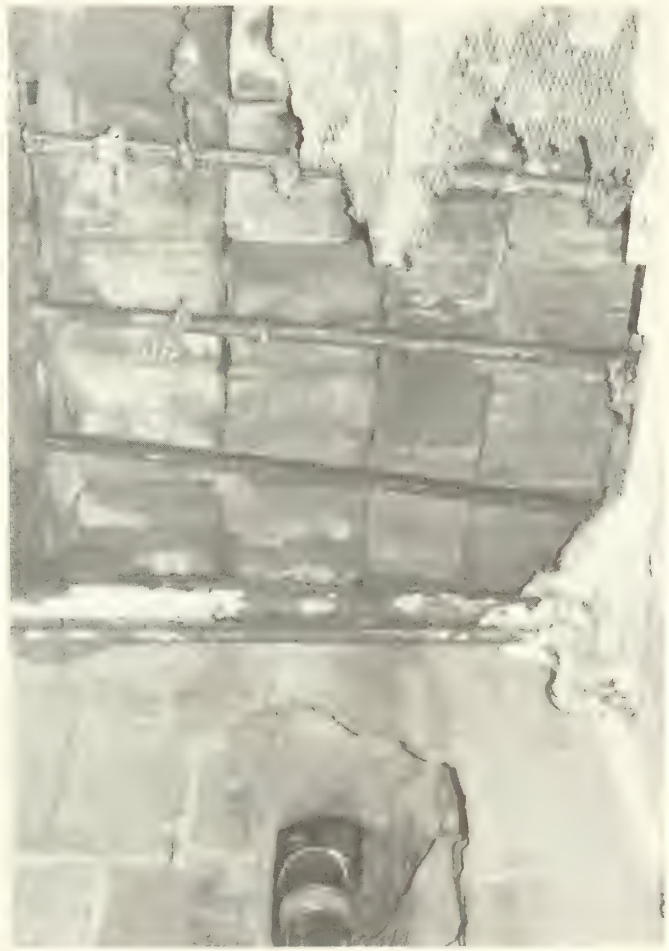

PHOTOGRAPHS: (4) Cove ceiling ROOM NO. 252

PHOTOGRAPHS:

ROOM NO.

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 318

ROOM NO: 254 LAST KNOWN USE: Office SQUARE FEET: 702.25 s.f. CEILING HEIGHT: 15'-6" DATE: 16 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [ ] Vinyl [X] Linoleum [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	10.5" h. No base on partitions.
WALLS:	[X] Plaster [ ] Gypsum Board [X] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor Plaster [X] Destroyed Wood	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Portions of partitions + windows missing.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	2 doors
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	5 fixtures - 4 w/ shades / globes suspended 1 w/ shade / no globe
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	2 radiators
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	( ) ( ) ( ) ( )	[ ] **Good** [ ] **Fair**	[X] **1900-1906** [ ] **1907-1923**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor

PHOTOGRAPHS: (1) View northeast (2) View southwest ROOM NO. 254

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 320

ROOM NO: 257 LAST KNOWN USE: File Room SQUARE FEET: 1113 s.f CEILING HEIGHT: 15'-1" DATE: 16 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Linoleum ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
BASE:	☒ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	12.5" h. Major areas along e. wall deteriorated.
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Glazed Wood Partitions ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
DOORS/ OPENINGS:	☒ ~~Wood~~/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	Dbl. doors; single door
LIGHTING:	☒ Incandescent ☐ Fluorescent ☐ Missing ☐ Other:	☒ Good 6 ☒ Fair 8 ☐ Poor ☒ Destroyed 2	☐ Pre-1924 ☐ Post-1924 ☐ In Question	suspended fixtures - 8 w/ shades/no globes; 6 w/ shades + globes; 2 destroyed
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☒ Vents Fans ☐ Fixtures ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	2 radiators 2 fans on fan shelves - e. wall.
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
SUMMARY:	○ E ○ B ○ W ○ C	☐ Good ☐ Fair ☒ Poor	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☒ Some ☐ Minor ☐ Negligible

PHOTOGRAPHS: (1) View northeast (2) View southwest ROOM NO. 257

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 322

ROOM NO: 258 LAST KNOWN USE: Office SQUARE FEET: 371 s.f. CEILING HEIGHT: 15'-6" DATE: 16 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Linoleum ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
BASE:	☒ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	12.5" h.
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Glazed Wood Partitions ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	Picture molding
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
DOORS/ OPENINGS:	☒ ~~Wood~~/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☒ Fair 1 ☐ Poor ☒ Destroyed 1	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	Dbl. doors Single door missing
LIGHTING:	☒ Incandescent ☐ Fluorescent ☐ Missing ☐ Other:	☒ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	3 fixtures w/ shades + globes 1 " w/ shade / no globe 2 globes w/ shades.
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents / Fans ☐ Fixtures ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
SUMMARY:	○ E ○ P ○ W ○ C	☐ **Good** ☒ **Fair** ☐ **Poor**	☒ **1900-1906** ☐ **1907-1923** ☐ **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☒ Some ☐ Minor ☐ Negligible

PHOTOGRAPHS: (1) View southeast

ROOM NO. 258

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING

ROOM NO: 259, H212 LAST KNOWN USE: Office SQUARE FEET: 303.5 s.f. CEILING HEIGHT: 15'-6" DATE: 16 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Linoleum ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
BASE:	☒ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	10.5" h. Deteriorated on e. wall
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Glazed Wood Partitions ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	Picture molding
CEILING:	☒ Plaster ☐ Acoustic panels ☒ Cove ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
DOORS/ OPENINGS:	☒ ~~Wood~~/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☒ Other: Steel	☐ Good ☒ Fair ☐ Poor ☒ Destroyed 2	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	1 pr. Dbl. doors Steel door - Rm. 260A Door to Rm. 258 destroyed. " " Rm. 260 "
LIGHTING:	☒ Incandescent ☐ Fluorescent ☐ Missing ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	3 suspended fixtures
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents/Fans ☐ Fixtures ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	

SUMMARY:	○ E ○ B ○ W ○ C	☒ Good ☐ Fair ☐ Poor	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	**ARCHITECTURAL SIGNIFICANCE:**	☐ Most ☒ Some ☐ Minor ☐ Negligible

PHOTOGRAPHS: (1) View southwest

ROOM NO. 259, H212

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 326

ROOM NO: 259A LAST KNOWN USE: Closet SQUARE FEET: 27.5 s.f. CEILING HEIGHT: 15'-6" DATE: 16 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☐ Linoleum ☒ Other: Black Composition	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☒ Other: Black Composition	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Glazed Wood Partitions ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
DOORS/ OPENINGS:	☒ ~~Wood~~/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
LIGHTING:	☒ Incandescent ☐ Fluorescent ☐ Missing ☐ Other:	☐ Good ☒ Fair ☐ Poor ☒ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents/Fans ☐ Fixtures ☒ Other: None	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
MISCELLANEOUS:	☒ Shelves; hooks	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	Some missing
SUMMARY:	○ F ○ B ○ W ○ C	☒ **Good** ☐ **Fair** ☐ **Poor** ☐ **Destroyed**	☒ **1900-1906** ☐ **1907-1923** ☐ **1924-Present** ☐ **In Question**	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☐ Minor ☒ Negligible

PHOTOGRAPHS: (1) View north

ROOM NO. 259A

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING

ROOM NO: 260 LAST KNOWN USE: Office SQUARE FEET: 410.75 s.f. CEILING HEIGHT: 15'-6" DATE: 16 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Linoleum ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
BASE:	☒ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	10.5"h.
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Glazed Wood Partitions ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	Picture molding
CEILING:	☒ Plaster ☐ Acoustic panels ☒ Cove ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
DOORS/ OPENINGS:	☒ ~~Wood~~/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☒ Good ☐ Fair ☐ Poor ☒ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	1 Dbl. door; 1 single door Door to Rm. 259 missing
LIGHTING:	☒ Incandescent ☐ Fluorescent ☐ Missing ☐ Other:	☒ Good 2 ☒ Fair 2 ☐ Poor ☐ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	2 suspended fixtures w/ shades + globes " " " " " /no globes.
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents/Fans ☐ Fixtures ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
SUMMARY:	○ F ○ B ○ W ○ C	☐ **Good** ☐ **Fair** ☒ **Poor** ☐ **Destroyed**	☒ **1900-1906** ☐ **1907-1923** ☐ **1924-Present** ☐ **In Question**	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☒ Some ☐ Minor ☐ Negligible

PHOTOGRAPHS: (1) View east

ROOM NO. 260

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 330

ROOM NO: 260A LAST KNOWN USE: Vault SQUARE FEET: 52 s.f CEILING HEIGHT: 14'-6" DATE: 16 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☐ Linoleum ☒ Other: Steel	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	Rusted.
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☒ Other: None	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
WALLS:	☐ Plaster ☐ Gypsum Board ☐ Glazed Wood Partitions ☒ Other: Steel	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	Rusted.
CEILING:	☐ Plaster ☐ Acoustic panels ☐ Cove ☒ Other: Steel	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	Rusted.
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☒ Other: Steel	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	Rusted. Lock missing.
LIGHTING:	☐ Incandescent ☐ Fluorescent ☒ Missing ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents/Fans ☐ Fixtures ☒ Other: None	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
SUMMARY:	○ F ○ B ○ W ○ C	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS: (1) View west

ROOM NO. 260A

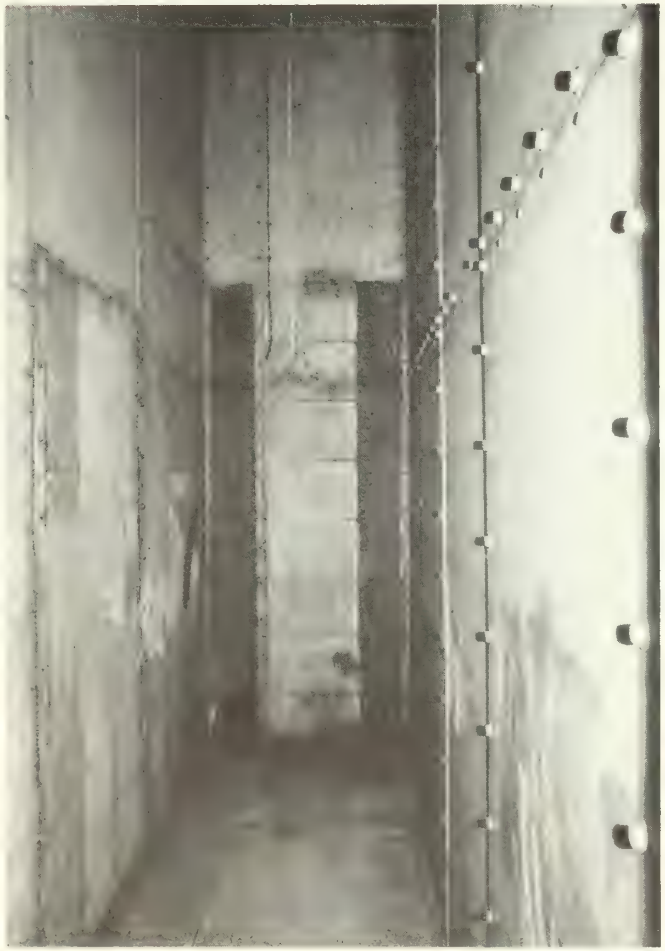

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 332

ROOM NO: 261 LAST KNOWN USE: Office SQUARE FEET: 318 s.f. CEILING HEIGHT: 15'-6" DATE: 16 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Linoleum ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
BASE:	☒ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	10.5"h.
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Glazed Wood Partitions ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	Picture moulding. Panel mouldings.
CEILING:	☒ Plaster ☐ Acoustic panels ☒ Cove ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
DOORS/ OPENINGS:	☒ ~~Wood~~/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☒ Good ☐ Fair ☐ Poor ☒ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	Dbl. door + sing. door - good Door to Rm. 261A - destroyed
LIGHTING:	☒ Incandescent ☐ Fluorescent ☐ Missing ☐ Other:	☒ Good ☐ Fair ☐ Poor ☒ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	Suspended Fixtures.
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents/Fans ☐ Fixtures ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	radiator Fanshelf at SE. corner.
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
SUMMARY:	○ E ○ P ○ W ○ C	☐ **Good** ☒ **Fair** ☐ **Poor**	☒ **1900-1906** ☐ **1907-1923** ☐ **1924-Present** ☐ **In Question**	**ARCHITECTURAL SIGNIFICANCE:** ☐ **Most** ☒ **Some** ☐ **Minor**

PHOTOGRAPHS: (1) View east

ROOM NO. 261

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 334

ROOM NO: 261A LAST KNOWN USE: Vault SQUARE FEET: 71.5 s.f. CEILING HEIGHT: 14'-5" DATE: 16 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☐ Linoleum ☒ Other: Steel	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	Rusted.
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☒ Other: None	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
WALLS:	☐ Plaster ☐ Gypsum Board ☐ Glazed Wood Partitions ☒ Other: Steel	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	Rusted.
CEILING:	☐ Plaster ☐ Acoustic panels ☐ Cove ☒ Other: Steel	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	Rusted.
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☒ Other: Missing	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
LIGHTING:	☒ Incandescent ☐ Fluorescent ☐ Missing ☐ Other:	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents/Fans ☐ Fixtures ☒ Other: None	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
SUMMARY:	○ ○ ○ ○ F P W C	☐ **Good** ☒ **Fair** ☐ **Poor**	☒ **1900-1906** ☐ **1907-1923** ☐ **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** ☐ **Most** ☐ **Some** ☒ **Minor**

PHOTOGRAPHS: (1) View west

ROOM NO. 261 A

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 336

ROOM NO: 262 LAST KNOWN USE: Commissioner's Office SQUARE FEET: 494 s.f CEILING HEIGHT: 15'-6" DATE: 16 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [ ] Vinyl [X] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	10.5"h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Picture molding. Panel moldings. Lg. section, 4' wide at its widest pt, recently opened to reveal beams.
CEILING:	[X] Plaster [ ] Acoustic panels [X] Cove [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Beams across ceiling.
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	3 doors
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	2 radiators
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ F ○ B ○ W ○ C	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: (1) Exposed column (2) View southeast ROOM NO. 262

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 338

ROOM NO: 262A LAST KNOWN USE: Toilet SQUARE FEET: 42 s.f. CEILING HEIGHT: 15'-6" DATE:

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	6" sq.
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	6" sq. to 74"h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~ Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
LIGHTING:	[ ] Incandescent [ ] Fluorescent [X] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents Fans [ ] Fixtures [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Radiator pedestal sink Toilet 1 Toilet Paper holder Towel rack - bent
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	◯ F ◯ B ◯ W ◯ C	[ ] **Good** [X] **Fair** [ ] **Poor** [ ] **Destroyed**	[X] **1900-1906** [ ] **1907-1923** [ ] **1924-Present** [ ] **In Question**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) View north

ROOM NO. 262A

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 340

ROOM NO: H201 LAST KNOWN USE: Passage SQUARE FEET: 196 s.f. CEILING HEIGHT: 15'-6½" DATE: 15 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Hex. 1'1/4" Lg. cracks
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	5'h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	2 prs. of double doors.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents Fans [ ] Fixtures [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY:	◯ F ◯ B ◯ W ◯ C	[X] Good / Fair / Poor / Destroyed	[X] 1900-1906 / 1907-1923 / 1924-Present / In Question	**ARCHITECTURAL SIGNIFICANCE:**	[X] Most / Some / Minor / Negligible

PHOTOGRAPHS: (1) View east

ROOM NO. H201

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 342

ROOM NO: H202 LAST KNOWN USE: Passage SQUARE FEET: 582 s.f. CEILING HEIGHT: 9'-7" DATE: 15 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 1'1/4"
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	5'h. Lg. section missing under one window
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Skylights covered over.
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [X] Other: Wire Mesh	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[X] Good 2 [ ] Fair [ ] Poor [X] Destroyed 2	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	2 fixtures w/ globes 2 " destroyed
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents Fans [ ] Fixtures [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	2 radiators
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY: ○ F ○ B ○ W ○ C

[ ] Good [X] 1900-1906
[ ] Fair [ ] 1907-1923
[X] Poor [ ] 1924-Present
[ ] Destroyed [ ] In Question

ARCHITECTURAL SIGNIFICANCE: [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) Southern half of hall, view north (2) Northern half of hall, view north ROOM NO. H202

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 344

ROOM NO: H203 LAST KNOWN USE: Passage SQUARE FEET: 156 s.f. CEILING HEIGHT: 14'-9" DATE: 15 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 1'1/4". Floor slopes to drain.
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	85"h. Major area missing under window on n. wall.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [X] Other: Wire mesh	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Graffiti carved into lintel.
LIGHTING:	[ ] Incandescent [ ] Fluorescent [X] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents Fans [ ] Fixtures [X] Other: None	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ F ○ B ○ W ○ C	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: ① View east

ROOM NO. H203

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 346

ROOM NO: H204 LAST KNOWN USE: Passage SQUARE FEET: 450 s.f. CEILING HEIGHT: 9'-7" DATE: 16 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	X Tile Vinyl Linoleum Other:	X Good Fair Poor Destroyed	X 1900-1906 1907-1923 1924-Present In Question	Hex. 1"1/4".
BASE:	Wood Tile X Tile Wainscot Other:	X Good Fair Poor Destroyed	X 1900-1906 1907-1923 1924-Present In Question	5'h.
WALLS:	X Plaster Gypsum Board Glazed Wood Partitions Other:	Good Fair Poor X Destroyed	X 1900-1906 1907-1923 1924-Present In Question	
CEILING:	X Plaster Acoustic panels Cove Other:	Good Fair Poor X Destroyed	X 1900-1906 1907-1923 1924-Present In Question	skylights covered over.
DOORS/ OPENINGS:	X Wood/Glass Panelled Wood Veneer X Galvanized Metal X Other: Wire mesh	Good X Fair Poor X Destroyed	X 1900-1906 1907-1923 X 1924-Present In Question	Wire mesh door w/ lock at entrance to hall.
LIGHTING:	X Incandescent Fluorescent Missing Other:	Good Fair Poor X Destroyed	Pre-1924 Post-1924 In Question	
HEATING/ VENTILATION PLUMBING:	Radiators Vents Fans Fixtures X Other: None	Good Fair Poor Destroyed	1900-1906 1907-1923 1924-Present In Question	
MISCELLANEOUS:		Good Fair Poor Destroyed	1900-1906 1907-1923 1924-Present In Question	
SUMMARY:	○ F ○ B ○ W ○ C	Good Fair X Poor Destroyed	X 1900-1906 1907-1923 1924-Present In Question	**ARCHITECTURAL SIGNIFICANCE:** Most / Some / X Minor

PHOTOGRAPHS: (1) Skylight (2) View west ROOM NO. H204

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 348

ROOM NO: H205 LAST KNOWN USE: Passage SQUARE FEET: 450 s.f. CEILING HEIGHT: 9'-7" DATE: 15 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	X Tile Vinyl Linoleum Other:	X Good Fair Poor Destroyed	X 1900-1906 1907-1923 1924-Present In Question	Hex. 1 1/4"
BASE:	Wood Tile X Tile Wainscot Other:	X Good Fair Poor Destroyed	X 1900-1906 1907-1923 1924-Present In Question	5'h.
WALLS:	X Plaster Gypsum Board Glazed Wood Partitions Other:	Good Fair Poor X Destroyed	X 1900-1906 1907-1923 1924-Present In Question	
CEILING:	X Plaster Acoustic panels Cove Other:	Good Fair Poor X Destroyed	X 1900-1906 1907-1923 1924-Present In Question	Skylights covered over.
DOORS/ OPENINGS:	X Wood/Glass Panelled Wood Veneer Galvanized Metal Other:	Good X Fair Poor Destroyed	X 1900-1906 X 1907-1923 X 1924-Present In Question	Wire mesh door at entrance to hall.
LIGHTING:	X Incandescent Fluorescent Missing Other:	X Good 3 Fair Poor X Destroyed 2	Pre-1924 Post-1924 In Question	5 ceiling mounted fixtures- 3 have globes.
HEATING/ VENTILATION PLUMBING:	X Radiators Vents Fans Fixtures Other:	Good X Fair Poor Destroyed	X 1900-1906 1907-1923 1924-Present In Question	2 radiators Pipes Electric box on s. wall
MISCELLANEOUS:		Good Fair Poor Destroyed	1900-1906 1907-1923 1924-Present In Question	
SUMMARY:	○ F ○ B ○ W ○ C	Good Fair X Poor Destroyed	X 1900-1906 1907-1923 1924-Present In Question	**ARCHITECTURAL SIGNIFICANCE:** Most / Some / X Minor

PHOTOGRAPHS: (1) View west

ROOM NO. H205

ROOM NO: H206 LAST KNOWN USE: Passage SQUARE FEET: 1.884 s.f. CEILING HEIGHT: 18'-6½" DATE: 9/23/83

DESCRIPTION:

General: Hallway that was created when a wall was put up in 1924 on the west side of the Registry Room. Access to stairs at north and south ends. S11 is located in the center of this hall.

Floor: Red tile; Registry Room pattern 6" square and 6" X 9".

Base: Red tile along north and part of west walls; tile wainscot along east and south and part of west walls. (84" h.)

Walls: Plaster over terracotta block. East and south walls are glazed in upper half with steel sash. Partition and wire mesh across center of hall on north side of S11 has a sliding door. Original open archway to S01 has been filled in with plaster and doors. Mechanically pulled plaster dado molding along north and part of west walls.

Ceiling: Plaster over terra cotta block. Columns support beams along ceiling.

Doors/ Openings: Galvanized metal doors, some glazed, others panelled. Segmental arched window over S11 on west wall. Wire mesh "wall" at entrance to H204.

Lighting: Suspended and wall-mounted incandescent fixtures.

Ventilation: Vents on west wall.

CONDITION:

Floor: Good condition.

Base: Good condition.

Walls: Plaster is generally in good condition. Base coat is exposed in small patches. Brick and terracotta block exposed in two large areas at northwest corner. Glazed walls are in good condition; only one small break in corner of one light.

Ceiling: Generally good condition; two sections have been opened to the north and south of S11.

Doors/ Openings: Some doors are in good condition, others are in fair condition. Segmental arched window missing glass in one light.

Lighting: No globes extant.

SUMMARY:

F ○ B ○ W ○ C ○

[X] Good [ ] Fair [ ] Poor [ ] Destroyed

[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] Questionable

ARCHITECTURAL SIGNIFICANCE: [ ] Most [X] Some [ ] Minor

PHOTOGRAPHS: 1. View north 2. View south **ROOM NO.** H206

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 352

ROOM NO: H207 LAST KNOWN USE: Passage SQUARE FEET: 1026 s.f. CEILING HEIGHT: 18'-1" DATE: 23 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Red Tile
BASE:	[ ] Wood [X] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Wainscot 5'h. on n. wall.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [X] Other: Glass	[X] Good Windows [ ] Fair [X] Poor Plaster [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	S. wall - arched windows w/ doors to balconies. n. wall - 4-lt. + 2-lt. glass Arched entries to stairs - originally open, filled in at a later date Mechanically pulled dado molding.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood 'Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Glazed doors Panelled doors
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[X] Good 1 [ ] Fair [ ] Poor [X] Destroyed 3	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	4 suspended fixtures - only 1 still has globe.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents 'Fans [ ] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	6 radiators
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ F ○ B ○ W ○ C	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	**ARCHITECTURAL SIGNIFICANCE:** [X] Most [ ] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: (1) View west

ROOM NO. H207

ELLIS ISLAND EXISTING CONDITION SURVEY REGISTRY BUILDING page: 354

ROOM NO: H208 LAST KNOWN USE: Passage SQUARE FEET: 450 s.f. CEILING HEIGHT: 9'-6" DATE: 16 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Red sq's - 6" sq. + 2 5/8" sq.
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	5'h. Major area in middle of s. wall is missing
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Arched entry to stairway - originally open filled in with plaster at a later date. Metal panel at w. end of s. wall. Electric box at e. end of wall.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Galv. metal door - panelled
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[X] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	Three fixtures have globes; the rest are destroyed.
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Fixtures [X] Other: None	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	( ) F ( ) B ( ) W ( ) C	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	**ARCHITECTURAL SIGNIFICANCE:** [X] Most [ ] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: (1) View west

ROOM NO. H208

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 356

ROOM NO: H209 LAST KNOWN USE: Passage SQUARE FEET: 450 s.f CEILING HEIGHT: 9'-6" DATE: 19 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Red Tile - 6" Sq's. 2 5/8" Sq's.
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	5'h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~ Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Windows on n. wall boarded over.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[X] Good 5 [ ] Fair [ ] Poor [X] Destroyed 1	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	5 Ceiling mounted globes.
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Fixtures [X] Other: None	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:	[X] Wood railing + door	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [X] In Question	Located near east end of hall.

SUMMARY:				**ARCHITECTURAL SIGNIFICANCE:**	
	○ F	○ H	○ W	○ C	[ ] Good [ ] Fair [X] Poor	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present	[ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: (1) Wood railing, west end of hall (2) View west ROOM NO. H209

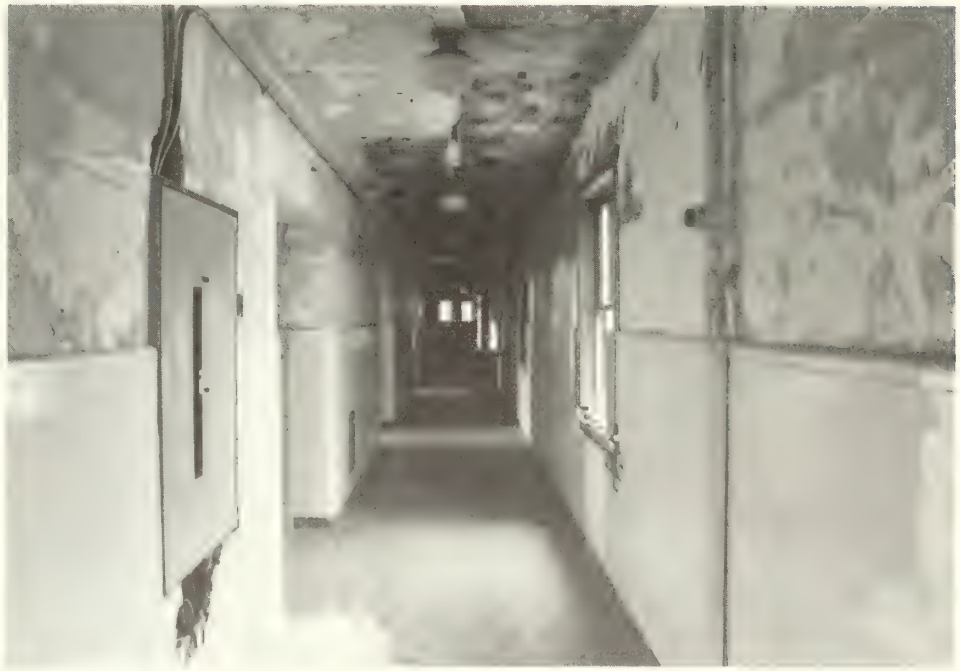

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 358

ROOM NO: H 210 LAST KNOWN USE: Passage SQUARE FEET: 88 s.f. CEILING HEIGHT: 9'-0½" DATE: 16 Sept 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [ ] Vinyl [ ] Linoleum [X] Other: Black composition	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
BASE:	[ ] Wood [ ] Tile [ ] Tile Wainscot [X] Other: Black composition	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	6"h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Electrical box at w. end of s. wall. Mechanically pulled plaster dado molding.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~ Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair 1 [ ] Poor [X] Destroyed 1	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Fixtures [X] Other: None	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:	[ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ ○ ○ ○	[ ] **Good** [X] **Fair** [ ] **Poor**	[X] **1900-1906** [ ] **1907-1923** [ ] **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [ ] Minor

PHOTOGRAPHS: (1) View west

ROOM NO. H210

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING

ROOM NO: H 211 LAST KNOWN USE: Passage SQUARE FEET: 576 s.f. CEILING HEIGHT: 9'-6" DATE: 16 Sept 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	X Tile Vinyl Linoleum Other:	X Good Fair Poor Destroyed	1900-1906 1907-1923 X 1924-Present In Question	Red Tile - 6" sq's. 2 5/8" sq's.
BASE:	Wood Tile X Tile Wainscot Other:	X Good Fair Poor Destroyed	X 1900-1906 1907-1923 1924-Present In Question	5' h.
WALLS:	X Plaster Gypsum Board Glazed Wood Partitions Other:	Good Fair X Poor Destroyed	X 1900-1906 1907-1923 1924-Present In Question	
CEILING:	X Plaster Acoustic panels Cove Other:	Good Fair X Poor Destroyed	X 1900-1906 1907-1923 1924-Present In Question	
DOORS/ OPENINGS:	X ~~Wood~~ Glass Panelled Wood Veneer X Galvanized Metal Other:	Good X Fair Poor Destroyed	X 1900-1906 1907-1923 1924-Present In Question	
LIGHTING:	X Incandescent Fluorescent Missing Other:	Good X Fair 5 Poor X Destroyed 1	Pre-1924 Post-1924 In Question	6 fixtures, ceiling mounted - 1 broken
HEATING/ VENTILATION PLUMBING:	Radiators Vents Fans Fixtures X Other: None	Good Fair Poor Destroyed	1900-1906 1907-1923 1924-Present In Question	
MISCELLANEOUS:		Good Fair Poor Destroyed	1900-1906 1907-1923 1924-Present In Question	

SUMMARY:	○ F ○ B ○ W ○ C	**Good** X **Fair** **Poor** **Destroyed**	X **1900-1906** **1907-1923** **1924-Present** **In Question**	**ARCHITECTURAL SIGNIFICANCE:**	**Most** X **Some** **Minor** **Negligible**

PHOTOGRAPHS: (1) View South (2) Tile floor ROOM NO. H211

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 362

ROOM NO: H 213 LAST KNOWN USE: Passage SQUARE FEET: 41.25 s.f. CEILING HEIGHT: 15'-6" DATE: 16 Sept. 1983

	FINISHES	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [ ] Vinyl [X] Linoleum [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	10.5"h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Panel moldings.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~ Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] Pre-1924 [ ] Post-1924 [ ] In Question	1 suspended globe.
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents Fans [ ] Fixtures [X] Other: None	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	◯ ◯ ◯ ◯	[ ] **Good** [X] **Fair** [ ] **Poor** [ ] **Destroyed**	[X] **1900-1906** [ ] **1907-1923** [ ] **1924-Present** [ ] **In Question**	**ARCHITECTURAL SIGNIFICANCE:** [ ] **Most** [ ] **Some** [X] **Minor**

PHOTOGRAPHS:

ROOM NO. H213

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 364

ROOM NO: H214 LAST KNOWN USE: Passage SQUARE FEET: 48 s.f. CEILING HEIGHT: 15'-6" DATE: 16 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Red sq's. - 6" sq. + 2 5/8" sq.
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	5' h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~ Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	1 suspended globe
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents Fans [ ] Fixtures [X] Other: None	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:	[ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	◯ ◯ ◯ ◯	[X] **Good** [ ] **Fair** [ ] **Poor**	[ ] **1900-1906** [ ] **1907-1923** [X] **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor

PHOTOGRAPHS: (1) View northeast

ROOM NO. H214

D. THIRD FLOOR

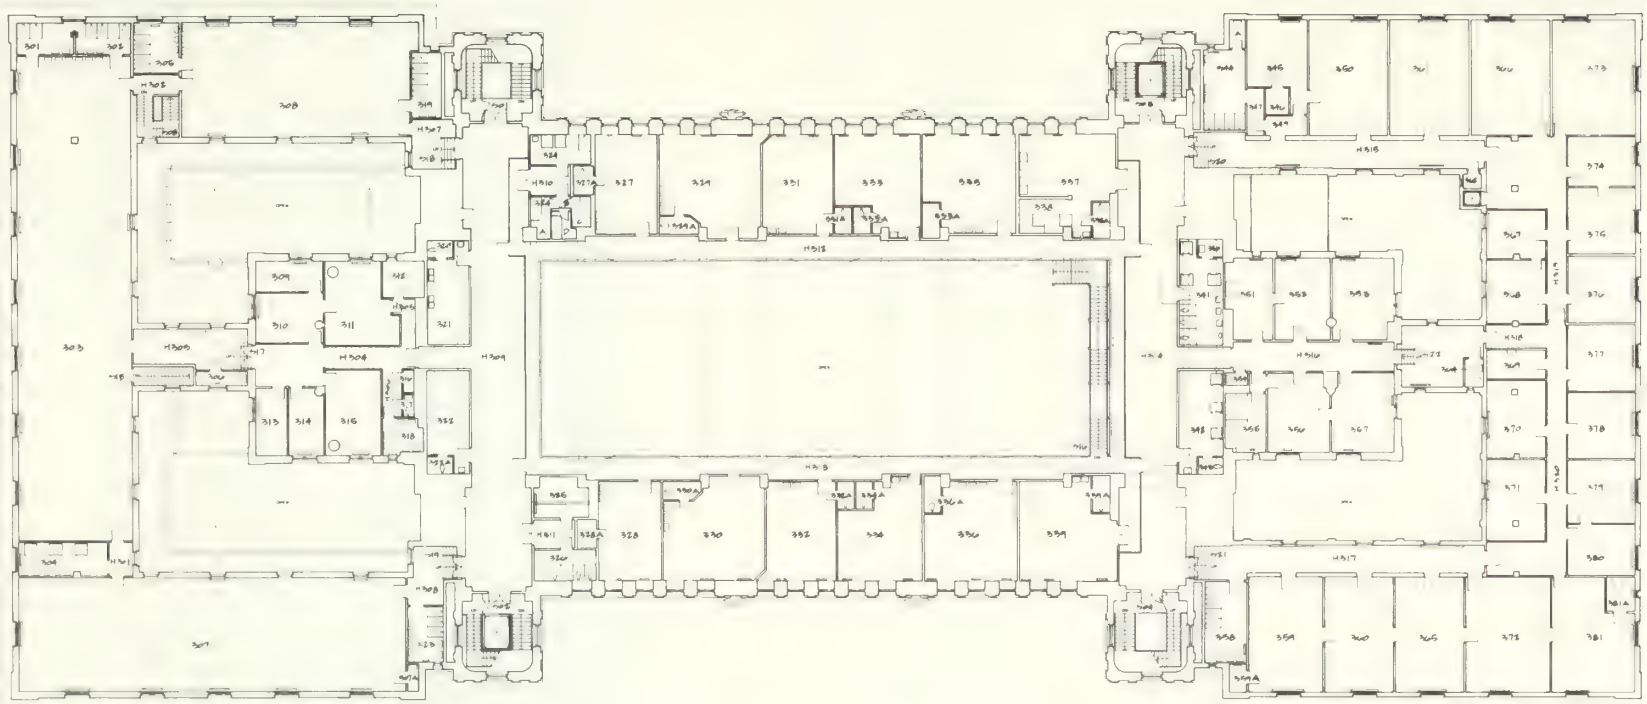

'AS FOUND' DRAWING

THIRD FLOOR PLAN

356	26,003 / 9 of 9
DSC	JUL 88

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 367

ROOM NO: 301 LAST KNOWN USE Bathroom SQUARE FEET: 94 ± sf CEILING HEIGHT: 15'-5½" DATE: 25 Aug. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good DEBRIS [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	hex. 1'1/4" Floor slopes to drain.
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	7' high. 18" section of wall near the window has been removed.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	18" section of wall near the window has been removed.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood 'Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	No. "18B" on exterior. Graffiti (Greek) - dates to 1914.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents Fans [X] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	radiator, 2 pedestal sinks mirror pipes 2 toilets, marble partitions
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ ○ ○ ○	[X] **Good** **Fair** **Poor**	[X] **1900-1906** **1907-1923** **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor

PHOTOGRAPHS: (1) View southwest.

ROOM NO. 301

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING

ROOM NO. 302 LAST KNOWN USE: Bathroom SQUARE FEET: 91 s.f. CEILING HEIGHT: 5'-5½" DATE: 25 Aug. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[ ] Good DEBRIS [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	hex. 1'1/4"
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	7' h. 18" section of wall + wainscot near window has been removed.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	18" section of wall near window has been removed. Section of exterior wall opened for drainpipe.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	2' x 1.5' section missing, n. end.
DOORS/ OPENINGS:	[ ] Wood Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	No. "18A" on exterior. Graffiti, dates to 1914.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents Fans [X] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [X] Destroyed 1 toilet	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	radiator 3 toilets; 4 marble partitions; 3 urinals; Graffiti (Chinese) on marble partitions.
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY: ○ ○ ○ ○ (F P W S)

[ ] Good
[ ] Fair
[X] Poor

[ ] 1900-1906
[X] 1907-1923
[ ] 1924-Present
[ ] In Question

ARCHITECTURAL SIGNIFICANCE:

[ ] Most
[ ] Some
[X] Minor
[ ] Negligible

PHOTOGRAPHS: (1) View northwest. (2) View southwest. (3) Ceiling ROOM NO. 302

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 371

ROOM NO: 303 LAST KNOWN USE: Dormitory #18 SQUARE FEET: 3132 s.f. CEILING HEIGHT: 15'-5½" DATE: 30 Aug. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	hex. 2"
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	7' h. Tile missing under some windows.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood 'Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	6 doors - Nos. printed on them - "18", "18A", "18B", "18C", "18D", "18E". Graffiti on doors - dates 1911-1914. (Greek)
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents Fans [X] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	7 radiators 6 pedestal sinks 2 wall fans
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ ○ ○ ○ F B W C	[ ] Good [ ] Fair [X] Poor	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present	**ARCHITECTURAL SIGNIFICANCE:** [X] Most [ ] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: (1) View north. (2) View south (3) Graffiti on Door. ROOM NO. 303

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 373

ROOM NO: 304 LAST KNOWN USE: Bathroom SQUARE FEET: 168 s.f. CEILING HEIGHT: 15'-5½" DATE: 13 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	hex. 1 1/4" Floor slopes to drain. discoloration, paint splattered.
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	row of hooks on wall.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [X] Other: Missing	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents Fans [X] Fixtures [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	5 pedestal sinks 3 aluminum shower stalls 1 mirror
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ ○ ○ ○	[X] **Good** **Fair** **Poor**	[ ] **1900-1906** [X] **1907-1923** [ ] **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) View northwest (2) Sinks, S. wall, view southwest. ROOM NO. 304

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 375

ROOM NO: 305 LAST KNOWN USE: Bathroom SQUARE FEET: 132 s.f. CEILING HEIGHT: 13'-4½" DATE: 30 Aug. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good DEBRIS [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	hex. 2"
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	7"h; removed under window.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	No. "17C"
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[X] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	2 suspended fixtures: 1 globe intact 1 broken.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents Fans [X] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	radiator 4 toilets; marble partitions; 3 urinals
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ ○ ○ ○	[X] **Good** [ ] **Fair** [ ] **Poor**	[X] **1900-1906** [ ] **1907-1923** [ ] **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) West Wall

ROOM NO. 305

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 377

ROOM NO. 306 LAST KNOWN USE Closet SQUARE FEET: 36 s.f. CEILING HEIGHT: 13'-5½" DATE: 30 Aug. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	hex. 2"
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	7'h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	window on s. wall boarded over.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents Fans [X] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	radiator 1 slop sink Large pipe in s.e. corner
MISCELLANEOUS:	[ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	◯ F ◯ B ◯ W ◯ C	[X] Good [ ] Fair [ ] Poor	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [ ] Minor [X] Negligible

PHOTOGRAPHS: (1) East wall

ROOM NO. 306

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 379

ROOM NO. 307 LAST KNOWN USE: Dormitory #19 SQUARE FEET: 2497.5sf. CEILING HEIGHT: 13'-3" / 14'-2" DATE: 30 Aug. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	hex. 1¼"
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	7" h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	2 narrow sections removed for pipes.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	Heaving.
DOORS/ OPENINGS:	[X] Wood ~~Glass~~ Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [X] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	Wall sconce- rusted
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents Fans [ ] Fixtures [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	2 radiators 6 radiators
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY: ( ) F ( ) B ( ) W ( ) C

[X] Good [X] Fair [ ] Destroyed [ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question

ARCHITECTURAL SIGNIFICANCE: [X] Most [ ] Some [ ] Minor

PHOTOGRAPHS: (1) View west (2) View east (3) Sconce, north wall ROOM NO. 307

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 381

ROOM NO: 307A LAST KNOWN USE: Sink room SQUARE FEET: 16.25 s.f. CEILING HEIGHT: 13'-3" DATE: 22 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	hex. 1'1/4"
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	83" h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Inlay
LIGHTING:	[ ] Incandescent [ ] Fluorescent [ ] Missing [X] Other: none	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents Fans [X] Fixtures [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	slopsink
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ ○ ○ ○	[X] **Good** **Fair** **Poor**	[X] **1900-1906** **1907-1923** **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [ ] Minor

PHOTOGRAPHS: (1) View east

ROOM NO. 307A

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 383

ROOM NO: 308 LAST KNOWN USE: Dormitory #17 SQUARE FEET: 1484.5 s.f. CEILING HEIGHT: 13'-4½" DATE: 30 Aug. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	hex. 2" Floor slopes to drain Discoloration in one small area
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	7'h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Narrow section of wall removed for pipe.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Nos. "17B", "17C", "17D", "17?" Graffiti on door to H302 ("17B").
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[X] Good [ ] Fair [X] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	8 suspended globes - good condition 2 wall sconces - 1 good, 1 poor 4 missing fixtures
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents Fans [X] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	5 radiators 3 pedestal sinks; 1 drinking fountain; 1 wall fan; pipe added in s.e. corner (recent alteration)
MISCELLANEOUS:	[ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ ○ ○ ○	[X] Good [X] Fair [ ] Poor	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) View east (2) Graffiti on door ROOM NO. 308

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 385

ROOM NO: 309 LAST KNOWN USE: Dormitory #25 SQUARE FEET: 112 s.f. CEILING HEIGHT: 12'-7½" DATE: 30 Aug. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☐ Linoleum ☒ Other: Wood	☒ Good DEBRIS ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	Painted wood floor.
BASE:	☒ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	10.5" h.
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Glazed Wood Partitions ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	Area near window destroyed.
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
DOORS/ OPENINGS:	☐ Wood ~~Glass~~ Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	Graffiti on exterior of door.
LIGHTING:	☒ Incandescent ☐ Fluorescent ☐ Missing ☐ Other:	☐ Good ☒ Fair ☐ Poor ☒ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents/Fans ☐ Fixtures ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	radiator
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	

SUMMARY: ○ E ○ R ○ W ○ C

☒ Good ☐ Fair ☐ Poor ☐ Destroyed

☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question

ARCHITECTURAL SIGNIFICANCE: ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS: (1) View east (2) Graffition door ROOM NO. 309

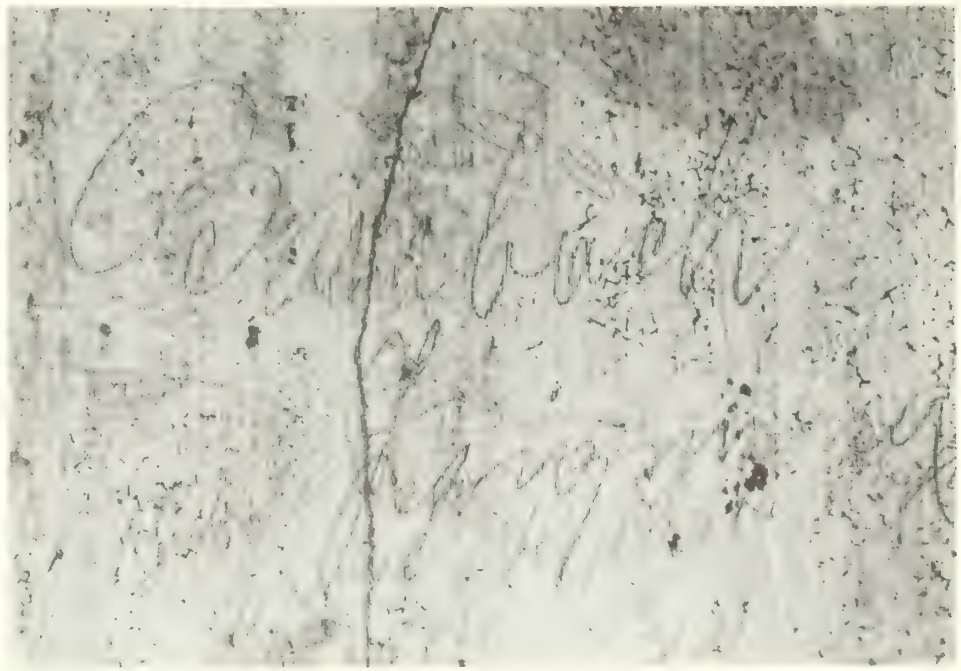

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 387

ROOM NO: 310 LAST KNOWN USE: Dormitory # 24 SQUARE FEET: 192 s.f. CEILING HEIGHT: 12'-7½" DATE: 30 Aug

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☐ Linoleum ☒ Other: Wood	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	painted wood floor.
BASE:	☒ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	10.5" h.
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Glazed Wood Partitions ☒ Other: Wood	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	South wall - vertical wood, cornice molding at 95"h. Octagonal column on east wall - Graffiti + doodles: faces, cartoon.
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
DOORS/ OPENINGS:	☒ Wood ~~Glass~~ Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
LIGHTING:	☒ Incandescent ☐ Fluorescent ☐ Missing ☐ Other:	☒ Good ☐ Fair ☐ Poor ☒ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	hanging fixture - good condition wall pendant - destroyed
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents Fans ☐ Fixtures ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
SUMMARY:	◯ ◯ ◯ ◯	☒ **Good** ☐ **Fair** ☐ **Poor**	☒ **1900-1906** ☐ **1907-1923** ☐ **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☒ Some ☐ Minor ☐ Negligible

PHOTOGRAPHS: (1) Northwest corner (2) South wall ROOM NO. 310

PHOTOGRAPHS: (3) Graffiti (4) Column capital ROOM NO. 310

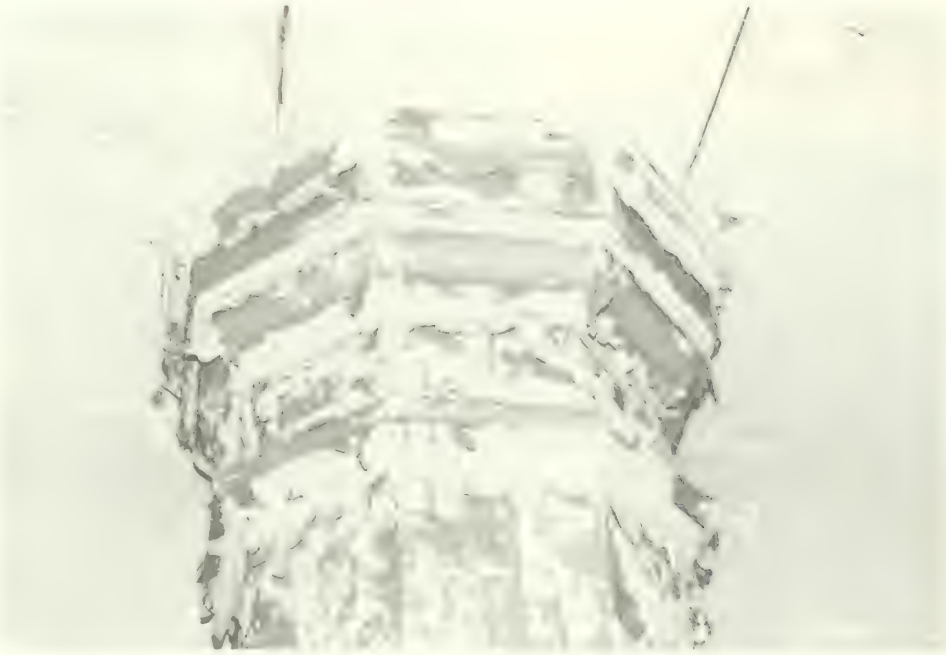

PHOTOGRAPHS:

ROOM NO.

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 391

ROOM NO: 311 LAST KNOWN USE: Dormitory #26 SQUARE FEET: 306 s.f. CEILING HEIGHT: 12'-7½" DATE: 30 August 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Linoleum ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	
BASE:	☒ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	10.5" h.
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Glazed Wood Partitions ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
DOORS/ OPENINGS:	☒ Wood/~~Glass~~ Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
LIGHTING:	☒ Incandescent ☐ Fluorescent ☐ Missing ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	2 suspended globes
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents Fans ☐ Fixtures ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	2 radiators Duct, 3' diam., in n.w. corner.
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
SUMMARY:	◯ ◯ ◯ ◯	☐ **Good** ☒ **Fair** ☐ **Poor** ☐ **Destroyed**	☒ **1900-1906** ☐ **1907-1923** ☐ **1924-Present** ☐ **In Question**	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS: (1) Northwest corner

ROOM NO. 311

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 393

ROOM NO: 312 LAST KNOWN USE: Closet SQUARE FEET: 85 s.f. CEILING HEIGHT: 12'-7½" DATE: 30 Aug. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☐ Linoleum ☒ Other: Wood	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
BASE:	☒ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	10.5"h.
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Glazed Wood Partitions ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
DOORS/ OPENINGS:	☒ Wood ~~Glass~~ Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
LIGHTING:	☒ Incandescent ☐ Fluorescent ☐ Missing ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	ceiling mounted globe
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents Fans ☐ Fixtures ☒ Other: none	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	

SUMMARY:	○ T ○ B ○ W ○ C	☒ **Good** ☐ **Fair** ☐ **Poor**	☒ **1900-1906** ☐ **1907-1923** ☐ **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:**	☐ **Most** ☐ **Some** ☐ **Minor** ☒ **Negligible**

PHOTOGRAPHS: (1) Northwest corner

ROOM NO. 312

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 395

ROOM NO: 313 LAST KNOWN USE: Dormitory #22 SQUARE FEET: 112 s.f. CEILING HEIGHT: 12'-7½" DATE: 1 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [ ] Vinyl [ ] Linoleum [X] Other: Wood	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	10.5" h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Graffition s. wall + s. end of w. wall, upper ½. These sections of wall are unstable. Picture molding.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents Fans [ ] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	( ) F ( ) B ( ) W ( ) C	**Good** **Fair** **Destroyed**	**1900-1906** **1907-1923** **1924-Present** **In Question**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor

PHOTOGRAPHS: (1) View south (2) Graffiti on south wall ROOM NO. 313

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 397

ROOM NO: 314 LAST KNOWN USE: Dormitory #21 SQUARE FEET: 128 s.f. CEILING HEIGHT: 12'-7½" DATE: 1 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [ ] Vinyl [ ] Linoleum [X] Other: Wood	[X] Good DEBRIS [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	10.5" h., wood finish.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Octagonal column in n.e. corner: graffiti in pencil + blue chalk Picture molding.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~ Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Window to light court on S. wall is boarded over.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents Fans [ ] Fixtures [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ ○ ○ ○ F B W C	[X] **Good** [ ] **Fair** [ ] **Poor** [ ] ~~**Destroyed**~~	[X] **1900-1906** [ ] **1907-1923** [ ] **1924-Present** [ ] **In Question**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) View South

ROOM NO. 314

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 399

ROOM NO: 315 LAST KNOWN USE: Dormitory #20 SQUARE FEET: 260 s.f. CEILING HEIGHT: 12'-7½" DATE: 1 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☐ Linoleum ☒ Other: Wood	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
BASE:	☒ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	10.5" h.
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Glazed Wood Partitions ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	Picture molding appears to be missing.
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
DOORS/ OPENINGS:	☒ ~~Wood~~/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	Windows to light court on S. wall boarded over.
LIGHTING:	☒ Incandescent ☐ Fluorescent ☐ Missing ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents/Fans ☐ Fixtures ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	Large duct, 3' in diam., in S.W. corner.
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
SUMMARY:	○ ○ ○ ○	☒ **Good** ☐ **Fair** ☐ **Poor**	☒ **1900-1906** ☐ **1907-1923** ☐ **1924-Present** ☐ **In Question**	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS: (1) Southeast corner

ROOM NO. 315

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 401

ROOM NO: 316 LAST KNOWN USE: Toilet SQUARE FEET: 12.5 s.f. CEILING HEIGHT: 12'-7½" DATE:

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☐ Linoleum ☐ Other:	☐ Good DEBRIS ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
BASE:	☐ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
WALLS:	☐ Plaster ☐ Gypsum Board ☐ Glazed Wood Partitions ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
CEILING:	☐ Plaster ☐ Acoustic panels ☐ Cove ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
LIGHTING:	☐ Incandescent ☐ Fluorescent ☐ Missing ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents/Fans ☐ Fixtures ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
MISCELLANEOUS:	☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
SUMMARY:	○ F ○ B ○ W ○ C	☐ **Good** ☐ **Fair** ☐ **Poor** ☐ **Destroyed**	☒ **1900-1906** ☐ **1907-1923** ☐ **1924-Present** ☐ **In Question**	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☐ Minor ☒ Negligible

PHOTOGRAPHS:

ROOM NO. 316

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 403

ROOM NO: 317 LAST KNOWN USE: Toilet SQUARE FEET: 12.5 s.f. CEILING HEIGHT: 12'-7½" DATE: 1 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	hex. 1'1/4"
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	6' h. w/ molding.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~ Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [X] Vents Fans [X] Fixtures [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Sink toilet broken at rear. toilet paper holder. lg. vent on e. wall
MISCELLANEOUS:	[ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ F ○ B ○ W ○ C	[X] **Good** [ ] **Fair** [ ] **Poor** [ ] **Destroyed**	[X] **1900-1906** [ ] **1907-1923** [ ] **1924-Present** [ ] **In Question**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) East wall

ROOM NO. 317

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING

ROOM NO: 318 LAST KNOWN USE: Bathroom SQUARE FEET: 68 s.f. CEILING HEIGHT: 12'-7½" DATE: 1 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	hex. 1¼"
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	7'h. w/ molding
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Base coat exposed near window
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	n. wall - opening to Rm. 317. s. wall - window boarded over.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [X] Vents/Fans [X] Fixtures [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	6 pedestal sinks; mirrors; paper towel dispenser vent in ne corner pipe w/ shower head spans room, n. to s.
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ F ○ B ○ W ○ C	[ ] **Good** [X] **Fair** [ ] **Poor** [ ] **Destroyed**	[X] **1900-1906** [ ] **1907-1923** [ ] **1924-Present** [ ] **In Question**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) Southeast corner

ROOM NO. 318

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 407

ROOM NO: 319 LAST KNOWN USE: Bathroom SQUARE FEET: 108.5 s.f CEILING HEIGHT: 13'-4½" DATE: 22 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good DEBRIS [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	hex. 1'1/4"
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	85" h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	part of S. + E. walls opened for pipe (recently).
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [X] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	4 toilets; marble partitions; wood slat doors; 2 pedestal sinks; mirror.
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ ○ ○ ○ F P W C	[X] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) View northwest

ROOM NO. 319

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 409

ROOM NO: 320 LAST KNOWN USE: Toilet SQUARE FEET: 24 s.f. CEILING HEIGHT: 10'-5¼" DATE: 1 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	hex. 1'1/4"
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	7'h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	
CEILING:	[ ] Plaster [ ] Acoustic panels [ ] Cove [X] Other: Wire mesh	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Glazed in upper half. Sliding door
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents Fans [X] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Toilet-missing seat
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ F ○ B ○ W ○ C	[X] **Good** [ ] **Fair** [ ] **Poor** [ ] **Destroyed**	[ ] **1900-1906** [X] **1907-1923** [ ] **1924-Present** [ ] **In Question**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) North wall

ROOM NO. 320

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 411

ROOM NO: 321 LAST KNOWN USE: Dormitory Q SQUARE FEET: 215.75 s.f. CEILING HEIGHT: 10'-5¼" DATE: 1 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	hex 1'1/4" Floor slopes to drain
BASE:	[ ] Wood [ ] Tile [ ] Tile Wainscot [X] Other: none	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
WALLS:	[ ] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [X] Other: Tile	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[ ] Plaster [ ] Acoustic panels [ ] Cove [X] Other: Wire mesh	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Glazed door
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [X] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	1 pedestal sink 2 double pedestal sinks
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:		[X] **Good** [ ] **Fair** [ ] **Poor** [ ] **Destroyed**	[ ] **1900-1906** [X] **1907-1923** [ ] **1924-Present** [ ] **In Question**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor

PHOTOGRAPHS: ① Southwest corner

ROOM NO. 321

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 413

ROOM NO: 322 LAST KNOWN USE: Dormitory S SQUARE FEET: 215.75 s.f. CEILING HEIGHT: 10'-5¼" DATE: 1 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good DEBRIS [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	hex. 1'1/4" Floor slopes to drain
BASE:	[ ] Wood [ ] Tile [ ] Tile Wainscot [X] Other: none	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
WALLS:	[ ] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [X] Other: Tile	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[ ] Plaster [ ] Acoustic panels [ ] Cove [X] Other: wire mesh	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Bending under debris, rusted.
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Glazed door
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [X] Fixtures [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	pedestal sink
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ ○ ○ ○ F S W C	[X] **Good** **Fair** **Poor**	[X] **1900-1906** **1907-1923** **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor

PHOTOGRAPHS: (1) View north

ROOM NO. 322

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 415

ROOM NO: 322A LAST KNOWN USE: Toilet SQUARE FEET: 24 s.f. CEILING HEIGHT: 10'-5¼" DATE: 1 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	7'h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	
CEILING:	[ ] Plaster [ ] Acoustic panels [ ] Cove [X] Other: Wire mesh	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Sliding door Transom
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents Fans [X] Fixtures [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Toilet
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ T ○ B ○ W ○ C	[X] **Good** [ ] **Fair** [ ] **Poor** [ ] **Destroyed**	[ ] **1900-1906** [X] **1907-1923** [ ] **1924-Present** [ ] **In Question**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) View south

ROOM NO. 322A

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 417

ROOM NO: 323 LAST KNOWN USE: Toilet SQUARE FEET: 110.5 s.f. CEILING HEIGHT: 13'-4¼" DATE: 1 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good DEBRIS [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	hex. 2"
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	7'h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood 'Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [X] Other: Missing	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents 'Fans [X] Fixtures [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	radiator 3 toilets; marble partitions; wood slat doors; 4 pedestal sinks; 2 urinals; mirror; 2 missing mirrors.
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY: ○ F ○ B ○ W ○ C

[X] Good / Fair / Poor

[X] 1907-1923

ARCHITECTURAL SIGNIFICANCE: [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: ① View south

ROOM NO. 323

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 419

ROOM NO: 324 LAST KNOWN USE: Bathroom SQUARE FEET: 101.5 s.f. CEILING HEIGHT: 14'-0½" DATE: 7 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	hex. 1'4" Floor slopes to drain
BASE:	[ ] Wood [ ] Tile [ ] Tile Wainscot [X] Other: Slate	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [X] In Question	70" h. wainscot painted
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Glazed Door Transom
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents Fans [X] Fixtures [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	radiator, elevated in middle of wall. 1 toilet; marble partitions; wood slat door; 2 metal shower stalls; 1 slop sink
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY:	○ E ○ B ○ W ○ C	[X] Good [ ] Fair [ ] Poor	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present	**ARCHITECTURAL SIGNIFICANCE:**	[ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) View east

ROOM NO. 324

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 421

ROOM NO: 324A LAST KNOWN USE: Tub Room SQUARE FEET: 40 s.f. CEILING HEIGHT: 10'-11" DATE: 7 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 1¼" Floor slopes to drain.
BASE:	[ ] Wood [ ] Tile [ ] Tile Wainscot [X] Other: None	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [X] Other: Tile	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Later (east) wall is only 96" high with tile to a ht. of 83", surmounted by plaster.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
LIGHTING:	[ ] Incandescent [ ] Fluorescent [ ] Missing [X] Other: None	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [X] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Radiator elevated on wall. Bathtub
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ F ○ R ○ W ○ C	[X] **Good** [ ] **Fair** [ ] **Poor** [ ] **Destroyed**	[ ] **1900-1906** [ ] **1907-1923** [X] **1924-Present** [ ] **In Question**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: ① West wall

ROOM NO. 324A

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 423

ROOM NO: 324B LAST KNOWN USE: Passage SQUARE FEET: 12.5 s.f. CEILING HEIGHT: 10'-11" DATE: 7 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 1 1/4" Floor slopes to drain.
BASE:	[ ] Wood [ ] Tile [ ] Tile Wainscot [X] Other: None	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [X] Other: Tile	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	e.,w., + s. walls are 96" high with tile to a ht. of 83", surmounted by plaster.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Galv. Metal door is glazed.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Fixtures [X] Other: None	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:	[ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ ○ ○ ○	[X] Good [ ] Fair [ ] Poor	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) View south

ROOM NO. 324B

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 425

ROOM NO: 324 C LAST KNOWN USE: Tub Room SQUARE FEET: 31.5 s.f. CEILING HEIGHT: 10'-11" DATE: 7 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 1¼" Floor slopes to drain
BASE:	[ ] Wood [ ] Tile [ ] Tile Wainscot [X] Other: None	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [X] Other: Tile	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Later (west) wall is 96" high with tile to a ht. of 83", surmounted by plaster
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~ Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
LIGHTING:	[ ] Incandescent [ ] Fluorescent [ ] Missing [X] Other: None	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents Fans [X] Fixtures [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Bathtub
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ E ○ R ○ W ○ C	[X] **Good** [ ] **Fair** [ ] **Poor** [ ] **Destroyed**	[ ] **1900-1906** [ ] **1907-1923** [X] **1924-Present** [ ] **In Question**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) Southeast corner

ROOM NO. 324C

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 427

ROOM NO: 324D LAST KNOWN USE: Tub Room SQUARE FEET: 31.25 s.f. CEILING HEIGHT: 10'-11" DATE: 7 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	X Tile Vinyl Linoleum Other:	X Good Fair Poor Destroyed	X 1900-1906 1907-1923 1924-Present In Question	Hex. 1¼" Floor slopes to drain.
BASE:	Wood Tile Tile Wainscot X Other: None	Good Fair Poor Destroyed	1900-1906 1907-1923 1924-Present In Question	
WALLS:	X Plaster Gypsum Board Glazed Wood Partitions X Other: Tile	X Good Tile X Fair Plaster Poor Destroyed	X 1900-1906 1907-1923 X 1924-Present In Question	n., e., + w. walls are 96" high with tile to a ht. of 83", surmounted by plaster.
CEILING:	X Plaster Acoustic panels Cove Other:	X Good Fair Poor Destroyed	1900-1906 1907-1923 X 1924-Present In Question	
DOORS/ OPENINGS:	X ~~Wood~~ Glass Panelled Wood Veneer Galvanized Metal Other:	Good X Fair Poor Destroyed	1900-1906 1907-1923 X 1924-Present In Question	
LIGHTING:	X Incandescent Fluorescent Missing Other:	Good Fair Poor X Destroyed	Pre-1924 Post-1924 In Question	
HEATING/ VENTILATION PLUMBING:	Radiators Vents/Fans X Fixtures Other:	Good X Fair Poor Destroyed	1900-1906 1907-1923 X 1924-Present In Question	Bathtub
MISCELLANEOUS:		Good Fair Poor Destroyed	1900-1906 1907-1923 1924-Present In Question	
SUMMARY:	E B W	X Good Fair Poor	1900-1906 1907-1923 X 1924-Present In Question	**ARCHITECTURAL SIGNIFICANCE:** Most / Some / X Minor

PHOTOGRAPHS: (1) View Southwest

ROOM NO. 324D

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 429

ROOM NO: 325 LAST KNOWN USE: Shower Room SQUARE FEET: 118 s.f. CEILING HEIGHT: DATE: 7 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Hex. 1'1/4" Floor slopes to drain.
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	85" h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Glazed Door. Transom. Pivotal window opens onto balcony.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [X] Vents/Fans [X] Fixtures [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Raised platform with showers on wall. Radiator elevated on wall Vent on east wall.
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ ○ ○ ○	[ ] **Good** [X] **Fair** [ ] **Poor**	[X] **1900-1906** [ ] **1907-1923** [ ] **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor

PHOTOGRAPHS: (1) North wall

ROOM NO. 325

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 431

ROOM NO: 326 LAST KNOWN USE: Bathroom SQUARE FEET: 105 s.f. CEILING HEIGHT: DATE: 7 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Hex. 1'1/4"
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	62" h. Good condition except major area removed for drain pipe on s. wall.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Glazed door. Transom.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents Fans [X] Fixtures [ ] Other:	[ ] Good [ ] Fair [X] Poor [X] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Radiator elevated on wall 4 toilets - 3 poor, 1 destroyed. Marble partitions - one knocked over. Sink knocked off wall.
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ ○ ○ ○ F B W C	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) South wall

ROOM NO. 326

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 433

ROOM NO: 327, 327A LAST KNOWN USE: Dormitory SQUARE FEET: 375.75 s.f. CEILING HEIGHT: 13'-6½" / 11'-11" DATE: 7 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 1'1/4" Floor slopes to drain
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	84" h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [X] Other: Pivotal windows	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Glazed Doors (2) Transoms Pivotal windows open onto balcony
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [X] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	3 suspended fixtures - shades, no globes Fixture in 327 A destroyed
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents Fans [X] Fixtures [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	2 radiators 2 pedestal sinks 1 toilet Toilet Paper
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ E ○ B ○ W ○ C	**Good** [X] **Fair** **Poor** **Destroyed**	**1900-1906** [X] **1907-1923** **1924-Present** **In Question**	**ARCHITECTURAL SIGNIFICANCE:** [X] Most [ ] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: (1) 327A, West wall (2) 327, View north (3) 327, View South ROOM NO. 327, 327A

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 435

ROOM NO: 328, 328A LAST KNOWN USE: Dormitory SQUARE FEET: 387.5 s.f. CEILING HEIGHT: 13'-5½" N 11'-9" DATE: 7 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 1'1/4" Floor slopes to drain.
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	84" h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [X] Other: Pivotal windows	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Glazed doors (2) Transom Pivotal windows open onto balcony
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents Fans [X] Fixtures [ ] Other:	[ ] Good [X] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	2 radiators 2 pedestal sinks mirror toilet in 328A has been knocked over.
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY:	○ F ○ P ○ W ○ C	[X] Good [ ] Fair [ ] Poor	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present	**ARCHITECTURAL SIGNIFICANCE:**	[ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) 328 A, West wall (2) 328, view south (3) 328, northeast corner ROOM NO. 328, 328A

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 437

ROOM NO: 329, 329A LAST KNOWN USE: Dormitory B SQUARE FEET: 584 S.F. CEILING HEIGHT: 13'-6 1/2" / 11'-11" DATE: 7 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 1'1/4" Floor slopes to drain.
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	84"h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Major areas have exposed terracotta blocks; beams exposed on s. wall; section of wall removed for pipe on n. wall (recent)
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Glazed doors (2) Transoms
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [X] Vents Fans [X] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	3 pedestal sinks; toilet 2 radiators broken mirror vent in ceiling of 329A.
MISCELLANEOUS:	[ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ E ○ B ○ W ○ C	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	**ARCHITECTURAL SIGNIFICANCE:** [X] Most [ ] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: (1) 329A, Southwest Corner (2) 329, View north (3) 329, View Southwest **ROOM NO.** 329, 329A

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 439

ROOM NO: 330, 330A LAST KNOWN USE: Dormitory M SQUARE FEET: 578.5 s.f. CEILING HEIGHT: 13'-5½" / 11'-9" DATE: 7 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 1'1/4" Floor slopes to drain.
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	84" h. Good condition except for areas missing below windows + removed to get at pipes.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [X] Other: Pivotal windows	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Glazed doors (2) Transoms Windows open onto balcony.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [X] Vents/Fans [X] Fixtures [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	3 radiators 3 pedestal sinks Toilet Vent in ceiling
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY: ○ F ○ B ○ W ○ C

[ ] Good	[ ] 1900-1906
[X] Fair	[X] 1907-1923
[ ] Poor	[ ] 1924-Present
[ ] Destroyed	[ ] In Question

ARCHITECTURAL SIGNIFICANCE:

- [ ] Most
- [X] Some
- [ ] Minor
- [ ] Negligible

PHOTOGRAPHS: (1) 330, southwest corner (2) 330, northwest corner ROOM NO. 330, 330A

PHOTOGRAPHS: (3) Rm. 330A, north wall (4) Duct in ceiling, Rm. 330 ROOM NO. 330, 330A

PHOTOGRAPHS:

ROOM NO.

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING

ROOM NO: 331, 331A LAST KNOWN USE: Dormitory C SQUARE FEET: 413.5 s.f. CEILING HEIGHT: 13'-6½"; 11'-11" DATE: 7 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 1¼" Floor slopes to drain
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	84"h. Major area of tile missing under windows.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Hole in wall over door All plaster + basecoat destroyed on n. wall.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Exposed lath at s. end.
DOORS/ OPENINGS:	[ ] Wood Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [X] Other: Pivoted windows	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Glazed doors (2) Transoms Windows open onto balcony - some lights broken.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [X] Vents Fans [X] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	2 radiators 2 pedestal sinks; mirror; toilet Toilet
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:		[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	**ARCHITECTURAL SIGNIFICANCE:** [X] Most [ ] Some [ ] Minor

PHOTOGRAPHS: (1) East wall, Room 331A (2) View north, Rm. 331 (3) View southwest, Rm. 331 ROOM NO. 331, 331A

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 445

ROOM NO: 332, 332A LAST KNOWN USE: Dormitory L SQUARE FEET: 419 s.f CEILING HEIGHT: 13'-5½" / 11'-9" DATE: 9 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 1'1/4"
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	84" h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Lath + ducts exposed.
DOORS/ OPENINGS:	[ ] Wood Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [X] Other: Pivotal Windows	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Glazed doors (2) Transoms Windows open onto balcony
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [X] Vents Fans [X] Fixtures [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	2 radiators 2 pedestal sinks; mirror; toilet; Drainpipe on W. wall, 5½" diam. Vents in ceiling.
MISCELLANEOUS:	[ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY: ○ F ○ B ○ W ○ C

[ ] Good
[X] Fair
[ ] Poor
[ ] Destroyed

[ ] 1900-1906
[X] 1907-1923
[ ] 1924-Present
[ ] In Question

ARCHITECTURAL SIGNIFICANCE:

[ ] Most
[X] Some
[ ] Minor
[ ] Negligible

PHOTOGRAPHS: (1) View south, Rm. 332 (2) View north, Rm. 332 ROOM NO. 332, 332A

PHOTOGRAPHS: (3) Southeast corner, Rm. 332A (4) Ceiling duct, Rm 332 ROOM NO. 332, 332A

PHOTOGRAPHS:

ROOM NO.

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 449

ROOM NO: 333, 333A LAST KNOWN USE: Dormitory SQUARE FEET: 4575 sf CEILING HEIGHT: 13'-6½" / 11'-11" DATE: 7 Sept. 1983

	FINISHES	CONDITION	DATE:	NOTES
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 1'1/4"
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	84"h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	n. wall - Terracotta blocks exposed.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	small section removed for pipe (recent)
DOORS/ OPENINGS:	[ ] Wood Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Glazed doors (2) Transoms
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [X] Vents/Fans [X] Fixtures [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	3 radiators 2 pedestal sinks Toilet Vents in ceiling.
MISCELLANEOUS:	[ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ F ○ B ○ W ○ C	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	**ARCHITECTURAL SIGNIFICANCE:** [X] Most [ ] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: ① West wall, Rm. 333A ② View north, Rm. 333 ③ View south

ROOM NO. 333, 333A

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 451

ROOM NO. 334, 334A LAST KNOWN USE Dormitory K SQUARE FEET 4575 sf CEILING HEIGHT 13'-5½", 11'-9" DATE 9 Sept. 1983

	FINISHES	CONDITION	DATE	NOTES
FLOOR:	X Tile Vinyl Linoleum Other:	X Good Fair Poor Destroyed	1900-1906 X 1907-1923 1924-Present In Question	Hex. 1'1/4" Floors slope to drain.
BASE:	Wood Tile X Tile Wainscot Other:	Good X Fair Poor Destroyed	1900-1906 X 1907-1923 1924-Present In Question	84" h. Tile missing + discolored over windows. Major area knocked out for electrical box on n. wall - 64" x 16".
WALLS:	X Plaster Gypsum Board Glazed Wood Partitions Other:	Good Fair X Poor Destroyed	X 1900-1906 X 1907-1923 1924-Present In Question	Major area knocked out for electrical box on n. wall - 64" x 16". Some recent holes for pipes.
CEILING:	X Plaster Acoustic panels Cove Other:	Good Fair X Poor Destroyed	1900-1906 1907-1923 X 1924-Present In Question	
DOORS/ OPENINGS:	Wood Glass Panelled Wood Veneer X Galvanized Metal Other:	Good X Fair Poor Destroyed	X 1900-1906 1907-1923 1924-Present In Question	Glazed doors (2) Transoms
LIGHTING:	X Incandescent Fluorescent Missing Other:	Good Fair Poor X Destroyed	Pre-1924 Post-1924 In Question	
HEATING/ VENTILATION PLUMBING:	X Radiators X Vents Fans X Fixtures Other:	Good X Fair Poor Destroyed	1900-1906 X 1907-1923 1924-Present In Question	2 radiators 2 pedestal sinks, mirror Toilet Toilet Paper holder
MISCELLANEOUS:		Good Fair Poor Destroyed	1900-1906 1907-1923 1924-Present In Question	

SUMMARY: ○ F ○ B ○ W ○ C

Good	1900-1906	**ARCHITECTURAL SIGNIFICANCE:**
X Fair	X 1907-1923	X Most
Poor	1924-Present	Some
Destroyed	In Question	Minor
		Negligible

PHOTOGRAPHS: (1) West wall, Rm. 334A (2) View south, Rm. 334 (3) View northwest, Rm. 334 ROOM NO. 334, 334A

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 453

ROOM NO: 335, 335A LAST KNOWN USE: Dormitory E SQUARE FEET: 526 sf CEILING HEIGHT: 13'-6½", 11'-11" DATE: 7 Sept 1983

	FINISHES	CONDITION	DATE:	NOTES
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 1'1/4" Floor slopes to drain.
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	84" h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [X] Other: Pivotal windows	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Glazed doors (2) Transoms Windows open onto balcony - one light missing.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [X] Vents Fans [X] Fixtures [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	3 radiators 3 pedestal sinks; mirror; toilet Vents in ceiling
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY: ○ F ○ B ○ W ○ C

[X] Good [X] Fair [ ] Poor [ ] Destroyed

[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question

ARCHITECTURAL SIGNIFICANCE: [X] Most [ ] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: (1) West wall, Rm. 335A (2) View northwest, Rm. 335 (3) View southeast, Rm. 335 ROOM NO. 335, 335A

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING

ROOM NO: 336, 336A LAST KNOWN USE: Dormitory J SQUARE FEET: 526 s.f CEILING HEIGHT: 13'-5½", 11'-9" DATE: 9 Sept. 1983

	FINISHES	CONDITION:	DATE	NOTES
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Hex 1 1/4 " Floor slopes to drain
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	84" h. A few tiles are missing under windows.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [X] Other: Pivotal Windows	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Glazed doors (2) Transoms Pivotal windows open onto balcony
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [X] Vents Fans [X] Fixtures [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	3 radiators 3 pedestal sinks; mirror 1 toilet
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY: ○ F ○ B ○ W ○ C

[ ] Good
[X] Fair
[ ] Poor
[ ] Destroyed

[X] 1900-1906
[ ] 1907-1923
[ ] 1924-Present
[ ] In Question

ARCHITECTURAL SIGNIFICANCE:

[ ] Most
[X] Some
[ ] Minor
[ ] Negligible

PHOTOGRAPHS: (1) West wall, Rm. 336A (2) View southwest, Rm. 336 (3) View northwest, Rm. 336 **ROOM NO.** 336, 336A

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 457

ROOM NO: 337 LAST KNOWN USE: Dormitory F SQUARE FEET: 322 s.f CEILING HEIGHT: 13'-6½" DATE: 7 Sept. 1983

	FINISHES	CONDITION	DATE	NOTES
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good DEBRIS [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 1'1/4"
BASE:	[ ] Wood [X] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	84"h. 6" red tile on part of s. wall.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	s. wall - only 77" high
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	More than ½ of ceiling has been totally removed.
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Glazed door Transom
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [X] Vents/Fans [X] Fixtures [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	2 radiators 2 double pedestal sinks vents in ceiling
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY:	○ E ○ B ○ W ○ C	[X] **Good** [X] **Fair** [ ] **Poor**	[ ] **1900-1906** [ ] **1907-1923** [X] **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:**	[ ] Most [ ] Some [X] Minor

PHOTOGRAPHS: (1) View west of Rm. 337; Rm. 338 is at left.

ROOM NO. 337

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 459

ROOM NO: 338 LAST KNOWN USE: Shower Room SQUARE FEET: 140 s.f CEILING HEIGHT: 11'-11" DATE: 7 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	X Tile Vinyl Linoleum Other:	X Good Fair Poor Destroyed	1900-1906 X 1907-1923 1924-Present In Question	Hex. 1'1/4"
BASE:	Wood X Tile X Tile Wainscot Other:	Good X Fair Poor Destroyed	1900-1906 X 1907-1923 X 1924-Present In Question	84" h. on s., e., + w. walls red tile base on n. wall, 6" h.
WALLS:	X Plaster Gypsum Board Glazed Wood Partitions Other:	Good X Fair Poor Destroyed	X 1900-1906 X 1907-1923 X 1924-Present In Question	
CEILING:	X Plaster Acoustic panels Cove Other:	Good Fair Poor X Destroyed	1900-1906 1907-1923 X 1924-Present In Question	
DOORS/ OPENINGS:	Wood Glass Panelled Wood Veneer Galvanized Metal X Other: Pivotal Windows	Good X Fair Poor Destroyed	X 1900-1906 1907-1923 1924-Present In Question	Windows open onto balcony Glass broken in one light.
LIGHTING:	X Incandescent Fluorescent Missing Other:	Good Fair Poor X Destroyed	Pre-1924 Post-1924 In Question	
HEATING/ VENTILATION PLUMBING:	Radiators Vents Fans X Fixtures Other:	Good Fair Poor Destroyed	1900-1906 X 1907-1923 X 1924-Present In Question	2 shower stalls 2 pedestal sinks
MISCELLANEOUS:		Good Fair Poor Destroyed	1900-1906 1907-1923 1924-Present In Question	
SUMMARY:	○ ○ ○ ○	**Good** X **Fair** **Poor**	**1900-1906** **1907-1923** X **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** Most / Some / X Minor

PHOTOGRAPHS: (1) View southwest

ROOM NO. 338

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 461

ROOM NO: 338A LAST KNOWN USE: Toilet SQUARE FEET: 32 s.f. CEILING HEIGHT: 11'-11" DATE: 7 Sept 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 1'1/4". Floor slopes to drain.
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	84" h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Half totally destroyed.
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Glazed door. Transom
LIGHTING.	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [X] Fixtures [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Toilet
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY: ( ) E ( ) R ( ) W ( ) C

[ ] Good
[X] Fair
[X] Poor

[ ] 1900-1906
[X] 1907-1923
[ ] 1924-Present

ARCHITECTURAL SIGNIFICANCE:

[ ] Most
[ ] Some
[X] Minor

PHOTOGRAPHS: (1) East wall

ROOM NO. 338A

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 463

ROOM NO: 339, 339A LAST KNOWN USE Dormitory I SQUARE FEET 556 sf CEILING HEIGHT 13'-5½"; 11'-9" DATE 9 Sept. 1983

	FINISHES	CONDITION	DATE	NOTES
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 1'1/4" Floors slope to drain.
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	84" h. Large crack on e. wall of 339A
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Ceiling removed in 339A.
DOORS/ OPENINGS:	[ ] Wood Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Glazed doors Transoms
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [X] Vents Fans [X] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	3 radiators 2 pedestal sinks; toilet; Toilet Paper dispenser 2 vents in ceiling
MISCELLANEOUS:	[ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY:	○ F ○ B ○ W ○ C	[X] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	**ARCHITECTURAL SIGNIFICANCE:**	[X] Most [ ] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: (1) East wall, Rm. 339A (2) View northeast, Rm. 339 **ROOM NO.** 339, 339A

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING

ROOM NO: 340 LAST KNOWN USE: Sink Room SQUARE FEET: 24 s.f. CEILING HEIGHT: 10'-5¼" DATE: 9 Sept. 1983

	FINISHES	CONDITION	DATE	NOTES
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good DEBRIS [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 1'1/4" Floor slopes to drain.
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	84"h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[ ] Plaster [ ] Acoustic panels [ ] Cove [X] Other: Wire mesh	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Mesh is rusted + sagging, bent out of shape.
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Sliding door Transom
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [X] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	1 slopsink
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY: ○ E ○ B ○ W ○ C

[ ] Good [X] Fair [ ] Poor [ ] Destroyed

[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question

ARCHITECTURAL SIGNIFICANCE: [ ] Most [ ] Some [X] Minor

PHOTOGRAPHS: (1) North wall

ROOM NO. 340

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 467

ROOM NO: 341 LAST KNOWN USE: Bathroom SQUARE FEET: 233 25 s f CEILING HEIGHT 10'-5¼" DATE 9 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good DEBRIS [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 1'1/4" Floor slopes to drain.
BASE:	[ ] Wood [ ] Tile [ ] Tile Wainscot [X] Other: None	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
WALLS:	[ ] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [X] Other: Tile	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	
CEILING:	[ ] Plaster [ ] Acoustic panels [ ] Cove [X] Other: Wire mesh	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Glazed door
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents Fans [X] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	3 pedestal sinks; 3 mirrors; paper towel dispensers; urinal; 3 toilets; Rusted metal stalls; toilet paper holders; 2 shower stalls
MISCELLANEOUS:	[ ] [ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY: ○ E ○ B ○ W ○ C

[X] Good [ ] Fair [ ] Poor

[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present

ARCHITECTURAL SIGNIFICANCE: [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) View north

ROOM NO. 341

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 469

ROOM NO: 342 LAST KNOWN USE: Bathroom SQUARE FEET: 228 S.F CEILING HEIGHT: 10'-5¼" DATE: 9 Sept 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good DEBRIS [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 1¼" Floor slopes to drain
BASE:	[ ] Wood [ ] Tile [ ] Tile Wainscot [X] Other: None	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
WALLS:	[ ] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [X] Other: Tile	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	
CEILING:	[ ] Plaster [ ] Acoustic panels [ ] Cove [X] Other: Wire mesh	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Rusted, sagging, debris on top.
DOORS/ OPENINGS:	[X] ~~Wood~~ Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Galvanized metal on exterior of glass panelled door.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [X] Fixtures [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	1 sink 3 aluminum shower stalls 1 mirror
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY: ○ E ○ R ○ W ○ C

[X] Good
[ ] Fair
[ ] Poor

[ ] 1900-1906
[X] 1907-1923
[ ] 1924-Present

ARCHITECTURAL SIGNIFICANCE:

[ ] Most
[ ] Some
[X] Minor

PHOTOGRAPHS: (1) View South

ROOM NO. 342

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 47/

ROOM NO: 343 LAST KNOWN USE: Toilet SQUARE FEET: 245 f CEILING HEIGHT: 10'-5¼" DATE: 9 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 1'1/4" Floor slopes to drain.
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	84"h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[ ] Plaster [ ] Acoustic panels [ ] Cove [X] Other: Wire mesh	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~ Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Transom Original sliding door no longer extant.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	Metal Shade, no globe
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents Fans [X] Fixtures [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Toilet with tank. Toilet Paper holder. Tank chipped at one corner.
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY:	( ) E ( ) P ( ) W ( ) C	[X] Good [ ] Fair [ ] Poor	[X] 1900-1906 [X] 1907-1923 [ ] 1924-Present	**ARCHITECTURAL SIGNIFICANCE:**	[ ] Most [ ] Some [X] Minor

PHOTOGRAPHS: (1)

ROOM NO. 343

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 473

ROOM NO. 344, 344A LAST KNOWN USE Bathroom SQUARE FEET: 218 sf CEILING HEIGHT: 13'-2" DATE 9 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[ ] Good DEBRIS [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 1'1/4"
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	72"h. Lots of small holes from fixtures
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	No door to 344 Wood veneer door to 344A
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Fixtures [ ] Other:	[X] Good [ ] Fair [ ] Poor [X] Destroyed sinks	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	4 toilets; 2 mirrors; wood veneer stalls; marble partitions; sinks; Slop sink in 344A
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY: ( ) E ( ) P ( ) W ( ) C

[ ] Good
[X] Fair
[X] Poor

[ ] 1900-1906
[X] 1907-1923
[ ] 1924-Present

ARCHITECTURAL SIGNIFICANCE:

[ ] Most
[ ] Some
[X] Minor

PHOTOGRAPHS: (1) View southwest, Rm. 344 (2) View north, Rm. 344A ROOM NO. 344, 344A

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 475

ROOM NO. 345, 348 LAST KNOWN USE Law Division SQUARE FEET 250 s f CEILING HEIGHT 13'-2" DATE 9 Sept. 1983

	FINISHES	CONDITION	DATE	NOTES
FLOOR:	[ ] Tile [X] Vinyl [ ] Linoleum [ ] Other:	[ ] Good DEBRIS [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	9" sq's.
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	12.5"h 12" section missing to the left of door to Room 350.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] Wood ~~Glass~~ Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	3 doors Metal louvre in top of door to Rm. 348.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [X] Fair 2 [ ] Poor [X] Destroyed 2	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	3 hanging fixtures, 2 with metal shades, 1 destroyed - Rm. 345; 1 destroyed - Rm. 348 (ceiling mounted)
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents Fans [ ] Fixtures [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ ○ ○ ○	[ ] Good [ ] Fair [X] Poor	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor

PHOTOGRAPHS: (1) View south, Rm. 348 (2) View southeast, Rm. 345 ROOM NO. 345, 348

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 477

ROOM NO 346 LAST KNOWN USE Closet SQUARE FEET: 33 s f CEILING HEIGHT: 13'-2" DATE 9 Sept. 1983

	FINISHES	CONDITION:	DATE:	NOTES
FLOOR:	☐ Tile ☐ Vinyl ☐ Linoleum ☐ Other:	☐ Good DEBRIS ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☒ 1924-Present ☐ In Question	9" Sq's.
BASE:	☒ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☒ 1924-Present ☐ In Question	12.5"h.
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Glazed Wood Partitions ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☒ 1924-Present ☐ In Question	
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other:	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☐ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	
DOORS/ OPENINGS:	☒ Wood ~~Glass~~ Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☒ 1924-Present ☐ In Question	
LIGHTING:	☒ Incandescent ☐ Fluorescent ☐ Missing ☐ Other:	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents Fans ☐ Fixtures ☒ Other: None	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
MISCELLANEOUS:	☒ shelves, clothes rod, hooks	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☒ 1924-Present ☐ In Question	1 shelf collapsed from debris.

SUMMARY:	○ ○ ○ ○	☒ **Good** **Fair** **Poor**	☐ **1900-1906** ☐ **1907-1923** ☒ **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor

PHOTOGRAPHS: (1) View South

ROOM NO. 346

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 479

ROOM NO: 347 LAST KNOWN USE: Passage SQUARE FEET: 44 s.f CEILING HEIGHT: 13'-2" DATE: 9 Sept 1983

	FINISHES	CONDITION	DATE	NOTES
FLOOR:	[ ] Tile [X] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	9" sq's.
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~ Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [X] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Metal Louvre missing in upper portion of veneer door.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Fixtures [X] Other: None	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:	[ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	◯ ◯ ◯ ◯	[X] **Good** [X] **Fair** [ ] **Poor**	[ ] **1900-1906** [X] **1907-1923** [X] **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [ ] Minor

PHOTOGRAPHS: ① Northwest corner

ROOM NO. 347

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING

ROOM NO. 349 LAST KNOWN USE: Passage SQUARE FEET: 455 sf CEILING HEIGHT: 13'-2" DATE: 9 Sept. 1983

	FINISHES	CONDITION	DATE	NOTES
FLOOR:	[ ] Tile [X] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	9" sq's.
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	No door at entry to Rm. 349. Door to Rm. 348 has a metal louvre in upper part. Door to Rm. 347 is missing metal louvre.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Fixtures [X] Other: None	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY: ○ E ○ B ○ W ○ C

[X] Good [X] Fair [ ] Poor

[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present

ARCHITECTURAL SIGNIFICANCE:

[ ] Most [ ] Some [ ] Minor [X] Negligible

PHOTOGRAPHS: (1) View east

ROOM NO. 349

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING

ROOM NO 350 LAST KNOWN USE Law Division SQUARE FEET 508.75 s.f CEILING HEIGHT 13'-2" DATE 9 Sept. 1983

	FINISHES	CONDITION	DATE	NOTES
FLOOR:	☐ Tile ☒ Vinyl ☐ Linoleum ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed DEBRIS	☐ 1900-1906 ☐ 1907-1923 ☒ 1924-Present ☐ In Question	9" sq'r.
BASE:	☒ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☒ 1907-1923 ☒ 1924-Present ☐ In Question	12.5" high sm. area on s. wall missing. E. wall post-dates 1940.
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Glazed Wood Partitions ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☒ 1907-1923 ☒ 1924-Present ☐ In Question	
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other:	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☐ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	
DOORS/ OPENINGS:	☐ Wood Glass Panelled ☒ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☐ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	Inlay 2 doors
LIGHTING:	☒ Incandescent ☐ Fluorescent ☐ Missing ☐ Other:	☐ Good ☒ Fair ☐ Poor ☒ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	3 suspended fixtures with metal shades + globes. 1 destroyed.
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents Fans ☐ Fixtures ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	1 radiator
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
SUMMARY:	○ F ○ B ○ W ○ C	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☐ 1900-1906 ☒ 1907-1923 ☒ 1924-Present ☐ In Question	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS: (1) View southeast (2) View northwest ROOM NO. 350

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING

ROOM NO. 351 LAST KNOWN USE Charwomen's Room SQUARE FEET: 197 s.f. CEILING HEIGHT: 12'-7" DATE 14 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☒ Vinyl ☐ Linoleum ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☒ 1924-Present ☐ In Question	9" sq's.
BASE:	☒ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☒ 1924-Present ☐ In Question	
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Glazed Wood Partitions ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☒ 1924-Present ☐ In Question	Picture molding appears to be missing.
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☒ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☒ 1924-Present ☐ In Question	2 doors, 1 has a metal louvre on top. window on n. wall boarded over.
LIGHTING:	☒ Incandescent ☐ Fluorescent ☐ Missing ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	2 extant suspended globes.
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☒ Vents/Fans ☐ Fixtures ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☒ 1924-Present ☐ In Question	radiator vent on W. wall. series of 5 electric boxes + outlets on W. wall. 1 sink
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	

SUMMARY: ○ I ○ II ○ III ○ C

☒ Good ☐ Fair ☐ Poor

☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present

ARCHITECTURAL SIGNIFICANCE:

☐ Most ☐ Some ☒ Minor

PHOTOGRAPHS: (1) View north

ROOM NO. 351

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 487

ROOM NO: 352 LAST KNOWN USE: Chaumonelle Room SQUARE FEET: 2535 s.f CEILING HEIGHT: 12'-7" DATE: 14 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☒ Vinyl ☐ Linoleum ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☒ 1924-Present ☐ In Question	9" Sq's.
BASE:	☒ Wood ☐ Tile ☐ Tile Wainscot ☐ Other	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☒ 1924 Present ☐ In Question	
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Glazed Wood Partitions ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☒ 1924-Present ☐ In Question	Picture molding 2½' section missing on w. wall. E. + W. walls are post-1935.
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
DOORS/ OPENINGS:	☒ ~~Wood~~ Glass Panelled ☒ Wood Veneer ☐ Galvanized Metal ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☒ 1924-Present ☐ In Question	Transom 2 doors Windows on n. wall boarded over.
LIGHTING:	☒ Incandescent ☐ Fluorescent ☐ Missing ☐ Other:	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents Fans ☐ Fixtures ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	

SUMMARY: ○ F ○ R ○ W ○ C

☒ Good
☐ Fair
☐ Poor
☐ Destroyed

☒ 1900-1906
☐ 1907-1923
☒ 1924-Present
☐ In Question

ARCHITECTURAL SIGNIFICANCE:

☐ Most
☐ Some
☒ Minor
☐ Negligible

PHOTOGRAPHS: ① View north

ROOM NO. 352

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 489

ROOM NO 353 LAST KNOWN USE: Charwomen's Room SQUARE FEET: 276 s f CEILING HEIGHT 12'-7" DATE: 14 Sept. 1983

	FINISHES	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [X] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	9" sq's.
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	W. wall post-dates 1935. Picture molding.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	N+E windows boarded over. Metal louvre in top of door.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[X] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	1 extant globe 1 destroyed globe
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents Fans [ ] Fixtures [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	◯ ◯ ◯ ◯	[X] **Good** [ ] **Fair** [ ] **Poor**	[ ] **1900-1906** [X] **1907-1923** [X] **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor

PHOTOGRAPHS: (1) Northeast corner

ROOM NO. 353

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 491

ROOM NO. 354 LAST KNOWN USE Lavatory SQUARE FEET: 155 s.f. CEILING HEIGHT: 12'-7" DATE: 14 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 1 1/4"
BASE:	[ ] Wood [ ] Tile [ ] Tile Wainscot [X] Other: Marble	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Marble wainscot 6'h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~ Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	Wall pendant - missing fixture.
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [X] Vents/Fans [X] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Slop sink Vents on s. wall
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY:

[X] Good
[ ] Fair

[X] 1900-1906
[ ] 1907-1923

ARCHITECTURAL SIGNIFICANCE

[ ] Most
[ ] Some
[ ] Minor

PHOTOGRAPHS: (1) South wall

ROOM NO. 354

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 493

ROOM NO: 355 LAST KNOWN USE Bathroom SQUARE FEET: 153 s.f. CEILING HEIGHT: 12'-7" DATE 14 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [ ] Vinyl [ ] Linoleum [X] Other: Marble	[X] Good DEBRIS [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	10" sq's.
BASE:	[ ] Wood [ ] Tile [ ] Tile Wainscot [X] Other: Marble	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Marble wainscot 6' h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Transom
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [X] Vents/Fans [X] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	radiator. 2 bathtubs; marble partitions Vent on n. wall
MISCELLANEOUS:	[ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ I ○ II ○ III ○ IV	[ ] Good [X] Fair [ ] Poor	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor

PHOTOGRAPHS: (1) View north

ROOM NO. 355

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 495

ROOM NO 356 LAST KNOWN USE: Dormitory SQUARE FEET: 266 s.f CEILING HEIGHT 12'-7" DATE 14 Sept 1983

	FINISHES	CONDITION	DATE	NOTES
FLOOR:	[ ] Tile [X] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	9" Sq's.
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Picture molding
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~ Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Transom 2 doors
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents Fans [ ] Fixtures [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	◯ ◯ ◯ ◯	[ ] **Good** [X] **Fair** [ ] **Poor**	[X] **1900-1906** [ ] **1907-1923** [ ] **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor

PHOTOGRAPHS: (1) Southwest Corner

ROOM NO. 356

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 497

ROOM NO: 357 LAST KNOWN USE: SQUARE FEET: 275.5 s.f. CEILING HEIGHT: 12'-7" DATE: 14 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [X] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	9" sq. 'r.
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Picture molding.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Transom 2 doors
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	1 suspended shade
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Fixtures [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	2 radiators
MISCELLANEOUS:	[ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY: ○ F ○ B ○ W ○ C

[ ] Good
[X] Fair
[ ] Poor
[ ] Destroyed

[X] 1900-1906
[ ] 1907-1923
[ ] 1924-Present
[ ] In Question

ARCHITECTURAL SIGNIFICANCE:

[ ] Most
[ ] Some
[X] Minor
[ ] Negligible

PHOTOGRAPHS: (1) View southeast

ROOM NO. 357

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING

ROOM NO: 358 LAST KNOWN USE: Bathroom SQUARE FEET: 190 s.f. CEILING HEIGHT: 13'-1½" DATE: 9 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [ ] Vinyl [ ] Linoleum [X] Other: Slate	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Slopes to drain.
BASE:	[ ] Wood [ ] Tile [ ] Tile Wainscot [X] Other: Plaster	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Plaster wainscot w/ fake scoring to a ht. of 87.5".
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [X] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	radiator 3 pedestal sinks; 3 toilets; wood panelled stalls; 1 slop sink; 2 toilet paper holders; 3 toilet seat dispensers
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY: ○ F ○ B ○ W ○ C

[ ] Good
[X] Fair
[ ] Poor
[ ] Destroyed

[ ] 1900-1906
[X] 1907-1923
[ ] 1924-Present
[ ] In Question

ARCHITECTURAL SIGNIFICANCE:

[ ] Most
[ ] Some
[X] Minor
[ ] Negligible

PHOTOGRAPHS: (1) View south (2) Ceiling, northwest corner ROOM NO. 358

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 501

ROOM NO: 359 LAST KNOWN USE: Chinese Division SQUARE FEET: 481.25 s.f. CEILING HEIGHT: 13'-1½" DATE: 9 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [X] Vinyl [ ] Linoleum [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Hole in center of room, 2'x3' 9"sq's.
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	12.5"h. Destroyed on s. wall.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[X] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Inlay on one door (to Rm. 359A) Entry door missing Door to 360 extant.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	3 suspended globes; 1 globe on floor in OK shape 2 ceiling mounted fixtures missing.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY: F ○ B ○ W ○ C ○

[X] Good [X] Fair [ ] Poor [ ] Destroyed

[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question

ARCHITECTURAL SIGNIFICANCE: [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) View south (2) Hole in floor ROOM NO. 359

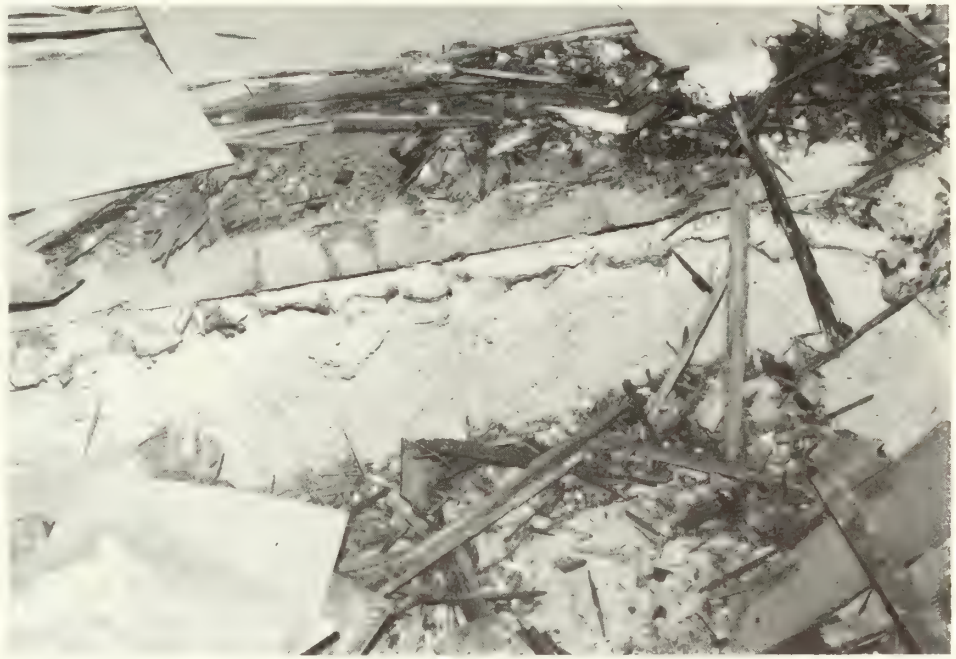

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING

ROOM NO: 359 A LAST KNOWN USE: Lavatory SQUARE FEET: 28 s.f. CEILING HEIGHT: 13'-1½" DATE: 9 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 1'1/4"
BASE:	[ ] Wood [X] Tile [ ] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	13" h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Inlay
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [X] Fixtures [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Pedestal sink Mirror
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY:	○ F ○ B ○ W ○ C	[X] **Good** [ ] **Fair** [ ] **Poor** [ ] **Destroyed**	[ ] **1900-1906** [X] **1907-1923** [ ] **1924-Present** [ ] **In Question**	**ARCHITECTURAL SIGNIFICANCE:**	[ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) View southwest

ROOM NO. 359A

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 505

ROOM NO: 360 LAST KNOWN USE: Chinese Division SQUARE FEET: 440 S.F. CEILING HEIGHT: 13'-1½" DATE: 9 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [X] Vinyl [ ] Linoleum [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	9" sq's.
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	12.5"
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Inlay
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	4 suspended globes
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ F ○ B ○ W ○ C	[X] **Good** **Fair** **Poor** **Destroyed**	[X] **1900-1906** **1907-1923** **1924-Present** **In Question**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) View south

ROOM NO. 360

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 507

ROOM NO: 361 LAST KNOWN USE: Office SQUARE FEET: 508.75 s.f. CEILING HEIGHT: 13'-2" DATE: 9 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☒ Vinyl ☐ Linoleum ☐ Other:	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☒ 1924-Present ☐ In Question	91 sq's.
BASE:	☒ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☐ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	12.5" h. Major areas near window have missing parts or are totally deteriorated.
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Glazed Wood Partitions ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☒ 1907-1923 ☒ 1924-Present ☐ In Question	E. + W. walls post-date 1940.
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	Areas nr. window are destroyed.
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☒ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☐ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	Inlay
LIGHTING:	☒ Incandescent ☐ Fluorescent ☐ Missing ☐ Other:	☒ Good 2 ☒ Fair 2 ☐ Poor ☐ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	4 hanging fixtures - 2 w/ shades + globes; 2 w/ shades/no globes
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents Fans ☐ Fixtures ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	

SUMMARY:	○ ○ ○ ○	**Good** **Fair** **Poor**	**1900-1906** ☒ **1907-1923** ☒ **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:**	☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS: (1) View northwest (2) View southeast ROOM NO. 361

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 509

ROOM NO: 362 LAST KNOWN USE: Closet SQUARE FEET: 12 s.f. CEILING HEIGHT: 13'-2" DATE: 9 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [X] Vinyl [ ] Linoleum [ ] Other:	[ ] Good DEBRIS [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	9"Sq's.
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Rusted electric box on e. wall.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Inlay defines panel. Window on w. wall boarded over 1 lt. missing glass.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Fixtures [X] Other: None	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ F ○ B ○ W ○ C	[ ] **Good** [X] **Fair** [X] **Poor** [ ] **Destroyed**	[ ] **1900-1906** [X] **1907-1923** [ ] **1924-Present** [ ] **In Question**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [ ] Minor [X]

PHOTOGRAPHS: (1) View South

ROOM NO. 362

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 511

ROOM NO: 364 LAST KNOWN USE: Toilet SQUARE FEET: 26 s.f. CEILING HEIGHT: 14'-2" DATE: 14 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	X Tile Vinyl Linoleum Other:	X Good Fair Poor Destroyed	1900-1906 X 1907-1923 1924-Present In Question	Hex. 1'1/4"
BASE:	Wood Tile X Tile Wainscot Other:	X Good Fair Poor Destroyed	1900-1906 X 1907-1923 1924-Present In Question	6'h. 1 lg. crack
WALLS:	X Plaster Gypsum Board Glazed Wood Partitions Other:	Good X Fair Poor Destroyed	1900-1906 X 1907-1923 1924-Present In Question	
CEILING:	X Plaster Acoustic panels Cove Other:	X Good Fair Poor Destroyed	1900-1906 X 1907-1923 1924-Present In Question	
DOORS/ OPENINGS:	Wood/Glass Panelled X Wood Veneer Galvanized Metal Other:	X Good Fair Poor Destroyed	1900-1906 X 1907-1923 1924-Present In Question	Inlay Window on s. wall boarded over.
LIGHTING:	X Incandescent Fluorescent Missing Other:	Good Fair Poor X Destroyed	Pre-1924 Post-1924 In Question	
HEATING/ VENTILATION PLUMBING:	Radiators Vents Fans X Fixtures Other:	X Good Fair Poor Destroyed	1900-1906 X 1907-1923 X 1924-Present In Question	Toilet + tank Sink Glass shelf above sink Toilet paper holder Towel Rack
MISCELLANEOUS:		Good Fair Poor Destroyed	1900-1906 1907-1923 1924-Present In Question	
SUMMARY:	E B W C	X Good Fair Poor Destroyed	1900-1906 X 1907-1923 1924-Present In Question	**ARCHITECTURAL SIGNIFICANCE:** Most / Some / X Minor / Negligible

ROOM NO. 364

PHOTOGRAPHS: (1) View southeast

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING

ROOM NO: 365 LAST KNOWN USE: Chinese Division SQUARE FEET: 440 s.f. CEILING HEIGHT: 13'-2½" DATE: 14 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☒ Vinyl ☐ Linoleum ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☒ 1924-Present ☐ In Question	9" Sq's.
BASE:	☒ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	12.5"h. missing + deteriorated sections on s. wall.
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Glazed Wood Partitions ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	"Recent" graffiti - blue magic marker - near light switch - face.
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☒ Wood Veneer ☐ Galvanized Metal ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	3 doors ; Inlay
LIGHTING:	☒ Incandescent ☐ Fluorescent ☐ Missing ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	4 suspended globes
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents/Fans ☐ Fixtures ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
SUMMARY:	○ F ○ B ○ W ○ C	☐ **Good** ☒ **Fair** ☐ **Poor**	☐ **1900-1906** ☒ **1907-1923** ☐ **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS: (1) View south

ROOM NO. 365

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING

ROOM NO: 366 LAST KNOWN USE: Office SQUARE FEET: 522.5 s.f. CEILING HEIGHT: 13'-2" DATE: 9 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [X] Vinyl [ ] Linoleum [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	9" sq's.
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	12.5" h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood 'Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Inset panel.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [X] Fair 3 [ ] Poor [X] Destroyed 1	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	4 suspended fixtures 3 with shades/no globes 1 wire w/no shade or globe
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents Fans [ ] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	◯ ◯ ◯ ◯ E E W S	[X] Good [ ] Fair [ ] Poor	[X] 1900-1906 [X] 1907-1923 [X] 1924-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) View southeast (2) View northwest ROOM NO. 366

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 517

ROOM NO: 367 LAST KNOWN USE: Detention SQUARE FEET: 161 s.f. CEILING HEIGHT: 13'-3" DATE: 13 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [X] Vinyl [ ] Linoleum [ ] Other:	[ ] Good DEBRIS [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	9" sq's.
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	12.5" h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	Good condition except for the sw corner where material has recently been removed for a drain pipe.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Metal louvre in top Window on w. wall to light court boarded over.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	2 suspended globes.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ E ○ B ○ W ○ C	[X] **Good** **Fair** **Poor**	[X] **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) View southwest

ROOM NO. 36

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 519

ROOM NO: 368 LAST KNOWN USE: Detention SQUARE FEET: 210 s.f. CEILING HEIGHT: 13'-3" DATE: 13 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [X] Vinyl [ ] Linoleum [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	9 "sq's.
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Metal louvre in top. Window on W. wall, to light court, boarded over.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	2 suspended globes
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents Fans [ ] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ ○ ○ ○	[X] **Good** [ ] **Fair** [ ] **Poor**	[ ] **1900-1906** [ ] **1907-1923** [X] **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor

PHOTOGRAPHS: (1) Southwest corner

ROOM NO. 368

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 521

ROOM NO: 369 LAST KNOWN USE: Closet SQUARE FEET: 98 s.f. CEILING HEIGHT: 13'-3" DATE: 13 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☒ Linoleum ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☒ 1924-Present ☐ In Question	
BASE:	☒ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☒ 1907-1923 ☒ 1924-Present ☐ In Question	
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Glazed Wood Partitions ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☒ 1907-1923 ☒ 1924-Present ☐ In Question	
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☒ Wood Veneer ☐ Galvanized Metal ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☒ 1924-Present ☐ In Question	
LIGHTING:	☒ Incandescent ☐ Fluorescent ☐ Missing ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	Suspended globe
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents/Fans ☐ Fixtures ☒ Other: None	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
MISCELLANEOUS:	☒ Wood shelves	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☒ 1924-Present ☐ In Question	

SUMMARY:	○ ○ ○ ○	☒ **Good** ☐ **Fair** ☐ **Poor**	☐ **1900-1906** ☐ **1907-1923** ☒ **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:**	☐ **Most** ☐ **Some** ☒ **Minor**

PHOTOGRAPHS: (1) View west

ROOM NO. 3

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 523

ROOM NO: 370 LAST KNOWN USE: Detention SQUARE FEET: 259 s.f. CEILING HEIGHT: 13'-3" DATE: 13 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [X] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	9" sq's.
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	small sec. removed in sw. corner for drain pipe.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood 'Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Metal louvre, rusted in top of door. Window on w. wall boarded over.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[X] Good 3 [ ] Fair [ ] Poor [X] Destroyed 1	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	3 suspended globes intact. 1 " globe missing.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents Fans [ ] Fixtures [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	◯ ◯ ◯ ◯	[X] **Good** **Fair** **Poor** **Destroyed**	[ ] **1900-1906** [ ] **1907-1923** [X] **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** [ ] **Most** [ ] **Some** [X] **Minor**

PHOTOGRAPHS: (1) Southwest Corner

ROOM NO. 370

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 525

ROOM NO: 371 LAST KNOWN USE: Detention SQUARE FEET: 266 s.f. CEILING HEIGHT: 13'-3" DATE: 13 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☒ Vinyl ☐ Linoleum ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☒ 1924-Present ☐ In Question	9" sq's. S.E. quadrant is sinking (deteriorated floor below?)
BASE:	☒ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☒ 1907-1923 ☒ 1924-Present ☐ In Question	
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Glazed Wood Partitions ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☒ 1907-1923 ☒ 1924-Present ☐ In Question	
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☒ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☒ 1924-Present ☐ In Question	Metal louvre in top of door (rusted). Missing hardware. Window on W. wall boarded over.
LIGHTING:	☒ Incandescent ☐ Fluorescent ☐ Missing ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents Fans ☐ Fixtures ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☒ 1907-1923 ☐ 1924-Present ☐ In Question	
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
SUMMARY:	○ ○ ○ ○	☒ **Good** ☐ **Fair** ☐ **Poor**	☐ **1900-1906** ☐ **1907-1923** ☒ **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor

PHOTOGRAPHS: (1) View northwest

ROOM NO. 371

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 527

ROOM NO: 372 LAST KNOWN USE: Chinese Division SQUARE FEET: 550 s.f. CEILING HEIGHT: 13'-3" DATE: 9 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [X] Vinyl [ ] Linoleum [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	9" sq's.
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	12.5" h. Missing + deteriorated sections on s. wall.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Electric box on wall next to door - 6.5" x 16".
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	3 doors Inlay.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[X] Good 1 [X] Fair 2 [ ] Poor [X] Destroyed 1	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:	[ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ ○ ○ ○	[X] **Good** **Fair** **Poor**	[X] **1900-1906** **1907-1923** **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) View southeast

ROOM NO. 372

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 529

ROOM NO: 373 LAST KNOWN USE: Office SQUARE FEET: 536.25 s.f. CEILING HEIGHT: 13'-2" DATE: 9 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [X] Vinyl [ ] Linoleum [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed DEBRIS	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	9" sq's.
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	12.5" h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Inlay
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[X] Good 3 [ ] Fair [ ] Poor [X] Destroyed 3	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	3 suspended fixtures w/ globes. 3 suspended fixtures missing.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	2 radiators
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY:	○ E ○ B ○ W ○ C	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	**ARCHITECTURAL SIGNIFICANCE:**	[X] Most [ ] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: (1) View northeast

ROOM NO. 373

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 531

ROOM NO: 374 LAST KNOWN USE: Detention SQUARE FEET: 192 s.f. CEILING HEIGHT: 13'-3" DATE: 9 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	9"sq's.
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	12.5" h. Deteriorated near window.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	2 doors Metal louvre in top of entry door missing.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ ○ ○ ○	[ ] **Good** [X] **Fair** [ ] **Poor**	[ ] **1900-1906** [ ] **1907-1923** [X] **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) View west (2) Ceiling, view east ROOM NO. 374

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 533

ROOM NO: 375 LAST KNOWN USE: Detention SQUARE FEET: 256 s.f. CEILING HEIGHT: 13'-3" DATE: 9 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [X] Vinyl [ ] Linoleum [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	9" Sq's.
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	12-5" h. Destroyed in s.w. corner.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	Destroyed in SW corner.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	2 doors Entry door has a rusted metal louvre.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[X] Good 1 [ ] Fair [ ] Poor [X] Destroyed 1	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	1 suspended fixture w/ globe. 1 " " missing.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY: ○ F ○ B ○ W ○ C

[X] Good
[ ] Fair
[ ] Poor
[ ] Destroyed

[ ] 1900-1906
[ ] 1907-1923
[X] 1924-Present
[ ] In Question

ARCHITECTURAL SIGNIFICANCE:

[ ] Most
[ ] Some
[X] Minor
[ ] Negligible

PHOTOGRAPHS: (1) South wall (2) Ceiling, southeast corner ROOM NO. 375

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING

ROOM NO: 376 LAST KNOWN USE: Detention SQUARE FEET: 256 s.f. CEILING HEIGHT: 13'-2" DATE: 9 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [X] Vinyl [ ] Linoleum [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	9" sq's. Hole in floor, s. end.
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	12.5"h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	Pencil doodle (architectural subject?) - looks recent.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Metal louvre in top of door missing.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	2 suspended globes
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ ○ ○ ○	[ ] **Good** [ ] **Fair** [X] **Poor**	[ ] **1900-1906** [ ] **1907-1923** [X] **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor

PHOTOGRAPHS: (1) Northeast corner (2) Ceiling, east end ROOM NO. 376

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 537

ROOM NO: 377 LAST KNOWN USE: Detention SQUARE FEET: 256 s.f. CEILING HEIGHT: 13'-2" DATE: 13 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [X] Vinyl [ ] Linoleum [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	9" sq's.
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Metal louvre in top of door is rusted. hardware missing.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	Globes extanton hanging fixtures.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	2 radiators
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	◯ ◯ ◯ ◯	[X] **Good** [ ] **Fair** [ ] **Poor**	[ ] **1900-1906** [ ] **1907-1923** [X] **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor

PHOTOGRAPHS: (1) Southeast corner (2) Ceiling, view east ROOM NO. 377

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 539

ROOM NO: 378 LAST KNOWN USE: Detention SQUARE FEET: 248 s.f. CEILING HEIGHT: 13'-1½" DATE: 13 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [X] Vinyl [ ] Linoleum [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	9" sq's.
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	12.5"h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Metal louvre in top of door is rusted.
LIGHTING:	[ ] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[X] Good 1 [ ] Fair [X] Poor 1 [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	1 suspended fixture with globe intact 1 suspended fixture with broken globe.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents Fans [ ] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY:			**ARCHITECTURAL SIGNIFICANCE:**
		[ ] Good	[ ] Most
		[ ] Fair	[ ] Some
		[X] Poor	[X] Minor
			[ ] Destroyed
		[ ] Destroyed	
			[ ] In Question
			[ ] Intact
			[ ] Altered
			[ ] Destroyed
			[ ] In Question

PHOTOGRAPHS: (1) Southeast corner (2) Ceiling, view east ROOM NO. 378

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 541

ROOM NO: 379 LAST KNOWN USE: Detention SQUARE FEET: 240 s.f. CEILING HEIGHT: 13'-1" DATE: 13 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [X] Vinyl [ ] Linoleum [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	9" Sq's. Deep hole near n.e. corner.
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	Sml. section of e. wall is very deteriorated.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Entry door has metal louvre on top. 2 doors
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[X] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	1 suspended globe intact 1 suspended fixture destroyed.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ ○ ○ ○ F B W C	[ ] Good [ ] Fair [X] Poor	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) View southeast (2) Lintel over window (3) Ceiling ROOM NO. 379

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 543

ROOM NO: 380 LAST KNOWN USE: SQUARE FEET: 192 s.f. CEILING HEIGHT: 13'-1" DATE: 13 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [X] Vinyl [ ] Linoleum [ ] Other:	[ ] Good [ ] Fair [X] Poor (DEBRIS) [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	9" Sq's.
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	12.5"h. Deteriorated + falling off one wall.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	2 doors Entry door has metal louvre on top.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	Fixture destroyed
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents Fans [ ] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	◯ ◯ ◯ ◯	[ ] **Good** [X] **Fair** [ ] **Poor**	[ ] **1900-1906** [X] **1907-1923** [X] **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor

PHOTOGRAPHS: (1) Northeast corner (2) Ceiling, view east ROOM NO. 380

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 545

ROOM NO: 381 LAST KNOWN USE: Chinese Division SQUARE FEET: 490.5 s.f. CEILING HEIGHT: 13'-3" DATE: 13 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [X] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	9" sq's.
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	12-5"
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	Picture moulding on all walls except missing on s. wall.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Inlay
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[X] Good 1 [ ] Fair [ ] Poor [X] Destroyed 3	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	4 suspended fixtures - 3 are missing globes, 1 w/ extant globe.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	2 radiators
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	

SUMMARY:					**Good** [X] **Fair** **Poor**	[X] **1900-1906** [X] **1907-1923** **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:**	[X] Most Some Minor Negligible
	E	N	W	S				

PHOTOGRAPHS: (1) View southeast (2) View northwest ROOM NO. 381

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING

ROOM NO: 381A LAST KNOWN USE: Toilet SQUARE FEET: 56 s.f. CEILING HEIGHT: 13'-3" DATE: 13 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Hex. 1'/4".
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Inlay. Door chipped at lower corner. Marble surround.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents Fans [X] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Radiator Toilet; sink; toilet paper holder; towel rack.
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	◯ ◯ ◯ ◯	[X] **Good** **Fair** **Poor**	[ ] **1900-1906** [ ] **1907-1923** [X] **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor

PHOTOGRAPHS: (1) View north

ROOM NO. 381A

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 549

ROOM NO: H 301 LAST KNOWN USE: Passage SQUARE FEET: 44 s.f. CEILING HEIGHT: 15'-5½" DATE: 30 Aug. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 1'1/4"
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	7'h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] Wood/~~Glass~~ Panelled [ ] Wood Veneer [X] Galvanized Metal [X] Other: Missing	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	No. "18 E" on metal door. - Graffiti, 1913 date. Door to Rm. 304 is missing.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Fixtures [X] Other: None	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ ○ ○ ○ E B W S	[X] **Good** [ ] **Fair** [ ] **Poor**	[X] **1900-1906** [X] **1907-1923** [ ] **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor

PHOTOGRAPHS: (1) View south

ROOM NO. H301

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 551

ROOM NO: H303, S17 LAST KNOWN USE: Passage; Stair SQUARE FEET: 240 S.F. CEILING HEIGHT: 13'-5½" DATE: 30 Aug. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 2".
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	7'h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Stairs lead to large double glass-panelled doors. Galv. metal door - No. "18C" - Graffiti
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:	[X] Marble stairs	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	5 steps Crack in one riser.
SUMMARY:	◯ ◯ ◯ ◯	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor

PHOTOGRAPHS: (1) View east

ROOM NO. H 303

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 553

ROOM NO: H304 LAST KNOWN USE: Passage SQUARE FEET: 272.5 s.f. CEILING HEIGHT: 12'-7½" DATE: 30 Aug. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☐ Linoleum ☒ Other: Wood	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
BASE:	☒ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	10.5"h.
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Glazed Wood Partitions ☒ Other: Wood Panelling	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	N. wall of larger space of H304 has vertical wood panelling with cornice molding at 92". Picture molding missing. Wood panel with hooks, 7" x 32" on S. wall.
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
DOORS/ OPENINGS:	☒ Wood/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
LIGHTING:	☒ Incandescent ☐ Fluorescent ☐ Missing ☐ Other:	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents Fans ☐ Fixtures ☒ Other: None	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
SUMMARY:	○ ○ ○ ○	☒ **Good** ☐ **Fair** ☐ **Poor** ☐ Destroyed	☒ **1900-1906** ☐ **1907-1923** ☐ **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor

PHOTOGRAPHS: (1) View west (2) View west, west end ROOM NO. H304

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 555

ROOM NO: H305 LAST KNOWN USE: Passage SQUARE FEET: 40.5 s.f. CEILING HEIGHT: 12'-7½" DATE: 30 Aug. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☐ Linoleum ☒ Other: Wood	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
BASE:	☒ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	10.5" h.
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Glazed Wood Partitions ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	Metal plate at lower corner of e. wall.
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
DOORS/ OPENINGS:	☒ Wood ~~/Glass~~ Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
LIGHTING:	☒ Incandescent ☐ Fluorescent ☐ Missing ☐ Other:	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☒ Vents Fans ☐ Fixtures ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	4'x 1.5' vent on e. wall.
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
SUMMARY:	◯ ◯ ◯ ◯	☒ **Good** ☐ **Fair** ☐ **Poor** ☐ Destroyed	☒ **1900-1906** ☐ **1907-1923** ☐ **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☐ Minor

PHOTOGRAPHS: (1) East wall

ROOM NO. H305

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 557

ROOM NO: H306 LAST KNOWN USE: Passage SQUARE FEET: 51.75 s.f. CEILING HEIGHT: 12'-7½" DATE: 1 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile ☐ Vinyl ☐ Linoleum ☒ Other: Wood	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
BASE:	☒ Wood ☐ Tile ☐ Tile Wainscot ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	10.5" h.
WALLS:	☒ Plaster ☐ Gypsum Board ☐ Glazed Wood Partitions ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
DOORS/ OPENINGS:	☒ ~~Wood~~/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
LIGHTING:	☒ Incandescent ☐ Fluorescent ☐ Missing ☐ Other:	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☐ Pre-1924 ☐ Post-1924 ☐ In Question	
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents Fans ☐ Fixtures ☒ Other: None	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1906 ☐ 1907-1923 ☐ 1924-Present ☐ In Question	
SUMMARY:	○ ○ ○ ○	☒ **Good** ☐ **Fair** ☐ **Poor**	☒ **1900-1906** ☐ **1907-1923** ☐ **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☐ Minor

PHOTOGRAPHS: (1) View South

ROOM NO. H306

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 557

ROOM NO: H307, S18 LAST KNOWN USE: Passage, Stair SQUARE FEET: 1275 s.f. CEILING HEIGHT: 13'-5½" DATE: 1 Sept 1983

	FINISHES	CONDITION	DATE	NOTES
FLOOR:	X Tile	X Good	1900-1906	11" x 2"
	Vinyl	Fair	X 1907-1923	
	Linoleum	Poor	1924-Present	
	Other	Destroyed	In Question	
BASE:	Wood	X Good	1900-1906	7'h.
	Tile	Fair	X 1907-1923	
	X Tile Wainscot	Poor	1924-Present	
	Other	Destroyed	In Question	
WALLS:	X Plaster	Good	1900-1906	
	Gypsum Board	Fair	X 1907-1923	
	Glazed Wood Partitions	X Poor	1924-Present	
	Other	Destroyed	In Question	
CEILING:	X Plaster	Good	1900-1906	
	Acoustic panels	Fair	X 1907-1923	
	Cove	Poor	1924-Present	
	Other	X Destroyed	In Question	
DOORS/ OPENINGS:	Wood Glass Panelled	Good	1900-1906	Transom
	Wood Veneer	Fair	1907-1923	
	Galvanized Metal	Poor	1924-Present	
	X Other Missing	Destroyed	In Question	
LIGHTING:	X Incandescent	Good	Pre 1924	
	Fluorescent	Fair	Post 1924	
	Missing	Poor	In Question	
	Other	X Destroyed		
HEATING/ VENTILATION PLUMBING:	Radiators	X Good	1900-1906	Boxes located on n. wall - recent.
	Vents Fans	Fair	1907-1923	
	Fixtures	Poor	X 1924-Present	
	X Other Electric boxes	Destroyed	In Question	
MISCELLANEOUS:		Good	1900-1906	
		Fair	1907-1923	
		Poor	1924-Present	
		Destroyed	In Question	

SUMMARY:				**ARCHITECTURAL SIGNIFICANCE:**	
	○ ○ ○ ○	Good	1900-1906		Most
		Fair	X 1907-1923		Some
		X Poor	1924-Present	X	Minor
		Destroyed	In Question		

PHOTOGRAPHS: (1) East wall and Stair (2) Original ROOM NO. H307, S18

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 561

ROOM NO: H308, S19 LAST KNOWN USE: Passage; Stairs SQUARE FEET: 141 s.f. CEILING HEIGHT: 13'-4 1/4" DATE: 1 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 2".
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	7'h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Electrical box on W. wall.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Stairs lead to large double doors.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents Fans [ ] Fixtures [X] Other: Electric box	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [X] In Question	Electrical box on W. wall.
MISCELLANEOUS:	[X] Marble stairs [X] Wood railing	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	5 steps: chipped edges, top step badly cracked. Wood railings - broken post on S. wall

SUMMARY:	○ F ○ B ○ W ○ C	[ ] Good [X] Fair [ ] Poor	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor

PHOTOGRAPHS: (1) View southeast (2) West wall ROOM NO. H308, S19

ROOM NO: H309 LAST KNOWN USE: Passage SQUARE FEET: 1,833.5 s.f. CEILING HEIGHT: 10'-10" DATE: 9/14/83

DESCRIPTION:

General: Hallway extends between Stair 01 to Stair 02 on the third floor balcony overlooking the Registry Room.

Floor: Hexagonal 1¼" ceramic tile. Tiled 1908.

Base: Tile wainscot (4') on west wall and north & south ends of east wall. Tiled 1908

Walls: Plaster over terracotta block (1900) walls along Rooms 320 & 321 are crowned by an entablature. (1908). Inset segmental arches frame end sections of hall. Gypsum board partitions in wood frames with small entablatures were installed on the east side of the hall in 1937. A fire extinguisher and remnants of an electric box are located on the walls. Pipes along walls at north and south ends.

Ceiling: Plaster at north and south end sections of hall.

CONDITION:

General: Originally the hall was the west balcony of the Registry Room. Rooms 321 & 322 were added on the west side of the hall in 1908. The stairs were originally entered through arched openings which have subsequently been filled in with plaster & doors.

The addition of partitions in 1937 obscured the visibility between the balcony and the Registry Room. However, the Guastavino tile ceiling and end walls with their large arched windows are still visible.

Floor: Fair condition, some cracks; past repairs are very noticeable.

Base: Wainscot is generally in good condition. A small number of tiles are missing in a few areas.

Walls: Plaster walls are in fair condition. Brick is exposed at the northwest corner. Gypsum board walls are in poor condition with several large holes.

Ceiling: Plaster is generally in good condition. However, small areas of the ceiling are open at the southwest and northwest corners.

(Continued)

SUMMARY: ( ) ( ) ( ) ( )

	Good
X	Fair
	Poor
	Destroyed

X	1900-1906
X	1907-1923
X	1924-Present

ARCHITECTURAL SIGNIFICANCE:

X	Most
	Some
	Minor

PHOTOGRAPHS: 1. View north 2. View south **ROOM NO.** H 309

ROOM NO: H309 LAST KNOWN USE: SQUARE FEET: 1,833.5 s.f. CEILING HEIGHT: DATE: 9/14/83
Continued

DESCRIPTION:

Doors/
Openings: Wood & glass panelled doors.

Lighting: Original fixtures destroyed. Fixtures with metal shades suspended off of pipes have been installed recently.

CONDITION:

Doors/
Openings: Fair condition.

SUMMARY:	○ ○ ○ ○		Good	X	1900-1906	ARCHITECTURAL SIGNIFICANCE:	X	Most
		X	Fair	X	1907-1923			Some
			Poor	X	1924-Present			Minor
								Negligible

PHOTOGRAPHS:

ROOM NO.

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 567

ROOM NO: H 310 LAST KNOWN USE: Passage SQUARE FEET: 66.5 s.f. CEILING HEIGHT: 11'-0½" DATE: 7 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 1'1/4"
BASE:	[ ] Wood [X] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	83"h. wainscot on n, s, + w walls. 5.5"h. base on e. wall.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Glazed on upper portion of doors. Transoms Dbl. doors; 2 single doors.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents Fans [ ] Fixtures [X] Other: None	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ ○ ○ ○	[X] **Good** [ ] **Fair** [ ] **Poor**	[ ] **1900-1906** [ ] **1907-1923** [X] **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [ ] Minor [X] Negligible

PHOTOGRAPHS: ① View east

ROOM NO. H310

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 569

ROOM NO: H 311 LAST KNOWN USE: Passage SQUARE FEET: 70 s.f. CEILING HEIGHT: DATE: 7 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[ ] Good DEBRIS [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 1'1/4"
BASE:	[ ] Wood [X] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	84" h. wainscot on n. + s. walls 5.5" h. tile base on e. wall.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Doors are glazed. - Dbl. doors; 2 single doors Transoms
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents Fans [ ] Fixtures [ ] Other: Pipes	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	Pipes along ceiling
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ ○ ○ ○	[ ] **Good** [X] **Fair** [ ] **Poor**	[X] **1900-1906** [ ] **1907-1923** [ ] **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [ ] Minor [X] Negligible

PHOTOGRAPHS: (1) View east

ROOM NO. H311

ROOM NO: H312 LAST KNOWN USE: Passage SQUARE FEET: 614 s.f. CEILING HEIGHT: DATE: 7 Sept. 1983

DESCRIPTION:

General: North balcony overlooking the Registry Room.

Floor: Hexagonal 1¼" ceramic tile. Tiled 1908.

Base: Tile wainscot to a height of 4' on the north wall. Tiled 1908.

Walls: Plaster over terracotta blocks with an entablature at spring of the vault.

Ceiling: Guastavino vault.

Doors/
Openings: Galvanized metal doors, glazed on the upper half. Transom door surrounds are marble on the lower half and metal on the upper half. Pivotal windows that open onto balcony from dormitory rooms. Window surrounds are metal.

Misc: Wrought iron railings and wood handrails.

CONDITION:

Floor: Fair condition. Some large cracks; tiles are missing in a couple of small areas; noticeable where tile has been replaced.

Base: Fair condition. Some tile missing in small areas; noticeable where tile has been replaced and where tile was cut for new doorways.

Walls: Poor condition; some of the earlier Caen Stone (1918) is exposed where the later plaster is destroyed. Some sections of wall and entablature have been removed for structural investigations.

Ceiling: Good condition.

Doors/
Openings: Doors are in fair condition. Some windows have broken glass.

Misc: Good condition.

SUMMARY:	○ ○ ○ ○	[ ] Good [X] Fair [ ] Poor	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present	ARCHITECTURAL SIGNIFICANCE:	[X] Most [ ] Some [ ] Minor

PHOTOGRAPHS: 1. View northwest 2. View northwest 3. Artificial Caen stone **ROOM NO.** H312

ROOM NO: H313 LAST KNOWN USE: Passage SQUARE FEET: 614 s.f. CEILING HEIGHT: DATE: 7 Sept. 1983

DESCRIPTION:

General: South balcony overlooking the Registry Room.

Floor: Hexagonal 1¼" ceramic tile. Tiled 1908.

Base: Tile wainscot to a height of 4' on the south wall. Tiled 1908.

Walls: Plaster over terracotta blocks with entablature at spring of vault.

Ceiling: Guastavino vault.

Doors/
Openings: Galvanized metal doors, glazed on the upper half. Transom door surrounds are marble on the lower half and metal on the upper half. Pivotal windows that open onto balcony from dormitory rooms. Window surrounds are metal.

Misc: Wrought iron railings & wood handrails.

CONDITION:

Floor: Fair condition. Some large cracks; tiles are missing in a few small areas; noticeable where tile has been replaced.

Base: Fair condition. Some tile missing in small areas; noticeable where tile has been replaced and where tile was cut for new doorways.

Walls: Poor condition. Some of the earlier Caen Stone (1918) is exposed where the later plaster is destroyed. Some sections of wall and entablature have been removed for structural investigation.

Ceiling: Good condition.

Doors/
Openings: Doors are in fair condition. Some windows have broken glass.

Misc: Good condition.

SUMMARY:	○ ○ ○ ○	[ ] Good [X] Fair [ ] Poor	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present	ARCHITECTURAL SIGNIFICANCE:	[X] Most [ ] Some [ ] Minor

PHOTOGRAPHS: 1. View southwest 2. View southwest **ROOM NO.** H313

ROOM NO: H314 LAST KNOWN USE: Passage SQUARE FEET: 1,817.5 s.f. CEILING HEIGHT: 10'-11½" DATE: 14 Sept. 1983

DESCRIPTION:

General: Hallway extends between Stair 03 and Stair 04 on third floor balcony overlooking the Registry Room.

Floor: Hexagonal 1¼" ceramic tile. Tiled 1908.

Base: Tile wainscot (4') on east wall and north and south ends of west wall. Tiled 1908.

Walls: Plaster over terracotta block (1900). Walls along Rooms 341 and 342 are crowned by an entablature (1908). Inset segmental arches frame end sections of hall. Gypsum board partitions in wood frames with a small entablature.

CONDITION:

General: Originally the hall was the east balcony of the Registry Room. Rooms 341 and 342 were added on the east side of the hall in 1908. The stairs were originally entered through arched openings which have subsequently been filled in with plaster and doors. The dropped ceilings at the north and south ends are lower than they were when the arches were extant. The addition of partitions in 1937obscured the visibility between the balcony and the Registry Room. However, the Guastavino tile ceiling and end walls with their large arched windows are still visible.

Floor: Fair condition. Large cracks. Past repairs and retiling are noticeable.

Base: Good condition.

Walls: Plaster is in fair condition. Northeast and southeast corners stripped to brick. A section of wall at the north end of the hall has been opened for a pipe. The gypsum board partitions are in poor condition with numerous large holes. The gypsum board at the south end of the west wall is entirely missing.

(continued)

SUMMARY:	○ ○ ○ ○	[ ] Good [X] Fair [ ] Poor	[X] 1900-1906 [X] 1907-1923 [X] 1924-Present	ARCHITECTURAL SIGNIFICANCE:	[X] Most [ ] Some [ ] Minor

PHOTOGRAPHS: 1. View north 2. View south **ROOM NO.** H314

ROOM NO: H314 LAST KNOWN USE: Passage SQUARE FEET: 1,817.5 s.f. CEILING HEIGHT: DATE: 14 Sept. 1983
Continued

DESCRIPTION:

Ceiling: Plaster at north and south end sections of hall. The middle section of the hall is open to the Guastavino ceiling.

Doors/ Openings: Wood and glass panelled doors; wood veneer doors; galvanized metal doors; transoms.

Lighting: Original fixtures destroyed.

Misc.: Metal partitions at doorways to Rooms 341 and 342.

CONDITION:

Ceiling: Plaster is generally in good condition. Open at northeast and southeast corners.

Doors/ Openings: Fair condition.

Misc.: Rusted.

SUMMARY:

E ○ B ○ W ○ C ○

	Good
X	Fair
	Poor
	Destroyed

X	1900-1906
X	1907-1923
X	1924-Present
	In Question

ARCHITECTURAL SIGNIFICANCE:

X	Most
	Some
	Minor
	Negligible

PHOTOGRAPHS:

ROOM NO.

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING

ROOM NO: H 315, S20 LAST KNOWN USE: Passage, Stairs SQUARE FEET: 477.25 s.f. CEILING HEIGHT: 13'-2" DATE: 9 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 1¼".
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	58"h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Terra cotta block exposed in one area - 104" x 65". Electrical boxes on n. wall - rusted.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Lath work exposed at W. end + in middle of S. wall.
DOORS/ OPENINGS:	[X] ~~Wood~~ Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Transoms Windows on S. wall boarded over - sash + glass missing.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents Fans [ ] Fixtures [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	2 radiators
MISCELLANEOUS:	[X] Marble stairs	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	5 steps

SUMMARY:			
	[X] **Good** [ ] **Fair** [ ] **Poor**	[ ] **1900-1906** [X] **1907-1923** [ ] **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** [X] Most [ ] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: (1) View west

ROOM NO. H315, S20

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 581

ROOM NO: H316 LAST KNOWN USE: Passage SQUARE FEET: 266 s.f. CEILING HEIGHT: 12'-7½" DATE: 14 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 1'1/4".
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	5'h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Transoms
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents Fans [ ] Fixtures [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:	[ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ E ○ B ○ W ○ C	[X] **Good** [ ] **Fair** [ ] **Poor** [ ] **Destroyed**	[X] **1900-1906** [ ] **1907-1923** [ ] **1924-Present** [ ] **In Question**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: ① View west

ROOM NO. H316

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 583

ROOM NO: H317, S21 LAST KNOWN USE: Passage Stairs SQUARE FEET: 477.25 s.f. CEILING HEIGHT: 13'-2" DATE: 14 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile [ ] Vinyl [ ] Linoleum [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Hex. 1 1/4" Hole in floor in front of Rm. 360.
BASE:	[ ] Wood [ ] Tile [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	58" h. Good condition except for section in middle of wall removed for drain pipe.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[X] Good Wood Veneer [ ] Fair [X] Poor Glass panelled [X] Destroyed Door to Rm. 359	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Transoms
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Fixtures [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	2 radiators
MISCELLANEOUS:	[X] Marble stairs	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	5 steps
SUMMARY:	○ ○ ○ ○	[X] **Good** **Fair** **Poor**	[X] **1900-1906** **1907-1923** **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** [X] Most [ ] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: (1) View east (2) View west (3) Hole in tile floor, entrance to Rm. 360 ROOM NO. H317, S21

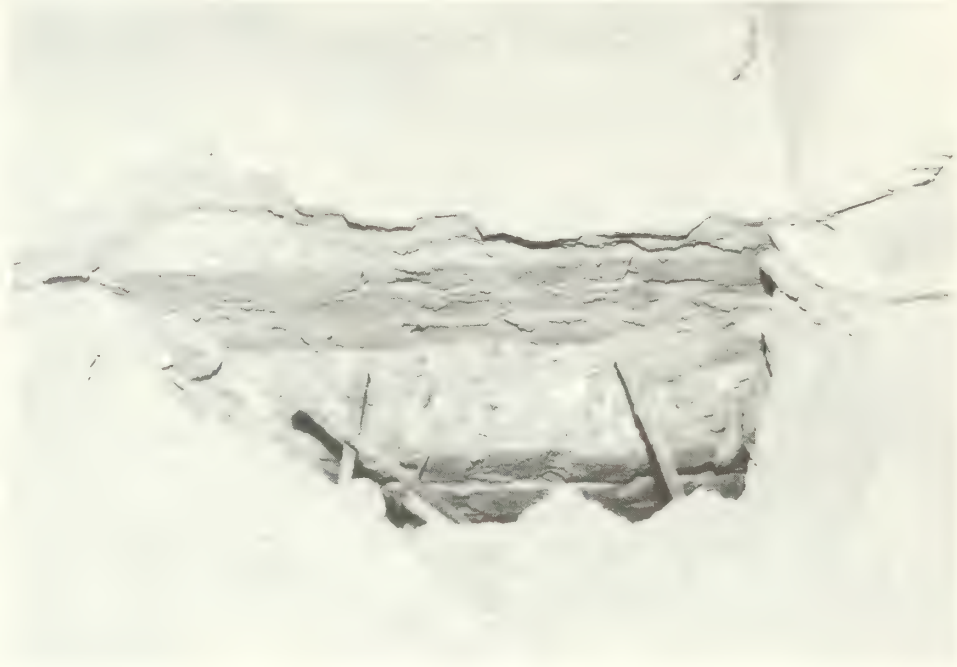

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 585

ROOM NO: H318 LAST KNOWN USE: Passage SQUARE FEET: 79.75 s.f. CEILING HEIGHT: 13'-2" DATE: 14 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [X] Vinyl [ ] Linoleum [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	9" Sq's.
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	Metal louvres in tops of doors.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	Suspended fixtures, globes extant
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents Fans [ ] Fixtures [X] Other: Electrical box	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [X] In Question	Electrical box on wall - 22"x60". (South)
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ ○ ○ ○	[X] **Good** [ ] **Fair** [ ] **Poor**	[ ] **1900-1906** [X] **1907-1923** [ ] **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [ ] Minor [X] Negligible

PHOTOGRAPHS: (1) View west

ROOM NO. H 318

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 587

ROOM NO: H319 LAST KNOWN USE: Passage SQUARE FEET: 444.55 s.f. CEILING HEIGHT: 13'-2" DATE: 14 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [X] Vinyl [ ] Linoleum [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	6"x9" Sq's.
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	12" h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [X] 1907-1923 [ ] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[X] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1906 [X] 1907-1923 [X] 1924-Present [ ] In Question	Metal louvres in tops of doors.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	5 suspended fixtures with globes.
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents Fans [ ] Fixtures [X] Other: None	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:	[ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	◯ ◯ ◯ ◯	[X] **Good** [ ] **Fair** [ ] **Poor**	[ ] **1900-1906** [ ] **1907-1923** [X] **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) View southwest (2) Floor, north end ROOM NO. H319

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING page: 589

ROOM NO: H320 LAST KNOWN USE: Passage SQUARE FEET: 386 s.f. CEILING HEIGHT: 13'-2" DATE: 14 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile [X] Vinyl [ ] Linoleum [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	6" + 9" sq's.
BASE:	[X] Wood [ ] Tile [ ] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	12"h.
WALLS:	[X] Plaster [ ] Gypsum Board [ ] Glazed Wood Partitions [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [X] 1924-Present [ ] In Question	Metal louvres in tops of doors.
LIGHTING:	[X] Incandescent [ ] Fluorescent [ ] Missing [ ] Other:	[X] Good 4 [ ] Fair [ ] Poor [X] Destroyed 1	[ ] Pre-1924 [ ] Post-1924 [ ] In Question	4 suspended fixtures w/ globes. 1 " " " destroyed.
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Fixtures [X] Other: None	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1906 [ ] 1907-1923 [ ] 1924-Present [ ] In Question	
SUMMARY:	○ ○ ○ ○ E B W S	[X] **Good** [ ] **Fair** [ ] **Poor**	[ ] **1900-1906** [ ] **1907-1923** [X] **1924-Present**	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor

PHOTOGRAPHS: (1) View north

ROOM NO. H320

ROOM NO: S01 LAST KNOWN USE: Staircase SQUARE FEET: 380/fl. CEILING HEIGHT: DATE: 23 Sept. 1983

DESCRIPTION:

General: Northwest tower stair system with 12 landings, serving 3 floors and the roof. Rectangular, winding stair surrounding open well. Access to stairs from Baggage and Dormitory Building at ground level, with height extending to the roof. Stair structure is cast iron with wrought iron railings and wood handrails.

Floor: Entrance landing is slate. First and third floor landings in 1¼" hexagonal white tile; second floor landing in red tile. The rest of the landings and stair steps are slate.

Base: Red tile on second floor landing; tile wainscot to 4' on third floor landing; slate base at all other landings. Cast iron base along stair stringers. Decorative iron brackets along base.

Walls: Plaster over terracotta block and brick with principle corners being curved. Mechanically pulled plaster dado molding throughout.

Ceiling: Plaster over terracotta blocks at ceilings of landings and top of stair tower.

Doors/ Openings: Openings to the main body of the building separated by galvanized metal double doors (with small windows) at all floors. The openings on the first and second stories were originally arched. The arches have been filled in with plaster and double doors, and they now appear as an indented arched enframement for the doors. Iron railings and wood handrails on the landings spanned these arched openings. These are still extant.

CONDITION:

Floor: Good condition.

Base: Good condition.

Walls: Overall condition is fair/poor. Certain areas are in good shape while other areas (particularly portions of the east and west walls) are destroyed. Molding largely intact.

Ceiling: Poor condition.

Doors/ Openings: Good condition. Iron railings are in good condition; one wood handrail is in good condition; the other is missing.

(continued)

SUMMARY:

E ○ B ○ W ○ C ○

[ ] Good
[X] Fair
[ ] Poor
[ ] Destroyed

[X] 1900-1906
[ ] 1907-1923
[ ] 1924-Present
[ ] In Question

ARCHITECTURAL SIGNIFICANCE:

[ ] Most
[X] Some
[ ] Minor
[ ] Negligible

PHOTOGRAPHS: 1. Stair tower from below 2. First floor landing, view north. **ROOM NO.** S01

ROOM NO: S01 LAST KNOWN USE: Staircase SQUARE FEET: 380/fl. CEILING HEIGHT: DATE: 23 Sept. 1983
Continued

DESCRIPTION:

Lighting: Ceiling mounted fixtures over each landing.

Heating: Two curved radiators located on first and second floor landings.

Misc.:
1. Wire mesh on third floor landing and along stair to roof. Mesh door.
2. Wrought iron railing; wood handrail.

CONDITION:

Lighting: All fixtures are missing or broken.

Heating: Radiators are in fair condition; some rust.

Misc.:
1. Mesh is rusted.
2. Railing and handrail along well are in good condition; railing and handrail along wall are missing except for flight between second and first floors.

SUMMARY:

F ○ B ○ W ○ C ○

	Good
X	Fair
	Poor
	Destroyed

X	1900-1906
	1907-1923
	1924-Present
	In Question

ARCHITECTURAL SIGNIFICANCE:

	Most
X	Some
	Minor
	Negligible

PHOTOGRAPHS: 3. Second floor landing, view north 4. Third floor landing, view north **ROOM NO.** S01

ROOM NO: S02 LAST KNOWN USE: Staircase SQUARE FEET: 380/fl. CEILING HEIGHT: DATE: 22 Sept. 1983

DESCRIPTION:

General: Southwest tower stair system with 12 landings, serving three floors and the roof. Rectangular, winding stair surrounding elevator shaft. Access to stairs from exterior at ground level, with height extending to roof. Stair structure is cast iron supported from outer walls with wrought iron railings. Elevator was added in 1910.

Floor: Entrance landing, first and third floor landings are all in 1¼" hexagonal white tile; second floor landing in red tile. The rest of the landings and stair steps are slate.

Base: Red tile on second floorlanding; tile wainscot to 4' on entry landing, first floor and third floor landings; composition base at all other landings; cast iron base along stair stringers; decorative iron brackets along base.

Walls: Plaster over terracotta blocks and brick with principle corners being curved. Mechanically pulled dado molding throughout.

Ceiling: Plaster over terracotta blocks at ceilings of landings and top of stair tower.

CONDITION:

Floor: Good condition.

Base: Some tile missing on first floor wainscot. Otherwise in good condition.

Walls: Major areas of west wall destroyed. Partially destroyed dado moldings. Other wall areas in fair condition.

Ceiling: Fair/poor condition.

(Continued)

SUMMARY:

F B W C

	Good
X	Fair
	Poor
	Destroyed

X	1900-1906
X	1907-1923
	1924-Present
	In Question

ARCHITECTURAL SIGNIFICANCE:

	Most
X	Some
	Minor
	Negligible

PHOTOGRAPHS: 1. First floor landing, view south 2. Second floor landing, view south **ROOM NO.** S02

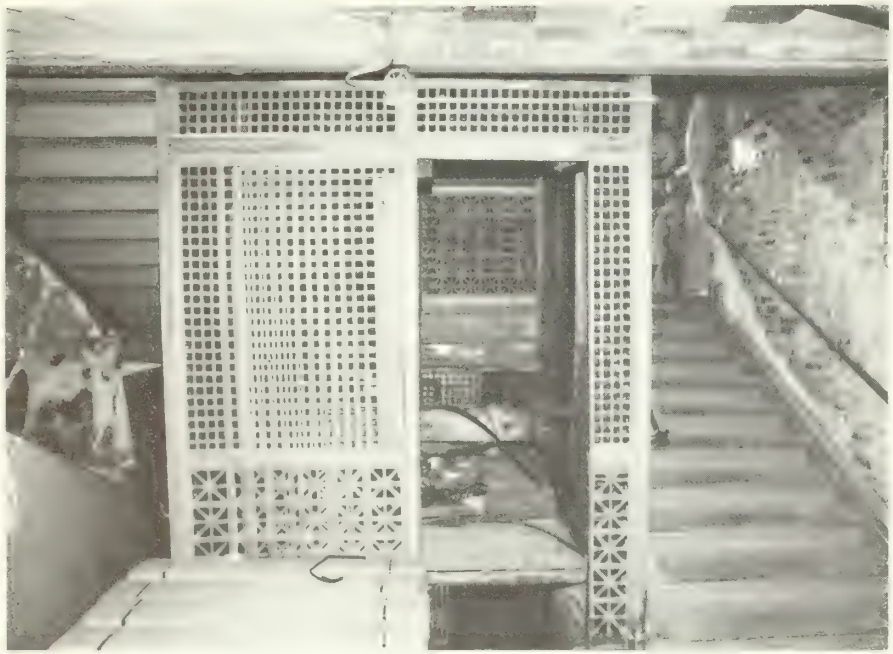

ROOM NO: S02 LAST KNOWN USE: Staircase SQUARE FEET: 380/fl. CEILING HEIGHT: DATE: 22 Sept. 1983
Continued

DESCRIPTION:

Doors/ Openings: Openings to the main body of the building separated by galvanized metal double doors (with small windows) at all floors. The openings on the first and second stories were originally arched. The first story arch has been filled in with plaster and double doors surmounted by a tympanum of glass blocks; the second story arch has been filled in with plaster and double doors. Iron railings and wood handrails on the landings spanned the arched openings. These are sill extant.

Lighting: Ceiling mounted fixtures over each landing.

Heating: Two curved radiators located on first and second floor landings.

Misc.:
1. Wire mesh on third floor landing and along stair to roof; mesh door.
2. Cast iron handrails.
3. Wrought iron elevator shaft. Decorative grille work.

CONDITION:

Doors/ Openings: Good condition. Iron railings and wood handrails are in good condition.

Lighting: All fixtures are missing.

Heating: Radiators are in fair condition.

Misc.:
1. Wire mesh is rusted in places.
2. Some sections of handrail missing on west wall.
3. Elevator shaft is in good condition. Rusted in places.

SUMMARY:	○ F ○ B ○ W ○ C						
			Good	X	1900-1906	ARCHITECTURAL SIGNIFICANCE:	Most
		X	Fair	X	1907-1923		Some
			Poor		1924-Present		Minor
			Destroyed		In Question		Negligible

PHOTOGRAPHS: 3. Third floor, looking south down stairs 4. Third floor landing, view northwest **ROOM NO.** S02

ROOM NO: S03 LAST KNOWN USE: Staircase SQUARE FEET: 380/fl. CEILING HEIGHT: DATE: 22 Sept. 1983

DESCRIPTION:

General: Northeast tower stair system with 12 landings, serving three floors and the roof. Rectangular, winding stair surrounding elevator shaft. Access to stairs from exterior at ground level, with height extending to roof. Stair structure is cast iron supported from outer walls by wooden handrails.

Floor: Entrance landing is slate. First and third floor landings in 1¼" hexagonal white tile; second floor landing in red tile. The rest of the landings and stair steps are slate.

Base: Red tile base at first and second story landings; white tile wainscot at third floor landing (4' high);composition base at other landings. Cast iron base along stair stringers. Decorative iron brackets along base.

Walls: Plaster over terracotta block and brick with principle corners being curved. Mechanically pulled plaster dado molding throughout.

Ceiling: Plaster over terracotta blocks at ceilings of landings and top of stair tower.

Doors/ Openings: Openings to the main body of the building separated by galvanized metal doors (with small windows) at all floors. The openings on the first and second stories were originally arched. The arches have been filled in with plaster and double doors, and they now appear as an indented arched enframement for the doors. Iron railings and wood handrails on the landings spanned this arched opening. These are still extant.

CONDITION:

Floor: Good condition.

Base: Good condition except for a section that is missing along the east wall where a pipe has been exposed.

Walls: Large areas or north and east walls are destroyed. Other wall surfaces are in good/ fair condition.

Ceiling: Most surfaces are destroyed.

Doors/ Openings: Good condition.

(continued)

SUMMARY: ○ E ○ R ○ W ○ C

- [ ] Good
- [X] Fair
- [ ] Poor
- [ ] Destroyed

- [X] 1900-1906
- [ ] 1907-1923
- [ ] 1924-Present
- [ ] In Question

ARCHITECTURAL SIGNIFICANCE:

- [ ] Most
- [X] Some
- [ ] Minor
- [ ] Negligible

PHOTOGRAPHS: 1. Ground floor entry from exterior, view southwest 2. First floor landing, view north **ROOM NO.** S03

ROOM NO: S03 LAST KNOWN USE: Staircase SQUARE FEET: 380/fl. CEILING HEIGHT: DATE: 22 Sept. 1983
Continued

DESCRIPTION:

Lighting: Ceiling mounted fixtures over each landing.

Heating: Two curved radiators located on the first and second floor landings.

Misc.:
1. Wire mesh on third floor landing and along stair to roof. Mesh door.
2. Wood handrails
3. Wrought iron elevator shaft. Decorative grillework.

Lighting: All fixtures are missing.

Heating: Radiators are in fair condition.

Misc.:
1. Wire mesh is rusted.
2. Handrails in good condition. Missing section at top of stairs on east and west walls.
3. Elevator shaft in good condition. Rusted in places.

SUMMARY:	○ E	○ B	○ W	○ C		Good	X	1900-1906	ARCHITECTURAL SIGNIFICANCE:		Most
					X	Fair		1907-1923		X	Some
						Poor		1924-Present			Minor
						Destroyed		In Question			Negligible

PHOTOGRAPHS: 3. Second floor landing, view north 4. Third floor, looking north down stair **ROOM NO.** S03

ROOM NO: S04 LAST KNOWN USE: Staircase SQUARE FEET: 380/fl. CEILING HEIGHT: DATE: 23 Sept. 1983

DESCRIPTION:

General: Southeast tower stair system with 12 landings, serving 3 floors and the roof. Rectangular, winding, stair surrounding open well. Access to stairs from exterior at ground level, with height extending to roof. Stair structure is cast iron, supported from outer walls with iron railings and wooden handrails.

Floor: Entrance landing in concrete; first and third floor landings in 1¼" hexagonal white tile; second floor landing in red tile. The rest of the landings and stair steps are slate.

Base: Composition base at all landings and cast iron base along stair stringers; decorative iron brackets along base.

Walls: Plaster over terracotta blocks and brick with principle corners being curved. Mechanically pulled plaster dado molding throughout.

Ceiling: Plaster over terracotta blocks at ceilings of landings and top of stair tower.

Doors/ Openings: Openings to the main body of the building separated by galvanized metal double doors (with small windows) at all floors. The openings on the first and second stories were originally arched. The arches have been filled in with plaster and double doors, and they now appear as an indented arched enframement for the doors. Iron railings and wood handrails on the landings spanned this arched opening. These are still extant.

Lighting: Ceiling mounted fixtures over each landing.

Heating: Two curved radiators located on first and second floor landing.

CONDITION:

Floor: Good condition.

Base: Good condition.

Walls: Summary condition is fair. Certain areas are in good shape while other areas (notably portions of the south & east walls are destroyed.

Ceiling: Overall condition is poor. Sections of plaster in various ceiling surfaces have been destroyed.

Doors/ Openings: Good condition. Iron rails and wood handrails are in good condition.

Lighting: All fixtures are missing.

Heating: Radiators are in fair condition.

(continued)

SUMMARY: ○ E ○ B ○ W ○ C

- [ ] Good
- [X] Fair
- [ ] Poor
- [ ] Destroyed

- [X] 1900-1906
- [ ] 1907-1923
- [ ] 1924-Present
- [ ] In Question

ARCHITECTURAL SIGNIFICANCE:

- [ ] Most
- [X] Some
- [ ] Minor
- [ ] Negligible

PHOTOGRAPHS: 1. Stair tower from below 2. Stair tower from above 3. First floor landing, view south. **ROOM NO.** S04

ROOM NO: S04 LAST KNOWN USE: Staircase SQUARE FEET: 380/fl. CEILING HEIGHT: DATE: 23 Sept. 1983
Continued

DESCRIPTION:

Misc.:
1. Wire mesh on third floor landing with mesh door leading to roof.
2. Wood handrails; wrought iron railing.
3. Glazed wood partition (later addition) on landing between first and second stories.

CONDITION:

Misc.:
1. Mesh is rusted.
2. Wood handrails in good condition along well; missing along wall.
3. Partition is in poor condition. Wood is splitting off; some glass missing.

SUMMARY:	○ E ○ B ○ W ○ C		Good	X	1900-1906	ARCHITECTURAL SIGNIFICANCE:		Most
		X	Fair		1907-1923		X	Some
			Poor		1924-Present			Minor
			Destroyed		In Question			Negligible

PHOTOGRAPHS: 4. Arched opening(filled in), over first floor doorway, view north.
5. Second floor landing, view south.
6. Third floor landing, view south.

ROOM NO. S04

PHOTOGRAPHS: 7. Niche, west wall, ground level entry 8. Newel post, first floor ROOM NO. S04

PHOTOGRAPHS: 9. Radiator, second floor

ROOM NO. S04

ROOM NO: S05 LAST KNOWN USE: Staircase SQUARE FEET: 36 s.f. CEILING HEIGHT: DATE: 23 Sept. 1983

DESCRIPTION:

General: Stair originally had two landings and served the first floor and the basement. Access was from Room 112A, adjacent to the Baggage Room. Cast iron stair structure with wood handrails.

Floor: Basement is concrete. Stair steps are cast iron; however, four original iron steps have been replaced with wood steps.

Base: Cast iron.

Walls: Plaster over terra cotta block.

Ceiling: Plaster over terra cotta block.

Misc.: Wood handrails on iron posts.

CONDITION:

General: Entry to the stairs on the first floor (Rm. 112A) has been filled in with terracotta blocks. The stair is no longer functional.

Floor: Good condition.

Base: Good condition.

Walls: Poor condition.

Ceiling: Destroyed.

Misc.: Good condition.

SUMMARY:	F B W C					ARCHITECTURAL SIGNIFICANCE:	
			Good	X	1900-1906		Most
		X	Fair		1907-1923		Some
			Poor		1924-Present		Minor
			Destroyed		In Question	X	Negligible

PHOTOGRAPHS: 1. Basement, view east

ROOM NO. S05

ROOM NO: S07 LAST KNOWN USE: Staircase SQUARE FEET: 48 s.f. CEILING HEIGHT: DATE: 23 Sept. 1983

DESCRIPTION:

General: Stair with 2 landings, serving the first floor and the basement. Access is from H112 on the first floor and from the east end of the basement. Stair structure is cast iron. Wood handrails are supported on iron posts.

Floor: Concrete on the landings. Cast iron stair steps.

Base: Cast iron.

Walls: Plaster over terracotta block.

Ceiling: Plaster over terracotta block.

Doors/ Openings: Wood panelled door. Opening has wire mesh. Entire door has vertical steel strips.

Lighting: Destroyed.

Misc.: Wood handrails.

CONDITION:

Floor: Good condition

Base: Good condition.

Walls: Good condition.

Ceiling: Good condition.

Doors/ Openings: Good condition.

Lighting: Good condition.

Misc.: Handrails are in good condition.

SUMMARY:

F B W C

X	Good
	Fair
	Poor
	Destroyed

X	1900-1906
	1907-1923
	1924-Present
	In Question

ARCHITECTURAL SIGNIFICANCE:

	Most
	Some
X	Minor
	Negligible

PHOTOGRAPHS: 1. First floor, view west 2. Door **ROOM NO.** S07

ROOM NO: S08 LAST KNOWN USE: Staircase SQUARE FEET: 150 s.f./ fl. CEILING HEIGHT: DATE: 22 Sept. 1983

DESCRIPTION:

General: Stair system with 9 landings, serving 3 stories in the west wing of the building. Stair between first and second stories dates from 1900. Stair between second and third stories was built when the third floor west wing was added in 1910. Rectangular, winding stair surrounding open well. Stair structure is cast iron with wrought iron railings and wooden handrails.

Floor: First floor landing in concrete, second floor landing in 1¼" hexagonal glazed ceramic tile, third floor landing in 2" hexagonal glazed ceramic tile. The rest of the landings and steps are slate.

Base: Tile wainscot on second and third floor landings. Concrete base on first floor landing. Cast iron base along stair stringers and on landing between second and third stories. Curvilinear brackets along base of the stairs.

Walls: Plaster over terra cotta block and brick. Mechanically pulled plaster dado molding throughout.

Ceiling: Plaster at ceilings of landings and stair tower and along underside of stairs.

Doors/ Openings: Openings to the building separated by single doors. The first floor has a galvanized metal door with a small window. The second floor door is missing. The third floor has 2 galvanized metal doors. The latter are imprinted with the numbers "17B" & "18" and have graffiti.

Lighting: Ceiling mounted fixtures.

Misc: 1. Wrought iron railing and wood handrails
2. Wire mesh with sliding gate on third floor landing.
3. Wire mesh with doors on second floor landing.

CONDITION:

General: Structure, railing and handrailing in good condition.

Floor: Good condition.

Base: Good condition.

Walls: The overall condition is fair. Third floor landing (H302) walls are in good condition.

Ceiling: The overall condition is poor. Third floor landing (H302) ceiling is in good condition.

Doors/ Openings: Fair condition. Second floor door missing.

Lighting: Two fixtures have glass shades; others are missing shades. A suspended fixture is also missing.

Misc: 1. Railing and handrail are in good condition.
2. Wire mesh is rusted; sliding gate is very corroded and difficult to move.
3. Wire mesh is rusted.

SUMMARY:	○ F ○ B ○ W ○ C		Good		1900-1906	ARCHITECTURAL SIGNIFICANCE:		Most
		X	Fair	X	1907-1923		X	Some
			Poor		1924-Present			Minor
			Destroyed		In Question			Negligible

PHOTOGRAPHS: 1. First floor landing; view north 2. Second floor, view south **ROOM NO.** S08

PHOTOGRAPHS: 3. Second floor landing, view north 4. Third floor landing; view southeast ROOM NO S08

PHOTOGRAPHS: 5. Third floor landing, (H302), view east 6. Graffiti on door, H302 **ROOM NO.** S08

ROOM NO: S09 LAST KNOWN USE: Staircase SQUARE FEET: 66 s.f. CEILING HEIGHT: DATE: 23 Sept. 1983

DESCRIPTION:		CONDITION:	
General:	Stair system with 5 landings, serving the first and second floors. Rectangular winding stair. Access to stairs from H106 and Room 219. Stair structure is cast iron with wrought iron railings and wood handrails.		
Floor:	First + second floor landings in 1¼" hexagonal white tile. Other landings and stair steps are slate. Top step is marble.	Floor:	Good condition.
Base:	Slate base at all landings and cast iron base along stair stringers. Decorative brackets along base.	Base:	Good condition.
Walls:	Plaster over terracotta blocks. Second floor tile wainscot continues to form upper half of stair wall at top of stairs.	Walls:	Generally in good condition. Basecoat is exposed in one medium-sized area. Tile in good condition.
Ceiling:	No ceiling at top of stair. Landings and underside of stair structure are covered with plaster.	Ceiling:	Plaster in good condition.
Doors/ Openings:	Glass panelled door on first floor. No door on second floor.	Doors/ Openings:	Fair condition.
Lighting:	Ceiling mounted fixtures on first floor. Wall mounted fixtures on landings.		
Misc:	Wrought iron railings and wood handrails. Handrails curved at corners.	Misc:	Railings and handrails in good condition.

SUMMARY:

F B W C

X	Good
	Fair
	Poor
	Destroyed

	1900-1906
X	1907-1923
	1924-Present
	In Question

ARCHITECTURAL SIGNIFICANCE:

	Most
X	Some
	Minor
	Negligible

PHOTOGRAPHS: 1. First floor landing, view west 2. Landing between floors, view east **ROOM NO.** S09

PHOTOGRAPHS 3. View from above (Rm. 219), looking west ROOM NO. S09

PHOTOGRAPHS:

ROOM NO.

ROOM NO: S11 LAST KNOWN USE: Staircase SQUARE FEET: 560 s.f. CEILING HEIGHT: DATE: 23 Sept. 1983

DESCRIPTION:

General: Wide stair between first and second floors with three landings. Access to stairs from H102 and H206. Stair structure is cast iron. Wood railings divide the stair into three sections.

Floors: First and second floor landings in red tile. Middle landing and stair steps are slate.

Base: Cast iron base along stairs.

Walls: Plaster over terracotta blocks. Wall with three doorways across middle landing. Mechanically pulled plaster dado molding.

Ceilings: Plaster over terracotta blocks. Ceiling is segmentally arched over part of top flight.

Doors/ Openings: Three galvanized metal doors with windows on middle landing.

Lighting: Ceiling mounted fixture on landing. Suspended fixture on second floor.

Misc: Wood railings and handrails. Appear to be a later alteration (1940's?). Wood along top of solid rail return on second floor.

CONDITION:

Floors: Good condition. Steps are filled in where notches were cut for original railing. Indentations on stairs from heavy wear.

Base: Good condition.

Walls: Good condition. However, dado molding is missing on first flight and middle landing.

Ceiling: Good condition.

Doors/ Openings: Good condition.

Misc: Railings and handrails in good condition.

SUMMARY:

○ F ○ B ○ W ○ C

X	Good
	Fair
	Poor
	Destroyed

X	1900-1906
	1907-1923
	1924-Present
	In Question

ARCHITECTURAL SIGNIFICANCE:

X	Most
	Some
	Minor
	Negligible

PHOTOGRAPHS: 1. First floor, view east 2. Second floor, view west **ROOM NO.** S11

ROOM NO: S15 LAST KNOWN USE: Staircase SQUARE FEET: 63 s.f. CEILING HEIGHT: DATE: 25 Aug. 1983

DESCRIPTION:

General: Stair with 3 landings, serving the second and third floors. Access to stairs from Rooms 223 & 303. Stair structure is cast iron with double wood handrails on walls. The stair dates from 1911 when the third west wing was constructed.

Floor: Landings and stair steps are slate.

Base: Cast iron base. Tile wainscot to a height of 7'.

Walls: Plaster over terra cotta blocks. Window to light court on south wall covered over.

Ceiling: Plaster.

Doors/ Openings: Openings separated by single doors: glass panelled on the second floor; galvanized metal on the third floor. The latter is imprinted with the number "18D" and has graffiti in Greek.

Lighting: Destroyed.

Misc.: Double wood handrails.

CONDITION:

Floor: Good condition.

Base: Good condition.

Walls: Poor condition.

Ceiling: Good condition.

Doors/ Openings: Fair condition.

Misc.: Lower north handrail is destroyed. Others are in good condition.

SUMMARY:

F B W C

	Good
X	Fair
	Poor
	Destroyed

	1900-1906
X	1907-1923
	1924-Present
	In Question

ARCHITECTURAL SIGNIFICANCE:

	Most
	Some
X	Minor
	Negligible

PHOTOGRAPHS: 1. Third floor, looking downstairs, view east 2. Graffiti on door, third floor **ROOM NO.** S15

ROOM NO: S16 LAST KNOWN USE: Staircase SQUARE FEET: 255 s.f. CEILING HEIGHT: DATE: 22 Sept. 1983

DESCRIPTION:

General: L-shaped stair with 5 landings, serving the second and third floors. Located at the east end of the Registry Room (230). Access from the Registry Room and the third floor south balcony (H313). Stair structure is wood. Installed post-1937.

Floor: Third floor balcony in hexagonal 1¼" tile. Registry Room in red tile. Landings and stair steps are wood.

Walls: Sides of stair are wood enclosed on west side and on east side of lower landing; east side of stair and both sides of lower flight have 5 planks of wood. Sides of stair are surmounted by a wood handrail.

CONDITION:

Floor: Good condition.

Walls: Sides of stairs are in good condition. Hand rail is in good condition.

SUMMARY:	F B W C				ARCHITECTURAL SIGNIFICANCE:	
		X	Good			Most
			Fair		1900-1906	Some
			Poor		1907-1923	X Minor
			Destroyed	X	1924-Present	Negligible
					In Question	

PHOTOGRAPHS: 1. View east from Registry Room 2. Lower flight, view northeast **ROOM NO.** S16

ELLIS ISLAND EXISTING CONDITION SURVEY MAIN BUILDING

ROOM NO: S22 LAST KNOWN USE: Stair SQUARE FEET: 246.5 s.f. CEILING HEIGHT: 14'-2" DATE: 14 Sept. 1983

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Vinyl	[X] Good	[X] 1924-Present	9" sq's.
BASE:	[X] Wood	[X] Poor	[X] 1907-1923	Major section missing on s. wall.
WALLS:	[X] Plaster	[X] Fair	[X] 1907-1923	
CEILING:	[X] Plaster	[X] Fair	[X] 1907-1923	
DOORS/ OPENINGS:	[X] Wood Veneer	[X] Fair	[X] 1907-1923 [X] 1924-Present	1 door has a metal louvre on top. Veneer doors - Inlay
LIGHTING:	[X] Incandescent [X] Other:	[X] Good [X] Destroyed	Pre-1924	2 suspended fixtures - 1 w/ globe 1 destroyed.
HEATING/ VENTILATION PLUMBING:	[X] Other: None			
MISCELLANEOUS:	[X] Wood stairs + handrail	[X] Good	[X] 1907-1923	5 steps
SUMMARY:	F B W C	[X] Fair	[X] 1907-1923	**ARCHITECTURAL SIGNIFICANCE:** [X] Minor

PHOTOGRAPHS: (1) View Southwest

ROOM NO. S22

This document was prepared for the United States Government, National Park Service, Denver Service Center, preparatory to development of preservation plans for the Main Building and as part of the A/E's technical services to the NPS.

The survey was conducted between August and November, 1983. Work was performed by the following staff members of Beyer Blinder Belle/Anderson Notter Finegold, Architects: Fred Wasserman conducted the survey and prepared the report; Donald Porter photographed the building; Ed Jenkins and Mark Stankard executed the architectural graphics.

BIBLIOGRAPHY
ELLIS ISLAND HISTORIC STRUCTURE REPORT
DOCUMENTATION

Prepared for the U.S. Department of Interior/National Park Service, Denver Service Center
by Beyer Blinder Belle/Notter Finegold Alexander

HISTORIC STRUCTURES REPORTS

Volume 1	The Main Building June 1, 1984	NPS D-41
Volume 2 Part One	Unit One Buildings December 1985	NPS D-42
Volume 2 Part Two	Unit One Buildings December 1985	NPS D-42
Volume 3	Powerhouse December 1985	NPS D-43
Volume 4 Part One	Units 2, 3 and 4 August 30, 1986	NPS D-44
Volume 4 Part Two	Units 2, 3 and 4 August 30, 1986	NPS D-44
Volume 4 Part Three	Units 2, 3 and 4 August 30, 1986	NPS D-44

EXISTING CONDITION SURVEYS

Volume 1 Appendix A	Main Building February 1, 1984	NPS D-41
Volume 2 Appendix D	Unit One Buildings July 1985	NPS D-42
Volume 3 Appendix A	Powerhouse December 1985	NPS D-43
Volume 4 Appendix A Part One	Units 2, 3 and 4 July 1986	NPS D-44
Volume 4 Appendix A Part Two	Units 2, 3 and 4 July 1986	NPS D-44

As the nation's principal conservation agency, the Department of the Interior has basic responsibilities to protect and conserve our land and water, energy and minerals, fish and wildlife, parks and recreation areas, and to ensure the wise use of all these resources. The department also has major responsibility for American Indian reservation communities and for people who live in island territories under U.S. administration.

Publication services were provided by the graphics staff of the Denver Service Center.
NPS D-41 September 1988

U S GOVERNMENT PRINTING OFFICE 1988—576-790 REGION NO 8